

Well Name: GALLEGOS CANYON UNIT	Well Location: T28N / R12W / SEC 19 / NENE / 36.65218 / -108.14682	County or Parish/State: SAN JUAN / NM
Well Number: 85	Type of Well: CONVENTIONAL GAS WELL	Allottee or Tribe Name:
Lease Number: NMSF078828A	Unit or CA Name: GCU DK 892000844F	Unit or CA Number: NMNM78391C
US Well Number: 3004513075	Well Status: Producing Gas Well	Operator: SIMCOE LLC

Notice of Intent

Sundry ID: 2653224

Type of Submission: Notice of Intent **Type of Action:** Casing

Date Sundry Submitted: 01/19/2022 **Time Sundry Submitted:** 09:47

Date proposed operation will begin: 04/18/2022

Procedure Description: Simcoe would like to do a casing repair. The casing repair procedure and a wellbore diagram are attached.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

- GCU_085_WBD_Reg_20220119094418.pdf
- GCU_085_Casing_Repair_20220119094348.pdf

Well Name: GALLEGOS CANYON UNIT	Well Location: T28N / R12W / SEC 19 / NENE / 36.65218 / -108.14682	County or Parish/State: SAN JUAN / NM
Well Number: 85	Type of Well: CONVENTIONAL GAS WELL	Allottee or Tribe Name:
Lease Number: NMSF078828A	Unit or CA Name: GCU DK 892000844F	Unit or CA Number: NMNM78391C
US Well Number: 3004513075	Well Status: Producing Gas Well	Operator: SIMCOE LLC

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: GINA DOERNER	Signed on: JAN 19, 2022 09:46 AM
Name: SIMCOE LLC	
Title: Regulatory Analyst	
Street Address: 1199 MAIN AVENUE SUITE 101	
City: DURANGO	State: CO
Phone: (970) 852-0082	
Email address: GINA.DOERNER@IKAVENERGY.COM	

Field Representative

Representative Name:		
Street Address:		
City:	State:	Zip:
Phone:		
Email address:		

BLM Point of Contact

BLM POC Name: KENNETH G RENNICK	BLM POC Title: Petroleum Engineer
BLM POC Phone: 5055647742	BLM POC Email Address: krennick@blm.gov
Disposition: Approved	Disposition Date: 01/27/2022
Signature: Kenneth Rennick	

SIMCOE LLC

CASING REPAIR PROCEDURE

GALLEGOS CANYON UNIT #085 – API 3004513075

990' FNL & 990' FEL – A SEC 19 T28N R12W

1. Hold pre-job safety meeting. Comply with all NMOCD, BLM safety, and environmental regulations. Test rig anchors prior to moving in rig if not rigged to base beam.
2. Check casing, tubing, and bradenhead pressures.
3. Remove existing piping on casing valve. RU blow lines from casing valves and begin blowing down casing pressure. Kill well as necessary. Ensure well is dead or on a vacuum.
4. ND wellhead and NU BOP. Function test BOP.
5. Pressure test tubing to 500 psi. If it holds pressure, pressure test casing.
6. TOOH w/ production tubing.
7. Test wellhead for communication between casing strings.
8. If pressure test fails, pick up tools and identify leak depth.
9. Once identified, rig up cement package and squeeze Class G cement as necessary.
10. Pick up bit and drill out cement.
11. Conduct MIT with NMOCD.
12. Unload well, retrieve any plugs and mill packer. TIH with 2 3/8" production tubing. RDMO.

GALLEGOS CANYON UNIT 085

DK

API # 30-045-13075

Unit A - Sec. 019 - T028N - R012W

990' FNL 990' FEL

San Juan, NM

Formation Tops

Fruitland	990'
Pictured Cliff	1428'
Lewis	1591'
Chacra	1980'
Cliff House	2370'
Menefee	3040'
Point Lookout	3910'
Mancos	4196'
Gallup	5095'
Greenhorn	5895'
Graneros	5960'
Two Wells	6000'
Paguate	6080'
Cubero	6122'

Logs

11/29-12/1/59 - SP/ILD f/ 300-6232'

Gallup Perforation


5417-29', 5436-52' 4 spf
 Frac w/ 40,000 gals oil & 60,000# snd
 2nd Frac w/ 14,000 gals oil & 20,000# snd

Dakota Perforation

6092-98', 6130-34' 6 spf
 Frac w/ 60,000 gals wtr & 50,000# 20/40 mesh
 & tail w/ 20,000# 10/20 mesh snd
 6005-15' 4 spf

Lewis 1591'
 Chacra 1980'
 Cliff House 2370'
 Menefee 3040'
 Point Lookout 3910'
 Mancos 4196'
 Gallup 5103'
 Greenhorn 5895'
 Two Wells 6000'
 Paguate 6080'

GL: 5685'

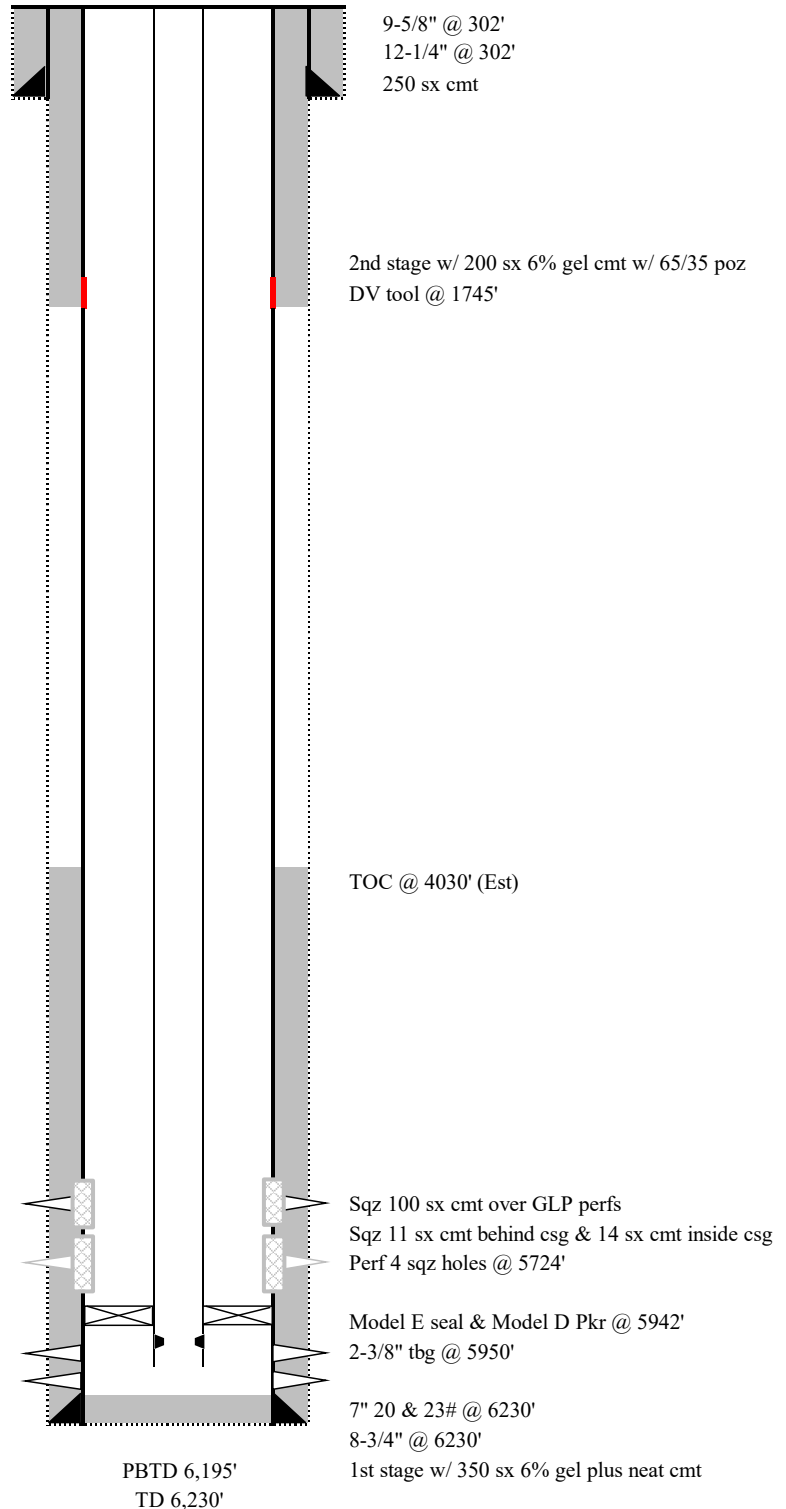

GALLEGOS CANYON UNIT 085

DK

API # 30-045-13075

Unit A - Sec. 019 - T028N - R012W

990' FNL 990' FEL

San Juan, NM

Formation Tops

Fruitland	990'
Pictured Cliff	1428'
Lewis	1591'
Chacra	1980'
Cliff House	2370'
Menefee	3040'
Point Lookout	3910'
Mancos	4196'
Gallup	5095'
Greenhorn	5895'
Graneros	5960'
Two Wells	6000'
Paguate	6080'
Cubero	6122'

Logs

11/29-12/1/59 - SP/ILD f/ 300-6232'

Gallup Perforation


5417-29', 5436-52' 4 spf
 Frac w/ 40,000 gals oil & 60,000# snd
 2nd Frac w/ 14,000 gals oil & 20,000# snd

Dakota Perforation

6092-98', 6130-34' 6 spf
 Frac w/ 60,000 gals wtr & 50,000# 20/40 mesh
 & tail w/ 20,000# 10/20 mesh snd
 6005-15' 4 spf

Lewis 1591'
 Chacra 1980'
 Cliff House 2370'
 Menefee 3040'
 Point Lookout 3910'
 Mancos 4196'
 Gallup 5103'
 Greenhorn 5895'
 Two Wells 6000'
 Paguate 6080'

GL: 5685'

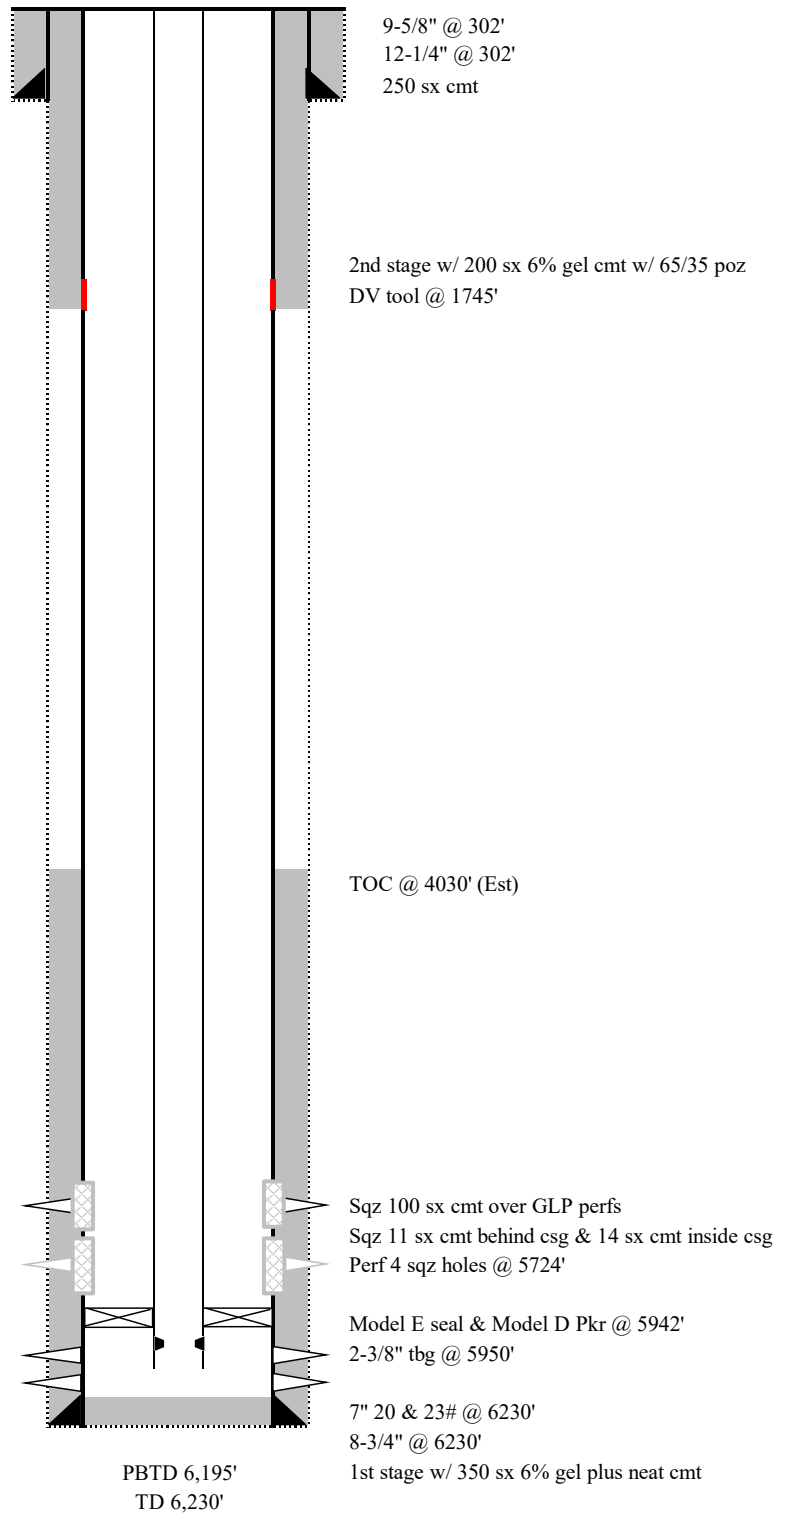

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 73433

CONDITIONS

Operator: SIMCOE LLC 1199 Main Ave., Suite 101 Durango, CO 81301	OGRID: 329736
	Action Number: 73433
	Action Type: [C-103] NOI Workover (C-103G)

CONDITIONS

Created By	Condition	Condition Date
dmcclure	Notify the Division at least 24 hours prior to cementing.	2/16/2022