

AFMSS

U.S. Department of the Interior  
BUREAU OF LAND MANAGEMENT**OPERATOR'S COPY****Sundry Print Report**

06/09/2022

<b>Well Name:</b> HAWK 8 D FEDERAL	<b>Well Location:</b> T18S / R27E / SEC 8 / NWNW /	<b>County or Parish/State:</b> EDDY / NM
<b>Well Number:</b> 46	<b>Type of Well:</b> OIL WELL	<b>Allottee or Tribe Name:</b>
<b>Lease Number:</b>	<b>Unit or CA Name:</b>	<b>Unit or CA Number:</b>
<b>US Well Number:</b> 300152830100X1	<b>Well Status:</b> Abandoned	<b>Operator:</b> REDWOOD OPERATING LLC

Accepted for record – NMOCD gc 6/28/2022

**Subsequent Report****Sundry ID:** 2675604**Type of Submission:** Subsequent Report**Date Sundry Submitted:** 06/08/2022**Date Operation Actually Began:** 05/27/2022**Type of Action:** Plug and Abandonment**Time Sundry Submitted:** 09:52

**RECEIVED**  
**JUN 22 2022**  
**MAILROOM**

**Actual Procedure:** 05/27/22 MIRU Plugging Equipment. ND well head, dug out cellar. 05/31/22 POH w/ rods & pump. ND well head, NU BOP. POH w/ tbq. Set 5 1/2 CIBP @ 2000'. Pressure tested csg, held 500 PSI. Spotted 50 sx class C cmt @ 2000'-1358'. WOC. 06/01/22 Tagged plug @ 1528'. Spotted 25 sx class C cmt w/ 2% CACL @ 1075-828'. ND BOP & WOC. Tagged plug @ 815'. Spotted 45 sx class C cmt @ 411' to surface. Rigged down & moved off. 06/03/22 Moved in backhoe and welder. Cut off well head & anchors. Roberta Thompson w/ BLM verified cmt @ surface via picture text message. Welded on "Above Ground Dry Hole Marker". Backfilled cellar, cut off deadmen, cleaned location, and moved off.

**SR Attachments****Actual Procedure**

Hawk\_8\_D\_Fed\_46\_\_Plugged\_WBD\_20220608095009.pdf

Hawk\_8\_D\_Fed\_46\_\_Current\_WBD\_20220608095009.pdf

Hawk\_8\_D\_Fed\_46\_\_Subsequent\_Report\_20220608095009.pdf

Reclamation Due 12-3-22

<b>Well Name:</b> HAWK 8 D FEDERAL	<b>Well Location:</b> T18S / R27E / SEC 8 / NWNW /	<b>County or Parish/State:</b> EDDY / NM
<b>Well Number:</b> 46	<b>Type of Well:</b> OIL WELL	<b>Allottee or Tribe Name:</b>
<b>Lease Number:</b>	<b>Unit or CA Name:</b>	<b>Unit or CA Number:</b>
<b>US Well Number:</b> 300152830100X1	<b>Well Status:</b> Abandoned	<b>Operator:</b> REDWOOD OPERATING LLC

**Operator**

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

**Operator Electronic Signature:** DELILAH FLORES**Signed on:** JUN 08, 2022 09:50 AM**Name:** REDWOOD OPERATING LLC**Title:** Regulatory Technician 1**Street Address:** 11344 LOVINGTON HWY**City:** ARTESIA**State:** NM**Phone:** (575) 748-1288**Email address:** DELILAH@MEC.COM**Field****Representative Name:****Street Address:****City:****State:****Zip:****Phone:****Email address:****BLM Point of Contact****BLM POC Name:** JAMES A AMOS**BLM POC Title:** Acting Assistant Field Manager**BLM POC Phone:** 5752345927**BLM POC Email Address:** jamos@blm.gov**Disposition:** Accepted**Disposition Date:** 06/09/2022**Signature:** James A. Amos

**Plug Abandonment  
Subsequent Report**


<b>OPERATOR NAME:</b>	Redwood Operating, LLC
<b>LEASE NO.:</b>	NMLC070678A
<b>WELL NAME &amp; NO.:</b>	Hawk 8 D Federal #46
<b>US WELL NUMBER:</b>	30-015-28301-00-S2
<b>LOCATION:</b>	Sec 8, T18S, R27E NWNW
<b>COUNTY:</b>	Eddy County, NM

05/27/22 MIRU Plugging Equipment. ND well head, dug out cellar. 05/31/22 POH w/ rods & pump. ND well head, NU BOP. POH w/ tbg. Set 5 1/2 CIBP @ 2000'. Pressure tested csg, held 500 PSI. Spotted 50 sx class C cmt @ 2000'-1358'. WOC. 06/01/22 Tagged plug @ 1528'. Spotted 25 sx class C cmt w/ 2% CACL @1075-828'. ND BOP & WOC. Tagged plug @ 815'. Spotted 45 sx class C cmt @ 411' to surface. Rigged down & moved off. 06/03/22 Moved in backhoe and welder. Cut off well head & anchors. Roberta Thompson w/ BLM verified cmt @ surface via picture text message. Welded on "Above Ground Dry Hole Marker". Backfilled cellar, cut off deadmen, cleaned location, and moved off.

Redwood Operating LLC		CURRENT	
Author:	Abby @ BCM	Well No.	#46
Well Name	Hawk 8 D Fed	API #:	30-015-28301
Field/Pool	Glorieta-Yeso	Location:	Sec 8, T18S, R27E
County	Eddy		
State	New Mexico		1090 FNL & 280 FWL
Spud Date	2/4/1995	GL:	3397' GL

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	8 5/8	J55	24#	1,025	12 1/4	550	0
Prod Csg	5 1/2	J55	15.5#	2,049	7 7/8	350	0

Formation	Top
Bowers	293
Queen	485
Grbg	890
Premier	1128
San Andres	1161
Glorieta	2525
Yeso	2658

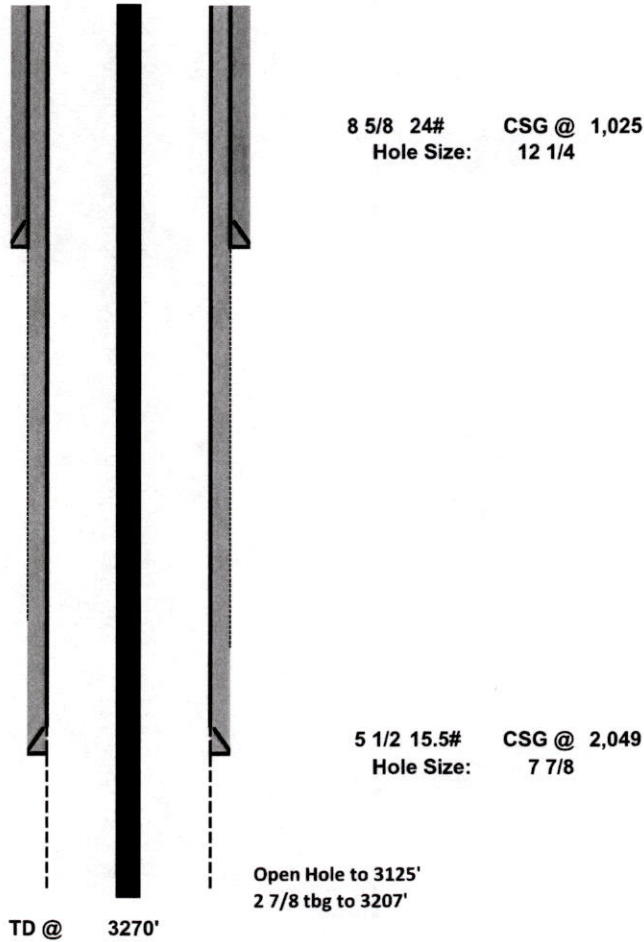

Redwood Operating LLC		PLUGGED	
Author:	Abby @ BCM	Well No.	#46
Well Name	Hawk 8 D Fed	API #:	30-015-28301
Field/Pool	Glorieta-Yeso	Location:	Sec 8, T18S, R27E
County	Eddy		
State	New Mexico		1090 FNL & 280 FWL
Spud Date	2/4/1995	GL:	3397' GL

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	8 5/8	J55	24#	1,025	12 1/4	550	0
Prod Csg	5 1/2	J55	15.5#	2,049	7 7/8	350	0

Formation	Top
Bowers	293
Queen	485
Grbg	890
Premier	1128
San Andres	1161
Glorieta	2525
Yeso	2658



3. Spotted 45 sx class C cmt @ 411' to surface.

8 5/8 24# CSG @ 1,025  
Hole Size: 12 1/4

2. Spotted 25 sx class C cmt w/ 2% CACL @1075-828'. ND BOP & WOC. Tagged plug @ 815'.

1. Set 5 1/2 CIBP @ 2000'. Pressure tested csg, held 500 PSI. Spotted 50 sx class C cmt @ 2000'-1358'. WOC & Tagged plug @ 1528'.

5 1/2 15.5# CSG @ 2,049  
Hole Size: 7 7/8

Open Hole to 3125'

TD @ 3270'

**District I**  
1625 N. French Dr., Hobbs, NM 88240  
Phone:(575) 393-6161 Fax:(575) 393-0720  
**District II**  
811 S. First St., Artesia, NM 88210  
Phone:(575) 748-1283 Fax:(575) 748-9720  
**District III**  
1000 Rio Brazos Rd., Aztec, NM 87410  
Phone:(505) 334-6178 Fax:(505) 334-6170  
**District IV**  
1220 S. St Francis Dr., Santa Fe, NM 87505  
Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

CONDITIONS

Action 120642

CONDITIONS

Operator: Redwood Operating LLC PO Box 1370 Artesia, NM 88210	OGRID: 330211
	Action Number: 120642
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	6/28/2022