

Well Name: CHOLLA 1 FED	Well Location: T18S / R31E / SEC 1 / SENE /	County or Parish/State: EDDY / NM
Well Number: 4	Type of Well: OIL WELL	Allottee or Tribe Name:
Lease Number: NMNM106718	Unit or CA Name:	Unit or CA Number:
US Well Number: 3001532834	Well Status: Abandoned	Operator: MATADOR PRODUCTION COMPANY

Accepted for record – NMOCD gc 9/7/2022

Subsequent Report

Sundry ID: 2689474

Type of Submission: Subsequent Report	Type of Action: Plug and Abandonment
Date Sundry Submitted: 08/29/2022	Time Sundry Submitted: 09:11
Date Operation Actually Began: 02/19/2022	

Actual Procedure: BLM Bond No.: NMB001079 Surety Bond No.: RLB0015172 2/19/22: MIRU WOR 2/21/22: Tag CIBP @ 8,549' TM; PU and spot 35 sx plug of Class "H" cmt on top of CIBP; WOC. 2/22/22: Tag TOC @ 7,989' TM; Pump 75 bbls of MLF (25 sxs/100 bbls) on top of cmt plug; POOH with tubing; MU 5-1/2" CIBP and set @ 5,844' TM; PU and spot 50 sxs Class "C" cmt on top of CIBP; WOC. 2/23/22: Tag TOC @ 5,394' TM; Circ well w/ MLF (25 sxs/100 bbls); Spot additional 25 sxs of Class "C" cmt at 5,394' TM; PU and spot a 35 sx balanced plug of Class "C" cmt @ 4,698' TM; WOC for 4 hrs; Tag TOC @ 4,311' TM; PU and spot an 80 sx balanced plug of Class "C" cmt @ 3,150' TM; WOC. 2/24/22: Tag TOC @ 2,241' TM; PU and spot a 25 sx balanced plug of Class "C" cmt @ 1,194' TM; WOC for 4 hrs; Tag TOC @ 940' TM. POOH w/ tubing. RIH and perf @ 453' TM; attempt to inject, pressure up to 500 psi, no injection with casing valves open; TIH & spot 55 sxs of Class "C" cmt at 503' TM; circulate cement to surface. 2/25/22: Dig out cellar; cut off wellhead 3' B.G.L.; top off well with 5 sxs Class "C" cmt; weld on steel plate & install dry hole marker per BLM/NMOCD standards. Spud Date: MIRU P&A equipment; 2/19/22 Rig Release Date: RDMO; 2/25/22

Received by OCD: 9/1/2022 1:55:00 PM

Page 2 of 4

Well Name: CHOLLA 1 FED	Well Location: T18S / R31E / SEC 1 / SENE /	County or Parish/State: EDDY / NM
Well Number: 4	Type of Well: OIL WELL	Allottee or Tribe Name:
Lease Number: NMNM106718	Unit or CA Name:	Unit or CA Number:
US Well Number: 3001532834	Well Status: Abandoned	Operator: MATADOR PRODUCTION COMPANY

SR Attachments

Actual Procedure

- Cholla_1_Federal_4_Cap_20220829091141.pdf
- Cholla_1_Federal_4_As_Plugged_WBD_20220829091133.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: BRETT JENNINGS	Signed on: AUG 29, 2022 09:11 AM
Name: MATADOR PRODUCTION COMPANY	
Title: Regulatory Analyst	
Street Address: 5400 LBJ FREEWAY, STE 1500	
City: DALLAS	State: TX
Phone: (972) 629-2160	
Email address: BRETT.JENNINGS@MATADORRESOURCES.COM	

Field

Representative Name:		
Street Address:		
City:	State:	Zip:
Phone:		
Email address:		


BLM Point of Contact

BLM POC Name: JAMES A AMOS	BLM POC Title: Acting Assistant Field Manager
BLM POC Phone: 5752345927	BLM POC Email Address: jamos@blm.gov
Disposition: Accepted	Disposition Date: 08/31/2022
Signature: James A. Amos	

Cholla 1 Federal #4
2260' FNL 400' FEL Sec. 1-T18S-R31E
Eddy County, NM
API: 30-015-32834

P&A WELLBORE SCHEMATIC (4/13/22)

Spudded: 8/6/2003

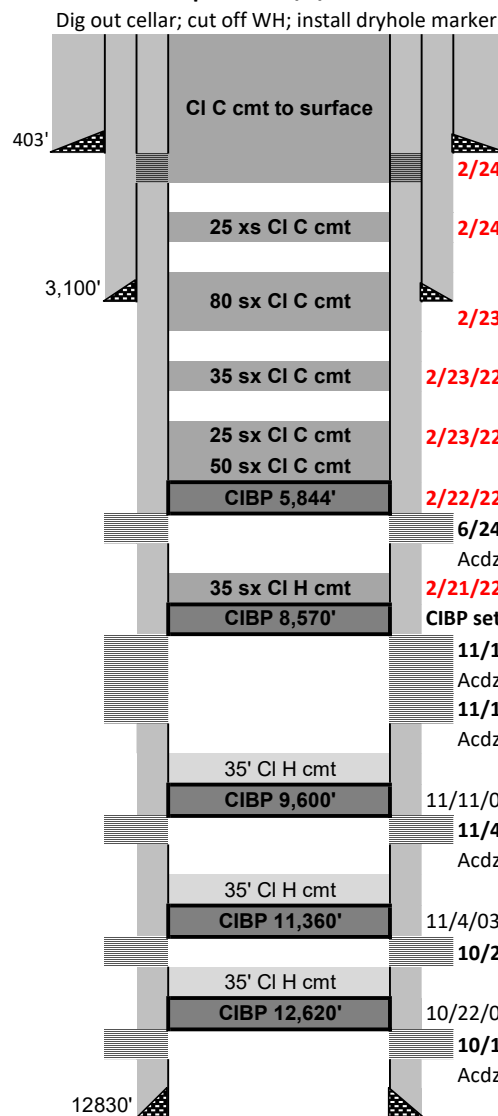

Casing Information					
Casing String	Casing Size	Weight lb/ft	Depth Set	Hole Size	Cementing Record
Surface	13 3/8"	48# H-40 & J-55	403'	17 7/8"	425 sx, circ'd
Intermediate	8 5/8"	32# J-55	3,100'	12 1/4"	1950 sx, circ'd
Production	5.5"	17# N-80 & P-110	12830'	7 7/8"	1920 sx, circ'd
		DV Tool @ 9346'			

2/24/22: Perf @ 453' (no injection), Spot 55 sxs CI C cmt @ 503' to surface

2/24/22: Spot 25 sx CI C cmt (Salt) @ 1,194' TM (TOC - 940' TM)

2/23/22: Spot 80 sx CI C cmt (7 Rivers & Yates) @ 3,150' TM (TOC - 2,241' TM)

2/23/22: Spot 35 sxs CI C cmt @ 4,698' (Delaware) (TOC - 4,311' TM)

2/23/22: Spot additional 25 sxs CI C cmt (Bone Spring) (No tag per BLM)

2/22/22: Set CIBP @ 5,844' & Spot 50 sxs CI C cmt (Bone Spring) (TOC - 5,394' TM)

6/24/04: Perf'd upper BS 5,894' - 5,944'

Acdz w/9000 gal 15% NEFE

2/21/22: Spot 35 sx CI H cmt on top of existing CIBP (TOC - 7,989' TM)

CIBP set @ 8,570' to protect from offset frac

11/15/03: Perf'd 2nd BS 8,646' - 8,655'

Acdz w/ 3000 gal 15% NEFE & frac w/ 79k# 20/40

11/11/03: Perf'd 2nd BS 8,802' - 8,836'

Acdz w/ 4000 gal 15% NEFE

11/11/03: CIBP set @ 9,600' w/ 35' CI H cmt

11/4/03: Perf'd WC 9,640' - 9,655'

Acdz w/ 3000 gal 15% NEFE

11/4/03: CIBP set @ 11,360' w/ 35' CI H cmt

10/22/03: Perf'd Strawn 11,425' - 11,560'

10/22/03: CIBP set @ 12,620' w/ 35' CI H cmt

10/17/03: Perf'd Morrow 12,665' - 12,677'

Acdz w/ 1000 gal 7.5% HCl

Geologic Markers	
Rustler	949
Yates	2450
Seven Rivers	2811
Queen	3513
Grayburg	4016
San Andres	4476
Delaware	4648
Bone Spring	5450
1st BS	7561
2nd BS	8224
3rd BS Sand	8878
Wolfcamp	9249
Penn Shale	10600
Strawn	11377
Atoka	11750
Morrow	12372

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 140247

CONDITIONS

Operator: MATADOR PRODUCTION COMPANY One Lincoln Centre Dallas, TX 75240	OGRID: 228937
	Action Number: 140247
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	9/7/2022