


District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

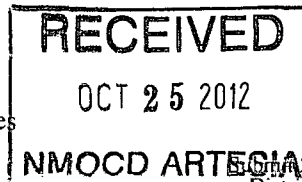

Form C-141
Revised October 10, 2003
Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

nJMW1231139384 OPERATOR ☒ Initial Report ☐ Final Report

Name of Company	COG OPERATING LLC 229137	Contact	Pat Ellis
Address	550 W. Texas, Suite 100, Midland, TX 79701	Telephone No.	432-230-0077
Facility Name	GJ West Coop Trunkline	Facility Type	Steel Flowline

Surface Owner	State	Mineral Owner		Lease No. (API#)	30-015-25492
				Wells tied into trunkline	30-015-03163

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
B	28	17S	29E					Eddy

Latitude 32.8101 Longitude 104.0761

NATURE OF RELEASE

Type of Release	Produced water w/ skim oil	Volume of Release	7bbls	Volume Recovered	5bbls
Source of Release	Steel line	Date and Hour of Occurrence	10/09/2012	Date and Hour of Discovery	10/09/2012 11:30 a.m.
Was Immediate Notice Given?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No <input checked="" type="checkbox"/> Not Required	If YES, To Whom?			
By Whom?	Date and Hour				
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.			
If a Watercourse was Impacted, Describe Fully.*					
Describe Cause of Problem and Remedial Action Taken.*					
Due to corrosion, a hole developed in a steel flowline causing the release of fluid. A temporary clamp has been installed on the clamp until the line can be replaced.					
Describe Area Affected and Cleanup Action Taken.*					
Initially 7bbls of produced fluids were released from the corroded line and we were able to recover 5bbls with a vacuum truck. Tetra Tech will sample the spill site area to delineate any possible contamination from the release and we will present a remediation work plan to the NMOCD for approval prior to any significant remediation work.					
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.					
Signature:		OIL CONSERVATION DIVISION			
Printed Name: Josh Russo		Approved by District Supervisor: Signed By			
Title: HSE Coordinator		Approval Date: NOV 06 2012		Expiration Date:	
E-mail Address: jrusso@conchoresources.com		Conditions of Approval:		Attached <input type="checkbox"/>	
Date: 10/24/2012 Phone: 432-212-2399					

* Attach Additional Sheets If Necessary

Remediation per OCD Rules &
Guidelines. **SUBMIT REMEDIATION
PROPOSAL NOT LATER THAN:**

Dec. 6, 2012

2RP-1387

Bratcher, Mike, EMNRD

From: Joshua Russo <jrusso@concho.com>
Sent: Thursday, October 25, 2012 11:23 AM
To: Bratcher, Mike, EMNRD
Cc: Ike Tavaréz (ike.tavaréz@tetrattech.com); Robert Grubbs (Robert.Grubbs@tetrattech.com); Tom Franklin (tom.k.franklin@tetrattech.com)
Subject: C-141 Initial Report - GJ WEST COOP UNIT TRUNKLINE
Attachments: GJ WEST COOP UNIT TRUNKLINE (#74 AND #125) -- DATE OF RELEASE -- 10-09-2012.pdf

Mr. Bratcher,

Please see attached the C-141 Initial Report for a release that occurred at our GJ West Coop Lease. We plan to sample the spill area timely.

Thank you,

Joshua Russo

Sr. Environmental Coordinator

432.683.7443 (main)

432.685.4381 (direct)

432.212.2399 (cell)

jrusso@concho.com

Mailing Address:

One Concho Center

600 W. Illinois Avenue

Midland, Texas 79701



CONFIDENTIALITY NOTICE: The information in this email may be confidential and/or privileged. If you are not the intended recipient or an authorized representative of the intended recipient, you are hereby notified that any review, dissemination or copying of this email and its attachments, if any, or the information contained herein, is prohibited. If you have received this email in error, please immediately notify the sender by return email and delete this email from your system. Thank you.