

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

NM OIL CONSERVATION

ARTESIA DISTRICT

NOV 20 2017

Submit 1 Copy to appropriate District Office in accordance with 19.15.29 NMAC.

RECEIVED

Form C-141
Revised August 8, 2011

Release Notification and Corrective Action

OPERATOR

X Initial Report

Final Report

Name of Company: Burnett Oil Co., Inc.	3080	Contact: Johnny Titsworth
Address: Burnett Plaza-Site 1500, 801 Cherry St-Unit 9, Fort Worth, TX 76102		Telephone No. (432) 425-2891
Facility Name Jackson B 5 TB		Facility Type Tank Battery

Surface Owner: BLM	Mineral Owner: BLM	API No. 30-015-36146
--------------------	--------------------	---------------------------------

LOCATION OF RELEASE

30-015-41191
JACKSON B 65

Unit Letter P	Section 1	Township 17S	Range 30E	Feet from the 1145	North/South Line FSL	Feet from the 1283	East/West Line FEL	County Eddy
------------------	--------------	-----------------	--------------	-----------------------	-------------------------	-----------------------	-----------------------	----------------

Latitude: 32.85965 Longitude: -103.92107

NATURE OF RELEASE

Type of Release: oil/pw	Volume of Release: 8/47	Volume Recovered: 5/45
Source of Release: Flare Stack	Date and Hour of Occurrence: 11/17/17 6:00 am	Date and Hour of Discovery 11/17/17 7:00 am
Was Immediate Notice Given? X Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? BLM - S. Tucker NMOCD - M. Bratcher	
By Whom? Johnny Titsworth	Date and Hour: 10/20/17 2:30 pm	
Was a Watercourse Reached? <input type="checkbox"/> Yes X No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*
N/A

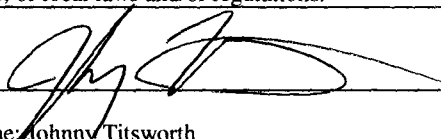


Describe Cause of Problem and Remedial Action Taken.*

Steel pipe running from water tanks to transfer pump corroded and released oil and produced water. The pipe has been replaced and is back in service

Describe Area Affected and Cleanup Action Taken.*

The release area is approximately 65' x 2' and 40' x 25'. The footprint is completely within the facility berm. The area will be remediated to regulatory standards

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Johnny Titsworth	Approved by Environmental Specialist: 	
Title: HSE Coordinator	Approval Date: 11/28/17	Expiration Date: N/A
E-mail Address: jtitsworth@burnettoil.com	Conditions of Approval:  See Attached	
Date: 11/17/17 Phone: (432) 425-2891	Attached <input type="checkbox"/> ARP-4495	

* Attach Additional Sheets If Necessary

11/27/17 AB

Operator/Responsible Party,

The OCD has received the form C-141 you provided on 11/20/2017 regarding an unauthorized release. The information contained on that form has been entered into our incident database and remediation case number ARP-4495 has been assigned. **Please refer to this case number in all future correspondence.**

It is the Division's obligation under both the Oil & Gas Act and Water Quality Act to provide for the protection of public health and the environment. Our regulations (19.15.29.11 NMAC) state the following,

The responsible person shall complete division-approved corrective action for releases that endanger public health or the environment. The responsible person shall address releases in accordance with a remediation plan submitted to and approved by the division or with an abatement plan submitted in accordance with 19.15.30 NMAC. [emphasis added]

Release characterization is the first phase of corrective action unless the release is ongoing or is of limited volume and all impacts can be immediately addressed. Proper and cost-effective remediation typically cannot occur without adequate characterization of the impacts of any release. Furthermore, the Division has the ability to impose reasonable conditions upon the efforts it oversees. **As such, the Division is requiring a workplan for the characterization of impacts associated with this release be submitted to the OCD District 2 office in ARTESIA on or before 12/20/2017. If and when the release characterization workplan is approved, there will be an associated deadline for submittal of the resultant investigation report. Modest extensions of time to these deadlines may be granted, but only with acceptable justification.**

The goals of a characterization effort are: 1) determination of the lateral and vertical extents along with the magnitude of soil contamination. 2) determine if groundwater or surface waters have been impacted. 3) If groundwater or surface waters have been impacted, what are the extents and magnitude of that impact. 4) The characterization of any other adverse impacts that may have occurred (examples: impacts on vegetation, impacts on wildlife, air quality, loss of use of property, etc.). To meet these goals as quickly as possible, the following items must, at a minimum, be addressed in the release characterization workplan and subsequent reporting:

- Horizontal delineation of soil impacts in each of the four cardinal compass directions. Adsorbed soil contamination must be characterized for the following constituents using the associated laboratory methods: benzene, toluene, ethylbenzene, and total xylenes by either Method 8260 or 8021, total petroleum hydrocarbons by Method 8015 extended range (GRO+DRO+MRO; C₆ thru C₃₆), and for chloride by Method 300. This is not an exclusive list of potential contaminants. Analyzed parameters should be modified based on the nature of the released substance(s). Soil sampling must be both within the impacted area and beyond.

- Vertical delineation of soil impacts. Adsorbed soil contamination must be characterized for the following constituents using the associated laboratory methods: benzene, toluene, ethylbenzene, and total xylenes by either Method 8260 or 8021, total petroleum hydrocarbons by Method 8015 extended range (GRO+DRO+MRO; C₆ thru C₃₆), and for chloride by Method 300. As above, this is not an exclusive list of potential contaminants and can be modified. Vertical characterization samples should be taken at depth intervals no greater than five feet apart. Lithologic description of encountered soils must also be provided. At least ten vertical feet of soils with contaminant concentrations at or below these values must be demonstrated as existing above the water table.

- Nominal detection limits for field and laboratory analyses must be provided.

- Composite sampling is not generally allowed.

- Field screening and assessment techniques are acceptable (headspace, titration, EC [include algorithm for validation purposes], EM, etc.), but the sampling and assay procedures must be clearly defined. Copies of field notes are highly desirable. A statistically significant set of split samples must be submitted for confirmatory laboratory analysis, including the laterally farthest and vertically deepest sets of soil samples. Make sure there are at least two soil samples submitted

for laboratory analysis from each borehole or test pit (highest observed contamination and deepest depth investigated). Copies of the actual laboratory results must be provided including chain of custody documentation.

- Probable depth to shallowest protectable groundwater and lateral distance to nearest surface water. If there is an estimate of groundwater depth, the information used to arrive at that estimate must be provided. If there is a reasonable assumption that the depth to protectable water is 50 feet or less, the responsible party should anticipate the need for at least one groundwater monitoring well to be installed in the area of likely maximum contamination.

- If groundwater contamination is encountered, an additional investigation workplan may be required to determine the extents of that contamination. Groundwater and/or surface water samples, if any, must be analyzed by a competent laboratory for volatile organic hydrocarbons (typically Method 8260 full list), total dissolved solids, pH, major anions and cations including chloride and sulfate, dissolved iron, and dissolved manganese. The investigation workplan must provide the groundwater sampling method(s) and sample handling protocols. To the fullest extent possible, aqueous analyses must be undertaken using nominal method detection limits. As with the soil analyses, copies of the actual laboratory results must be provided including chain of custody documentation.

- Accurately scaled and well-drafted site maps must be provided providing the location of borings, test pits, monitoring wells, potentially impacted areas, and significant surface features including roads and site infrastructure that might limit either the release characterization or remedial efforts. Field sketches may be included in subsequent reporting, but should not be considered stand-alone documentation of the site's layout. Digital photographic documentation of the location and fieldwork is recommended, especially if unusual circumstances are encountered.

Nothing herein should be interpreted to preclude emergency response actions or to imply immediate remediation by removal cannot proceed as warranted. Nonetheless, characterization of impacts and confirmation of the effectiveness of remedial efforts must still be provided to the OCD before any release incident will be closed.

Jim Griswold

OCD Environmental Bureau Chief

1220 South St. Francis Drive

Santa Fe, New Mexico 87505

505-476-3465

jim.griswold@state.nm.us

Bratcher, Mike, EMNRD

From: Johnny Titsworth <jtitsworth@burnettoil.com>
Sent: Monday, November 20, 2017 11:29 AM
To: Tucker, Shelly; Bratcher, Mike, EMNRD; Weaver, Crystal, EMNRD
Cc: Kyle Adams; Leslie Garvis
Subject: Jackson B 5 Tank Battery
Attachments: JB 5 initial C-141 11.17.17.doc

All

Attached is the C-141 for the Jackson B 5 TB release. I am unable to send in a signed copy at this time, I am having printer difficulties. Once we have collected samples, a work plan will be submitted. If there are any questions or concerns, feel free to contact us. thanks

Johnny Titsworth
HSE COORDINATOR

BURNETT OIL CO., INC.
P.O. Box 188
CR 220 North
Loco Hills, NM 88255
MOBILE: (432)-425-2891
EMAIL: jtitsworth@burnettoil.com

This message is intended only for the person(s) to which it is addressed and may contain privileged, confidential and/or insider information. If you have received this communication in error, please notify us immediately by replying to the message and deleting it from your computer. Any disclosure, copying, distribution, or the taking of any action concerning the contents of this message and any attachment(s) by anyone other than the named recipient(s) is strictly prohibited.

Bratcher, Mike, EMNRD

From: Johnny Titsworth <jtitsworth@burnettoil.com>
Sent: Monday, November 20, 2017 9:50 AM
To: Bratcher, Mike, EMNRD; Weaver, Crystal, EMNRD; Tucker, Shelly
Cc: Kyle Adams; Leslie Garvis
Subject: Jackson B 5 TB

All

On 11/17/17, we had a release at the Jackson B 5 TB. The release was 100% contained within the facility berm. Once the release footprint has been sampled a work plan will be submitted for approval. If there are any questions or concerns, feel free to contact us. Thank you.

Johnny Titsworth
HSE COORDINATOR

BURNETT OIL CO., INC.
P.O. Box 188
CR 220 North
Loco Hills, NM 88255
MOBILE: (432)-425-2891
EMAIL: jtitsworth@burnettoil.com

This message is intended only for the person(s) to which it is addressed and may contain privileged, confidential and/or insider information. If you have received this communication in error, please notify us immediately by replying to the message and deleting it from your computer. Any disclosure, copying, distribution, or the taking of any action concerning the contents of this message and any attachment(s) by anyone other than the named recipient(s) is strictly prohibited.