

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

☒ Initial Report ☒ Final Report

Name of Company: Targa Midstream Services LLC	Contact: Randy Duncan
Address: P.O. Box 67, Monument, NM 88265	Telephone No.: 575 393 2823
Facility Name: Monument Plant	Facility Type: Gas Processing

Surface Owner: State of New Mexico	Mineral Owner	Lease No.:
------------------------------------	---------------	------------

LOCATION OF RELEASE

Unit Letter H	Section 14	Township 19S	Range 36E	Feet from the 1511'	North/South Line NORTH	Feet from the 1020'	East/West Line EAST	County LEA
------------------	---------------	-----------------	--------------	------------------------	---------------------------	------------------------	------------------------	---------------

Latitude: 32.663599

Longitude: -103.319654

NATURE OF RELEASE

Type of Release: PRODUCED WATER	Volume of Release: APPROX 30BBLS	Volume Recovered: APPROX 30BBLS
Source of Release: UNMARKED 4" A/C TRANSITE	Date and Hour of Occurrence: 8-3-11 10AM	Date and Hour of Discovery: 8-3-11 10AM
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? E. Gonzales / J. Leking	
By Whom? Todd Young	Date and Hour: 8/3/11 11AM	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.*

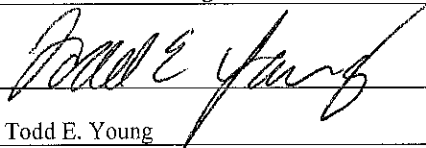
Watson Const. cutting trench for new gas line, cut across unmarked 4" a/c transite pipeline. One-Call was made. Producer was not a member of one call and didn't receive notice. Producer did not know where line was (no markers).

Water truck called in and arrived within 30min. water was vacuumed up immediately and disposed of properly. Crew excavated saturated trench material, set aside for sampling.

Describe Area Affected and Cleanup Action Taken.*

CLEAN UP ACTION: Trench area of leak was excavated, excavated material set aside for sampling. Whole Earth Environmental Inc. contracted by Targa for sampling and setting up delineation of site. Samples will be sent to Cardinal Labs for confirmation.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	<u>OIL CONSERVATION DIVISION</u>	
Printed Name: Todd E. Young	Approved by District Supervisor:	
Title: Monument Area Manager	Approval Date:	Expiration Date:
E-mail Address: tyoung@targaresources.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: 8/8/11 Phone: 575-393-2823 234		

* Attach Additional Sheets If Necessary

11/23/2011 G.L. approved backfill/assume closure needs met this date
Bradford Billings 2/24/2020