


Excavation Data

5 pt bottom composite of 6 inch scrape	Cl-	PID	GRO	DRO	B	T	E	X	BTEX
	<16	1.2	<10	<10	<0.05	<0.05	<0.05	<0.15	<0.3
5 pt bottom composite of 1.5 ft excavation	Cl-	PID	GRO	DRO	B	T	E	X	BTEX
	<16	0.7	<10	<10	<0.05	<0.05	<0.05	<0.15	<0.3
5 pt bottom composite of 4 ft excavation	Cl-	PID	GRO	DRO	B	T	E	X	BTEX
	<16	0.08	<10	<10	<0.05	<0.05	<0.05	<0.15	<0.3
5 pt composite of spoil pile	Cl-	PID	GRO	DRO	B	T	E	X	BTEX
	240	4.8	<10	48.9	<0.05	<0.05	<0.05	<0.15	<0.3

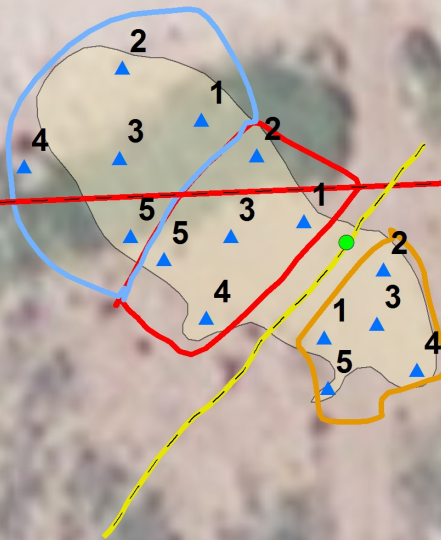

Legend


- ▲ SAMPLE POINT
- ⚡ DEADMAN
- ⚡ ELECTRIC POLE
- ELECTRICAL BOX
- VERTICAL PIPE 1FT
- WELLHEAD
- BURIED PIPELINE
- OVERHEAD ELECTRIC LINE
- PAD/ROAD EDGE
- SURFACE ELECTRIC
- SURFACE PIPELINE
- 1.5' EXCAVATION
- 4' EXCAVATION
- 6" SCRAPE
- PUMPJACK
- STAIN (2,103 sq ft)

Landowner: BLM
Groundwater: None



**LINN H E
WEST B #58**

UL G SECTION 10
T-17-S R-31-E
EDDY COUNTY, NM

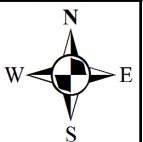

0 25 50
Feet

GPS date: 9/2/14 BC, 10/28/14
Drawing date: 10/30/14
Drafted by: T. Grieco, L. Weinheimer