


District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

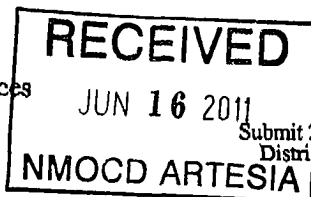

Form C-141
Revised October 10, 2003
Submit 2 Copies to appropriate District Office in accordance with Rule 116 on back side of form

Release Notification and Corrective Action

NMLB 1122236644

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company Yates Petroleum Corporation	OGRID Number 25575	Contact Robert Asher
Address 105 S. 4 TH Street	Telephone No. 575-748-1471	
Facility Name Perdomo BMP State Com. #1	API Number 30-015-36499	Facility Type Water Line
Surface Owner State	Mineral Owner State	Lease No. VB-827 & VO-5867

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
L	24	24S	27E	1650	South	660	West	Eddy

Latitude 32.20029 Longitude 104.15024

NATURE OF RELEASE

Type of Release Produced Water	Volume of Release 100 B/PW	Volume Recovered 90 B/PW
Source of Release Poly line	Date and Hour of Occurrence 6/9/2011; PM	Date and Hour of Discovery 6/9/2011; PM
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Mike Bratcher/NMOCD II	
By Whom? Bob Asher/Yates Petroleum Corporation	Date and Hour 6/10/2011; AM	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse. N/A	
If a Watercourse was Impacted, Describe Fully.* N/A		
Describe Cause of Problem and Remedial Action Taken.* 8" poly line ruptured on a welded fuse, possibly due to an increase in main line pressure. Valves were isolated on the main waterline. Vacuum truck called.		
Describe Area Affected and Cleanup Action Taken.* An approximate area of 20' X 300' (Cigarillo SWD main line, approximately 0.4 miles west of Perdomo Battery). Remaining produced water recovered. Vertical and horizontal delineation samples will be taken and analysis ran for TPH & BTEX (chlorides for documentation). If initial analytical results for TPH & BTEX are under RRAL's (site ranking is 10) a Final Report, C-141 will be submitted to the OCD requesting closure. If the analytical results are above the RRAL a work plan will be submitted to the OCD. Depth to Ground Water: 50-99' (70", Section 22, T24S-R27E, NMOSE), Wellhead Protection Area: No, Distance to Surface Water Body: > 1000', SITE RANKING IS 10.		
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.		

OIL CONSERVATION DIVISION

Signature: *Robert Asher*

Printed Name: Robert Asher

Title: Senior Environmental Regulatory Agent

E-mail Address: boba@yatespetroleum.com

Date: Thursday, June 16, 2011 Phone: 575-748-4021

Signed By *Mike Bratcher*
Approved by District Supervisor:

Approval Date: AUG 10 2011

Expiration Date:

Conditions of Approval:

Attached ☐

Remediation per OCD Rules & Guidelines. **SUBMIT REMEDIATION PROPOSAL NOT LATER THAN:**

9/10/2011

2RP-820

* Attach Additional Sheets If Necessary