
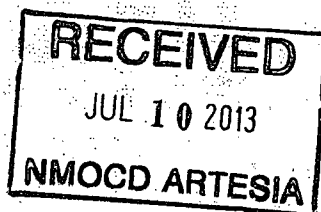


30-015-10182

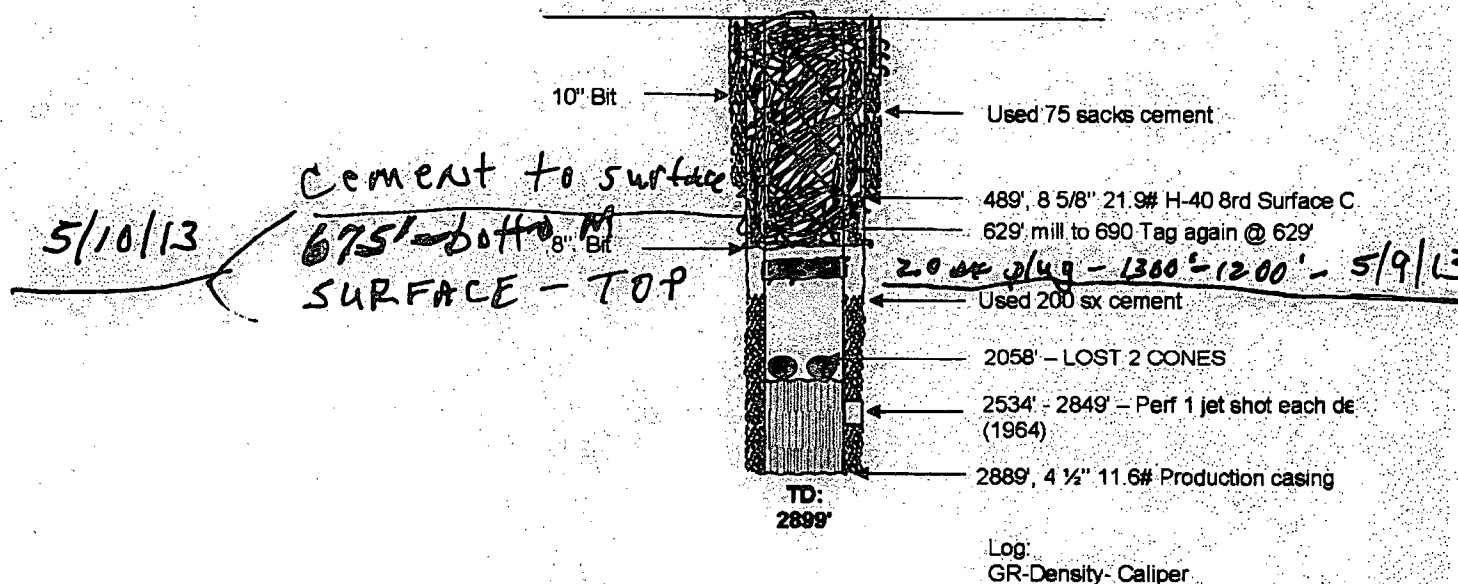

WELL DIAGRAM

Well: 200Current Status ~~TA~~ **PLUGGED/ABANDONED**Field: ArtesiaLease: State 647 AC 711State: New MexicoCounty: EddyAPI No: 3001510182Diagram Revised: DAVISSpud date: 01/30/64

Perf: 2534', 2536', 2538', 2830', 2832', 2840', 2843', 2846', 2849' - w/ 1spf (1964)

Acid 2830' - 2849' w/ 2500 gal 15% NE acid

Acid 2534' - 2538' w/ 250 gal acid

Frac 2534' - 2538' w/ 634 bbls fresh water + 17500 lbs sand. (1964)

TIH tag @ 52' Clean to 630' -lost returns

Fluid coming outside 8 5/8" casing

Continue cleaning getting partial returns outside 8 5/8" casing to 2030'

Workthrough several tight places getting to bottom Clean to 2058' - **LOST 2 CONES**

PU Magnet TIH to 2058' did not have cones or skirt

PU bit string mill and collars TIH tag @ 629' mill to 690' - 6.5 hr POOH