Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

OCD Artesia

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018


5. Lease Serial No. NMNM0475051

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.

6. If Indian, Allottee or Tribe Name

	·	·	·						
SUBMIT IN T	7. If Unit or CA/Agreement, Name and/or No. SRM1144								
1. Type of Well ☐ Oil Well ☑ Gas Well ☐ Other					8. Well Name and No. PENNZOIL 9 2				
Name of Operator WADI PETROLEUM INCORP		9. API Well No. 30-015-24202-00-S1							
	or or the Edward Transaction	- 	include area code)						
3a. Address 4355 SYLVANFIELD SUITE 2 HOUSTON, TX 77014	Ph: 713-296			10. Field and Pool or Exploratory Area WHITE CITY-WOLFCAMP					
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, State				
Sec 9 T24S R26E NESW 1729		EDDY COUNTY			NM				
12. CHECK THE AP	PROPRIATE BOX(ES)	TO INDICAT	E NATURE O	F NOTICE,	REPORT, OR OTH	ER DATA			
TYPE OF SUBMISSION									
D Nation of Intent	☐ Acidize	Deepe	☐ Deepen		ion (Start/Resume)	☐ Water Shut-Off			
☐ Notice of Intent	_		ulic Fracturing	☐ Reclamation		■ Well Integrity			
Subsequent Report Subsequent Re	Casing Repair	☐ New (☐ New Construction		lete	Other			
☐ Final Abandonment Notice	☐ Change Plans ☐ Plu		nd Abandon	∑ Tempora	rarily Abandon				
}	Convert to Injection	🗖 Plug I	☐ Plug Back		Disposal				
Attach the Bond under which the wor following completion of the involved testing has been completed. Final Abdetermined that the site is ready for fi Marathon Oil Permian sincerel Pennzoil 9 Federal Com 2, for 1/31/18 Drove to location, rigg the pressure test, run a 30 mir BLM signed the chart and app Attachments: MIT chart, Well E	operations. If the operation re andonment Notices must be fil nal inspection. If y requests a temporary a the period of one year. ed up pump truck, and so a chart, with 500# psi dro	sults in a multiple ed only after all re abandonment e et up chart recopping to 190# p	ecompletion or recognirements, includents,	empletion in a raing reclamation of following was site to witness good. The	new interval, a Form 3160 n, have been completed an vell, ARTES	4 must be filed once and the operator has			
14. I hereby certify that the foregoing is true and correct. Electronic Submission #403974 verified by the BLM Well Information System For WADI PETROLEUM INCORPORATED, sent to the Carlsbad Committed to AFMSS for processing by PRISCILLA PEREZ on 02/12/2018 (18PP1097SE) Name (Printed/Typed) JENNIFER E VAN CUREN Title SR. REGULATORY COMPLIANCE REP									
Name (Printed/Typed) JENNIFEF	R E VAN CUREN		Title SR. RE	GULATURT	COMPLIANCE REP	, 			
Signature (Electronic Submission)			Date 02/09/2018						
Deried-Failed T	THIS SPACE FO	OR FEDERAL	OR STATE	OFFICE U	SE				
-Approved By	u a. Com	200	Title Scep	v. fc	ST	2-12-18 Date			
Conditions of approval, if any, are attached certify that the applicant holds legal or equ which would entitle the applicant to condu	Office	Isha	<u> </u>						
THE TOTAL OF THE STATE OF THE S				211.0.11		3 0 0 7 1 1			

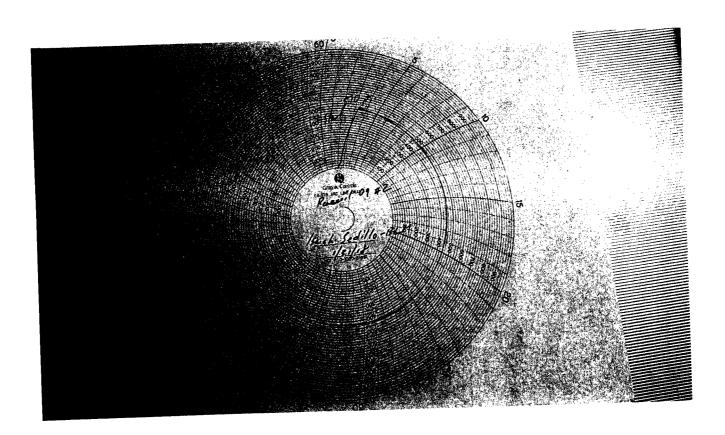

ζ

Wadi Petroleum, Inc.		P	Pennzoil 9 Federal Com #2			API 30-015-24202		
			n n					
	- 2		_				*	
Well Bore Schemat	ric		a a		CURR	ENT		
County:	Eddy, NM	3	Description	ID	OD	Length	Depth	
Formation:	Morrow	Ě						
R.K.B. 20.0' Surface Csg:	500 sx TOC @ surf	25.5	13-3/8", 48#, H40		13.375"		455'	
Intermediate Csg:	2400 sx TOC @ surf	**(\$)	8-5/8", 24# & 28#, S80, J55		8.625"		5482'	
	*							
San day ti ay Garage	000							
Production Csg:	900 sx TOC @ 7700'		5-1/2", 17#, S95		5.500'		11,742	
		\$ 0.50 \$10 \$10 \$10 \$10 \$10 \$10 \$10 \$10 \$10 \$1			 			
					 			
	4							
		1					ļ	
Tubing:	<u>.</u>		340 jts, 2 7/8" 6.5#, N80, 8rd EUE On/Off Tool w/2.25" F profile		2.875"		 	
Packer:			Arrowset 1-X packer				11,157	
					ļ		ļ	
			CIPD @ 44 2401 and 251 and 4	dir	ļ			
			CIBP @ 11,340' w/ 35' cmt by wir	enne au	ilisa duri			
Perforations:	<u>.</u>		11348', 11356', 11360', 11364', 11	368', 11	372', 1137	7', 11382', 1	385',	
	30 30 30	Andra	11396', 11398', 11423', 11426', 11 11491', 11494', 11497', 11556', 11		432, 1143	5 , 11438', 1'	1480,	
pozo.	11,658 11,750'			<u> </u>	 			
PBTD: Total Depth:	11,658 11,750'		Prepared By: E Riddle	1	 	 	<u> </u>	

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Temporary Abandonment of Wells on Federal Lands Conditions of Approval

A temporarily abandoned well is defined as a completion that is not capable of production in paying quantities but which may have value as a service well. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Temporary Abandonment (TA) status approval requires a successful mechanical or casing integrity test as follows:

- 1. A Notice of Intent (NOI) Sundry Notice (Form 3160-5) requesting approval to run a mechanical integrity test (MIT) or casing integrity test (CIT).
- 2. A description of the temporary abandonment procedure.
 - a. A bridge plug or packer must be installed as close to 50 feet above any open perforations or open hole as possible. The bridge plug is to be capped with 35 feet of cement (if bailed) or 25 sacks (if placed with tubing). If a cement plug is used, the top of the cement must be verified by tagging.
 - b. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes with a 10% allowable leakoff.
 - c. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if they are not isolated by a packer.
 - d. A bradenhead test must be conducted. If the test indicates a problem exists, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.
 - e. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Eddy County, 575-361-2822; Lea County 575-393-3612.
- 3. Provides justification why the well should be temporarily abandoned rather than permanently plugged and abandoned and an estimated date that the well will be returned to beneficial use or plugged and abandoned.

Wells that successfully pass the casing integrity test may be approved for Temporary Abandonment (TA) status provided that the operator:

- Submits a subsequent Sundry Notice (Form 3160-5) requesting TA approval with well bore diagram.
- 2. Describes the temporary abandonment procedure.
- 3. Attaches a clear copy or the original of the pressure test chart.
- 4. Give justification to allow well to be place in TA status and plan for future use of well with time frame that well will be place back on line or plans to P&A well will be submitted.

If the well does not pass the casing integrity test, then the operator shall within 30 days submit to BLM for approval one of the following:

- 1. A procedure to repair the casing so that a TA approval can be granted.
- 2. A procedure to plug and abandon the well.

Well Name: Submit Subsequent Report and well bore diagram with all Perforations and CIBP with tops of cement. Well may be approved to be TA for a period of 1 year after successful MIT and subsequent report is submitted.