

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

JUL 28 2009 Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

USER 0832942801

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company Yates Petroleum Corporation	OGRID Number 25575	Contact Robert Asher
Address 104 S. 4 TH Street		Telephone No. 575-748-1471
Facility Name Dog Canyon UP State #1	API Number 30-015-24167	Facility Type Producing Gas Well

Surface Owner State	Mineral Owner State	Lease No. E-5313
------------------------	------------------------	---------------------

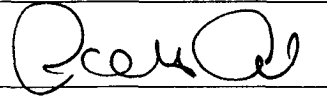
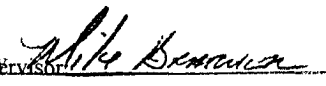
LOCATION OF RELEASE

Unit Letter I	Section 2	Township 17S	Range 27E	Feet from the 1500	North/South Line South	Feet from the 660	East/West Line East	County Eddy
------------------	--------------	-----------------	--------------	-----------------------	---------------------------	----------------------	------------------------	----------------

Latitude 32.85983 Longitude 104.24240

NATURE OF RELEASE

Type of Release Condensate	Volume of Release 70 B/C	Volume Recovered 0 B/C
Source of Release Stock tank developed leak	Date and Hour of Occurrence 10/9/2008 AM	Date and Hour of Discovery 10/9/2008 AM
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Van Barton/NMOCD District II	
By Whom? Mike Stubblefield/YPC Environmental	Date and Hour 10/10/2008 AM	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse. N/A	
If a Watercourse was Impacted, Describe Fully.* N/A		
Describe Cause of Problem and Remedial Action Taken.* The pumper found stock tank to have developed leak. A vacuum truck was called to location; condensate removed from the tank.		
Describe Area Affected and Cleanup Action Taken.* Impacted area was the bermed area of the tank battery. The bermed area was not lined. Impacted soils were removed, placed on a liner and remediated per the 11/4/2008 work plan. Vertical and horizontal delineation conducted on 6/18/2009, based on analytical results further impacted soils were removed and taken to an NMOCD approved facility, samples were taken on 7/20/2009, based on results no further corrective action will be needed. When Final C-141 report is approved, remediated stockpiled soils will be used to backfill and a 20 mil lined will be installed under the battery area. Depth to Ground Water: 50-99', Wellhead Protection Area: No, Distance to Surface Water Body: >1000', SITE RANKING IS 0: Based on enclosed information, Yates Petroleum Corporation requests closure.		
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.		

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Robert Asher	Approved by District Supervisor 	
Title: Environmental Regulatory Agent	Approval Date: JUL 28 2009	Expiration Date: N/A
E-mail Address: boba@ypcnm.com	Conditions of Approval: N/A	Attached <input type="checkbox"/>
Date: Monday, July 27, 2009	Phone: 575-748-4271	2RP-276

* Attach Additional Sheets If Necessary