. Form 3160-5 (August 1999)

### UNITED STATES · DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

### OCD-ARTEMA

FORM APPROVED OMB NO. 1004-0135

Expires: November 30, 2000

## 5. Lease Serial No.


SUNDRY	NOTICES	AND	REPORTS	ON	WELLS

Do not use this form for proposals to drill or to re-enter an

6. If Indian, Allottee or Tribe Name

abandoned well. Use For					
SUBMIT IN TRIPLICATE -	7. If Unit or CA/Agreement, Name and/or No.				
Type of Well Oil Well X Gas Well Other  2. Name of Operator	8. Well Name and No. Sterling Silver 33 #9				
OXY USA Inc.  3a. Address	1 21	. Phone No. (include are	696	Federal De 9. API Well N	lo.
P.O. Box 50250 Midland, TX 7971  4. Location of Well (Footage, Sec., T., R., M., or Survey of 1980 FSL 1980 FWL NESW(K) Sec 33	432-685-5717	a coae)		75 Pool, or Exploratory Area Morrow, West	
				11. County or Eddy	NM
12. CHECK APPROPRIATE	BOX(ES) TO INDIC	ATE NATURE OF N	IOTICE, REPO	ORT, OR OTH	HER DATA
TYPE OF SUBMISSION	•	TYP	E OF ACTION		
X Notice of Intent  Subsequent Report  Final Abandonment Notice	Acidize  Alter Casing  Casing Repair  Change Plans  Convert to Injection	Deepen Fracture Treat New Construction Plug and Abandon Plug Back	Production of Reclamation Recomplete  X Temporarily  Water Dispo	: / Abandon	Water Shut-Off  Well Integrity  Other
Attach the Bond under which the work will be perfollowing completion of the involved operations. testing has been completed. Final Abandonment determined that the final site is ready for final insport TD-15100' PBTD-15045' PerfoxY USA Inc requests to temporari being evaluated for possible Bone 1. POOH w/ pkr & tbg. RIH & set	If the operation results in a positive shall be filed only section.)  of s-14409-14843  ily abandon this we section.	multiple completion or re fiter all requirements, inc ell for possible potential	completion in a no luding reclamatio	ew interval, a Fon, have been co	orm 3160-4 shall be filed once impleted, and the operator has in record
2. Notified BLM/NMOCD of casing i 3. RU pump truck, circulate well	integrity test 24hr with treated water	rs in advance.			AS
SEE ATTACHED FOR CONDITIONS OF APPROV	AL REC	EIVED 09 2011 OCD ARTESIA Title		FEB 2 6 JD Whitl	2011 COAs
14. I hereby certify that the foregoing is true and correct Name ( <i>Printed/Typed</i> )  David Stewart .	Janic			AU OF LAND	MANAGEMENT
In Still		1 .	4/11		
THIS	S SPACE FOR FEDER				
Approved by  Conditions of approval, if any, are attached. Approval of	of this notice does not were	Title		Da	enients)
certify that the applicant holds legal or equitable title to which would entitle the applicant to conduct operations the	those rights in the subject	nt or Office lease			(FM1F

OXY USA Inc. - Proposed
Sterling Silver 33 Federal Deep #9
API No. 30-015-33975

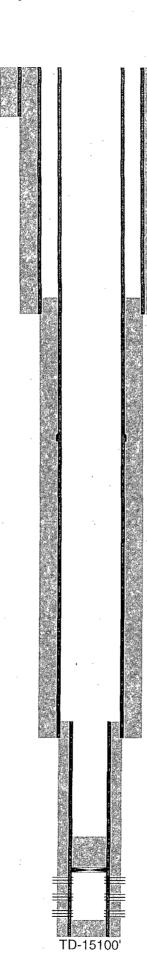

17-1/2" hole @ 690' 13-3/8" csg @ 690' w/ 700sx-TOC-Surf-Circ

12-1/4" hole @ 4175' 9-5/8" csg @ 4175' w/ 1700sx-TOC-Surf-Circ


8-1/2" hole @ 11720'
7" csg @ 11720'
DVT @ 6560'
1st w/ 1320sx-TOC-6555'-Circ
2nd w/ 1005sx-TOC-\*4000'-CBL
\*CBL ran from 15040-4000',cmt above

6-1/2" hole @ 15100' 5" liner @ 11489-15100' w/ 300sx-TOC-11489'-Circ

Perfs @ 14409-14843'

CIBP @ 14360' W/ 25sx cmt

✓ OXY USA Inc. - Current Sterling Silver 33 Federal Deep #9 API No. 30-015-33975

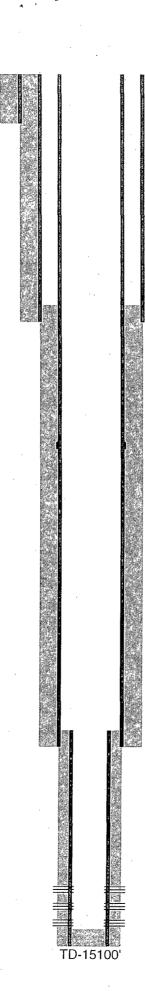

17-1/2" hole @ 690' 13-3/8" csg @ 690' w/ 700sx-TOC-Surf-Circ

12-1/4" hole @ 4175' 9-5/8" csg @ 4175' w/ 1700sx-TOC-Surf-Circ

8-1/2" hole @ 11720'
7" csg @ 11720'
DVT @ 6560'
1st w/ 1320sx-TOC-6555'-Circ
2nd w/ 1005sx-TOC-\*4000'-CBL
\*CBL ran from 15040-4000',cmt above

6-1/2" hole @ 15100' 5" liner @ 11489-15100' w/ 300sx-TOC-11489'-Circ

Perfs @ 14409-14843'

#### BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

# Temporary Abandonment of Wells on Federal Lands Conditions of Approval

A temporarily abandoned well is defined as a completion that is not capable of production in paying quantities but which may have value as a service well. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Temporary Abandonment (TA) status approval requires a successful mechanical or casing integrity test as follows:

- 1. A Notice of Intent (NOI) Sundry Notice (Form 3160-5) requesting approval to run a mechanical integrity test (MIT) or casing integrity test (CIT).
- 2. A description of the temporary abandonment procedure.
  - a. A bridge plug or packer must be installed as close to 50 feet above any open perforations or open hole as possible. If a cement plug is used, the top of the cement must be verified by tagging.
  - b. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes. Any leak-off will be evaluated.
  - c. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if they are not isolated by a packer.
  - d. A bradenhead test must be conducted. If the test indicates a problem exists, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.
  - e. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Eddy County, 575-361-2822; Lea County 575-393-3612.
- Provides justification why the well should be temporarily abandoned rather than permanently plugged and abandoned and an estimated date that the well will be returned to beneficial use or plugged and abandoned.

Wells that successfully pass the casing integrity test may be approved for Temporary Abandonment (TA) status provided that the operator:

- 1. **Submits a subsequent Sundry Notice** (Form 3160-5) requesting TA approval <u>with well bore diagram</u> with all perforations and CIBP's and tops of cement on CIBP's.
- 2. Describes the temporary abandonment procedure.
- 3. Attaches a clear copy or the original of the pressure test chart.
- 4. Give justification to allow well to be place in TA status and plan for future use of well with time frame that well will be place back on line or plans to P&A well will be submitted.

If the well does not pass the casing integrity test, then the operator shall within 30 days submit to BLM for approval one of the following:

- 1. A procedure to repair the casing so that a TA approval can be granted.
- 2. A procedure to plug and abandon the well.

Sterling Silver 33 Fed Deep #9 Well may be approved to be TA/SI for a period of 90 days or until 5/26/2011 after successful MIT and subsequent report with well bore diagram is submitted. This will be the only TA approval for this well. Well must be returned to production, beneficial use or plans to P&A must be submitted by May 26, 2011.