

45F

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

RECEIVED

1. oil well gas well other
2. NAME OF OPERATOR
Yates Petroleum Corporation
3. ADDRESS OF OPERATOR
207 South 4th St., Artesia, NM 88210
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1980 FSL & FWL, Sec. 15-7S-25E
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

SEP 30 1982

W. C. D.
ARTESIA OFFICE


- | | | | |
|--------------------------|--------------------------|-----------------------|-------------------------------------|
| REQUEST FOR APPROVAL TO: | | SUBSEQUENT REPORT OF: | |
| TEST WATER SHUT-OFF | <input type="checkbox"/> | | <input checked="" type="checkbox"/> |
| FRACTURE TREAT | <input type="checkbox"/> | | <input type="checkbox"/> |
| SHOOT OR ACIDIZE | <input type="checkbox"/> | | <input type="checkbox"/> |
| REPAIR WELL | <input type="checkbox"/> | | <input type="checkbox"/> |
| PULL OR ALTER CASING | <input type="checkbox"/> | | <input type="checkbox"/> |
| MULTIPLE COMPLETE | <input type="checkbox"/> | | <input type="checkbox"/> |
| CHANGE ZONES | <input type="checkbox"/> | | <input type="checkbox"/> |
| ABANDON* | <input type="checkbox"/> | | <input type="checkbox"/> |
| (other) | | | |

5. LEASE
NM 10893
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME
Godfrey MP Federal
9. WELL NO.
8
10. FIELD OR WILDCAT NAME
Pecos Slope Abo
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Unit K, Sec. 15-T7S-R25E
12. COUNTY OR PARISH
Chaves
13. STATE
NM
14. API NO.
15. ELEVATIONS (SHOW DF, KDB, AND WD)
3811' GR

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Spudded a 14-3/4" hole 3:15 PM 7-24-82. Set 40' of 20" conductor pipe. Ran 22 joints of 10-3/4" 40.5# J-55 casing set at 836'. 1-Texas Pattern guide shoe at 836'. Insert float at 796'. Cemented w/400 sacks Pacesetter Lite, 1/4# celloseal and 3% CaCl2. Tailed in w/300 sacks Class "C" 2% CaCl2. Compressive strength of cement - 1250 psi in 12 hours. PD 9:45 AM 7-26-82. Bumped plug to 750 psi, released pressure and float held okay. WOC. Drilled out 3:45 AM 7-27-82. WOC 18 hours. Nipped up and tested to 1000 psi, okay. Reduced hole to 9-7/8". Drilled plug and resumed drilling.

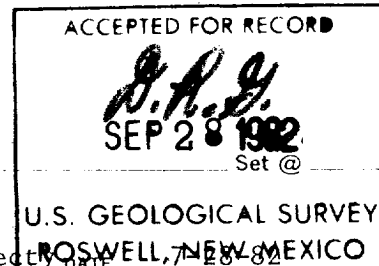


Subsurface Safety Valve: Manu. and Type

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature] TITLE Engineering Section DATE 7-28-82

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

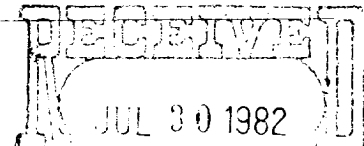

*See Instructions on Reverse Side

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO