

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENTFORM APPROVED
OMB NO. 1004-0137
Expires: January 31, 2018**SUNDRY NOTICES AND REPORTS ON WELLS**
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.**SUBMIT IN TRIPLICATE - Other instructions on page 2**

1. Type of Well <input checked="" type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other	5. Lease Serial No. NMNM29233
2. Name of Operator OXY USA INC.	6. If Indian, Allottee or Tribe Name
3a. Address P.O. BOX 50250 MIDLAND, TX 79710	7. If Unit or CA/Agreement, Name and/or No.
3b. Phone No. (include area code) Ph: 432-685-5717	8. Well Name and No. FEDERAL 12 6
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Sec 12 T22S R31E NESW 2310FSL 1650FWL 32.405109 N Lat, 103.734711 W Lon	9. API Well No. 30-015-26917
	10. Field and Pool or Exploratory Area LIVINGSTON RIDGE DELAWARE
	11. County or Parish, State EDDY COUNTY, NM

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize <input type="checkbox"/> Deepen <input type="checkbox"/> Production (Start/Resume) <input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing <input type="checkbox"/> Hydraulic Fracturing <input type="checkbox"/> Reclamation <input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair <input type="checkbox"/> New Construction <input type="checkbox"/> Recomplete <input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans <input type="checkbox"/> Plug and Abandon <input checked="" type="checkbox"/> Temporarily Abandon
	<input type="checkbox"/> Convert to Injection <input type="checkbox"/> Plug Back <input type="checkbox"/> Water Disposal

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompletable horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletable in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

OXY USA Inc respectfully requests to temporarily abandon this well. It is currently being evaluated for possible future recompletable in the upper Brushy Canyon. A program is currently being reviewed to do a water shut-off of the lower Brushy Canyon. If the results are good and economical, then this well is a future candidate.

TD-8525' PBTD-6766' Perfs-7052-7096' CIBP-6990'

12/29/17 RU PU, Reverse pit & ut. Load tbg w/ 1 bbls FW, test to 600#, held. Removed beam unit head, LD.

1/2/18 Tbg-20#, Csg-50#, bled off to pit, pressure test tbg to 2000#, good. Unseat pump, POOH w/ rods & pump. NDWH, NUBOP, rel TAC.

NM OIL CONSERVATION
ARTESIA DISTRICT

MAR 30 2018

RECEIVED

Accepted for record
NMOCD PF 4/9/18

14. I hereby certify that the foregoing is true and correct.

Electronic Submission #401910 verified by the BLM Well Information System
For OXY USA INC., sent to the Carlsbad

Name (Printed/Typed) DAVID STEWART

Title SR. REGULATORY ADVISOR

Signature

(Electronic Submission)

Date 01/23/2018

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved By

Title

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

**** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED ****

Additional data for EC transaction #401910 that would not fit on the form

32. Additional remarks, continued

1/3/18 Tbg-20#, Csg-20#. POOH w/ tbg. RIH w/ bit & scrapper, clean out to 7050', POOH.

1/4/18 Tbg-20#, Csg-20#, pump 30bbl to kill well. RU WL & RIH & set CIBP @ 6990', POOH. RIH w/ tbg & tag CIBP @ 6990', load & test csg to 500#, held OK.

1/5/18 Tbg-0#, Csg-0#. POOH w/ tbg, several found plugged. RU HW truck, circ well until clean.

1/8/18 Tbg-0#, Csg-0#. RU cmtg co, break circ, M&P 35sx CL H cmt, calc TOC 6706', PUH, WOC.

1/9/18 Tbg-0#, Csg-0#. RIH & tag cmt @ 6765', still wet, PUH, WOC.

1/10/18 Tbg-0#, Csg-0#. RIH w/ tbg & tag cmt @ 6766', PUH, circ pkr fluid, pressure test csg to 550# for 30 min, held good. Start to POOH w/ tbg, SD due to wind.

1/11/18 WH-0#. POOH & LD tbg, ND BOP NUWH. Load hole w/ pkr fluid, pressure test to 550# for 30min. RU chart, pressure test csg to 520# for 30#, tested good, BLM witnessed test. RDPU.

BUREAU OF LAND MANAGEMENT
Carlsbad Field Office
620 East Greene Street
Carlsbad, New Mexico 88220
575-234-5972

Approved for a period of 12 months ending 10/26/2018 subject to conditions of approval.

**Temporary Abandonment of Wells on Federal Lands
Conditions of Approval**

A temporarily abandoned well is defined as a completion that is not capable of production in paying quantities but which may have value as a service well. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Temporary Abandonment (TA) status approval requires a successful mechanical or casing integrity test as follows:

1. A Notice of Intent (NOI) Sundry Notice (Form 3160-5) requesting approval to run a mechanical integrity test (MIT) or casing integrity test (CIT).
2. A description of the temporary abandonment procedure.
 - a. A bridge plug or packer must be installed as close to 50 feet above any open perforations or open hole as possible. If a cement plug is used, the top of the cement must be verified by tagging. CIBP must be capped with minimum 25 sacks cement, placed with tubing, or 35 feet of cement if placed with bailer.
 - b. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes. Any leak-off will be evaluated.
 - c. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if they are not isolated by a packer.
 - d. A bradenhead test must be conducted. If the test indicates a problem exists, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.
 - e. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Eddy County, 575-361-2822; Lea County 575-393-3612.
3. **Provides justification why the well should be temporarily abandoned rather than permanently plugged and abandoned and an estimated date that the well will be returned to beneficial use or plugged and abandoned. 43 CFR 3162.3-4 (a) The operator shall promptly plug and abandon...wells in which oil or gas is not encountered in paying quantities...**

Wells that successfully pass the casing integrity test **may** be approved for Temporary Abandonment (TA) status provided that the operator:


1. **Submits a subsequent Sundry Notice** (Form 3160-5) requesting TA approval **with well bore diagram** with all perforations and CIBP's and tops of cement on CIBP's.
2. Describes the temporary abandonment procedure.
3. Attaches a clear copy or the original of the pressure test chart.
4. Give justification to allow well to be place in TA status and plan for future use of well with time frame that well will be place back on line or plans to P&A well will be submitted.

If the well does not pass the casing integrity test, then the operator shall within 30 days submit to BLM for approval one of the following:


1. A procedure to repair the casing so that a TA approval can be granted.
2. A procedure to plug and abandon the well.

Federal 12 6

1. Well is approved to be TA/SI for a period of 12 months or until 10/26/2018
2. This will be the last TA approval for this well.
3. Must submit NOI to recomplete or NOI to P&A. Must be submitted by 10/26/2018
4. COA's met at this time.

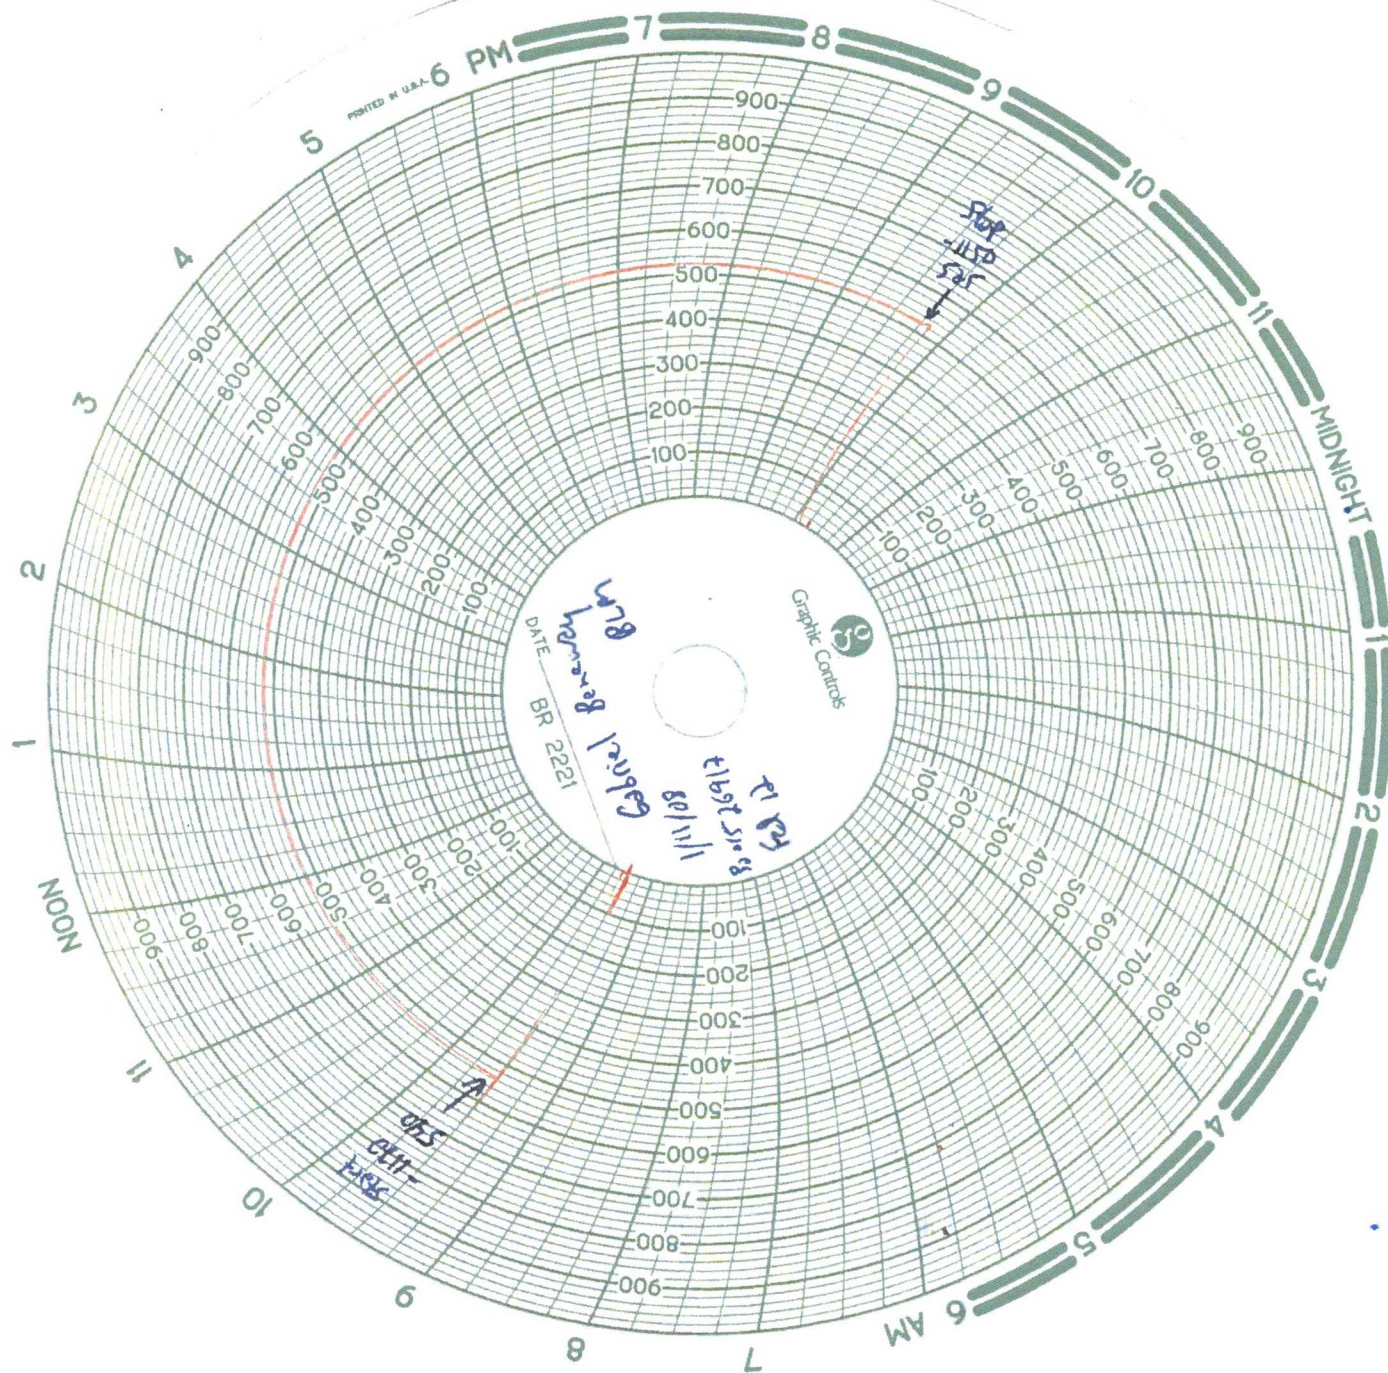

OXY USA Inc. - Final
Federal 12 #6
API No. 30-015-26917

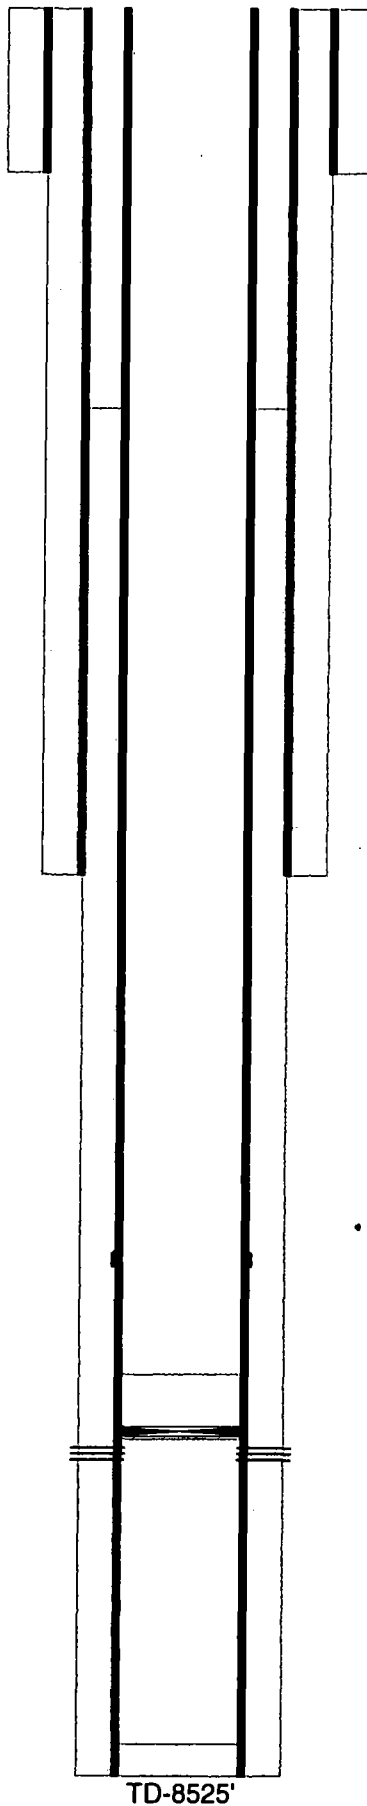

17-1/2" hole @ 818'
13-3/8" csg @ 818'
w/ 1000sx-TOC-Surf-Circ

11" hole @ 4310'
8-5/8" csg @ 4310'
w/ 1700sx-TOC-Surf-Circ

CIBP @ 6990' w/ 35sx cmt to 6766'

Perfs @ 7052-7096'

7-7/8" hole @ 8525'
5-1/2" csg @ 8525'
w/ 1375sx-TOC-2200'-CBL
DVT @ 6176'

PBTD-8485'

TD-8525'