


District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

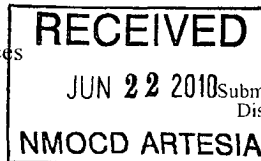

Form C-141
Revised October 10, 2003
2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

30-015-26931
nkmw 1035646177

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company BOPCO, L.P. 260737	Contact Tony Savoie
Address 522 W. Mermod, Suite 704 Carlsbad, N.M. 88220	Telephone No. 432-556-8730
Facility Name: Golden 8 Federal Battery #1	Facility Type E&P

Surface Owner Federal	Mineral Owner Federal	Lease No.
-----------------------	-----------------------	-----------

LOCATION OF RELEASE

Unit Letter K	Section 8	Township 21S	Range 29E	Feet from the	North/South Line	Feet from the	East/West Line	County Eddy
------------------	--------------	-----------------	--------------	---------------	------------------	---------------	----------------	----------------

Latitude N 32.491438 Longitude W 104.008147

NATURE OF RELEASE

Type of Release: Crude oil	Volume of Release: 90 Bbls of Crude oil	Volume Recovered: 80 bbls of crude oil
Source of Release: Drain line connection on the back of a 500 bbl. tank	Date and Hour of Occurrence Unknown	Date and Hour of Discovery 6/14/10 8:56 a.m.
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Randy NMOCD on call operator	
By Whom? Tony Savoie	Date and Hour 6/14/10 9:24 a.m.	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.* The drain line connection on the back of the tank failed due to internal corrosion, the remaining oil in the tank was removed, the tank was cleaned, inspected and repaired by replacing the connections and coating the tank internally.

Describe Area Affected and Cleanup Action Taken.* The released fluid affected an area of approximately 2,000 sq. ft inside the earthen containment around the tanks. The free standing fluids were removed. The heavily saturated soil is in the process of being removed and placed on plastic. The area inside the containment area will be sampled to determine vertical extent; a remediation plan along with a new containment plan will be submitted. The Site remediation for the crude oil spill will follow the NMOCD guidelines for leaks and spills.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.


Signature: Tony Savoie	OIL CONSERVATION DIVISION	
Printed Name: Tony Savoie	Approved by District Supervisor: Signed By M. L. Brannon	
Title: Waste Mgmt. & Remediation Specialist	Approval Date: 3/3/11	Expiration Date:
E-mail Address: TASavoie@BassPet.com	Conditions of Approval: Remediation per OCD Rules & Guidelines. SUBMIT REMEDIATION	Attached <input type="checkbox"/>
Date: 6/22/10	Phone: 432-556-8730	

* Attach Additional Sheets If Necessary

PROPOSAL NOT LATER THAN:

4/3/11

2 RP-521

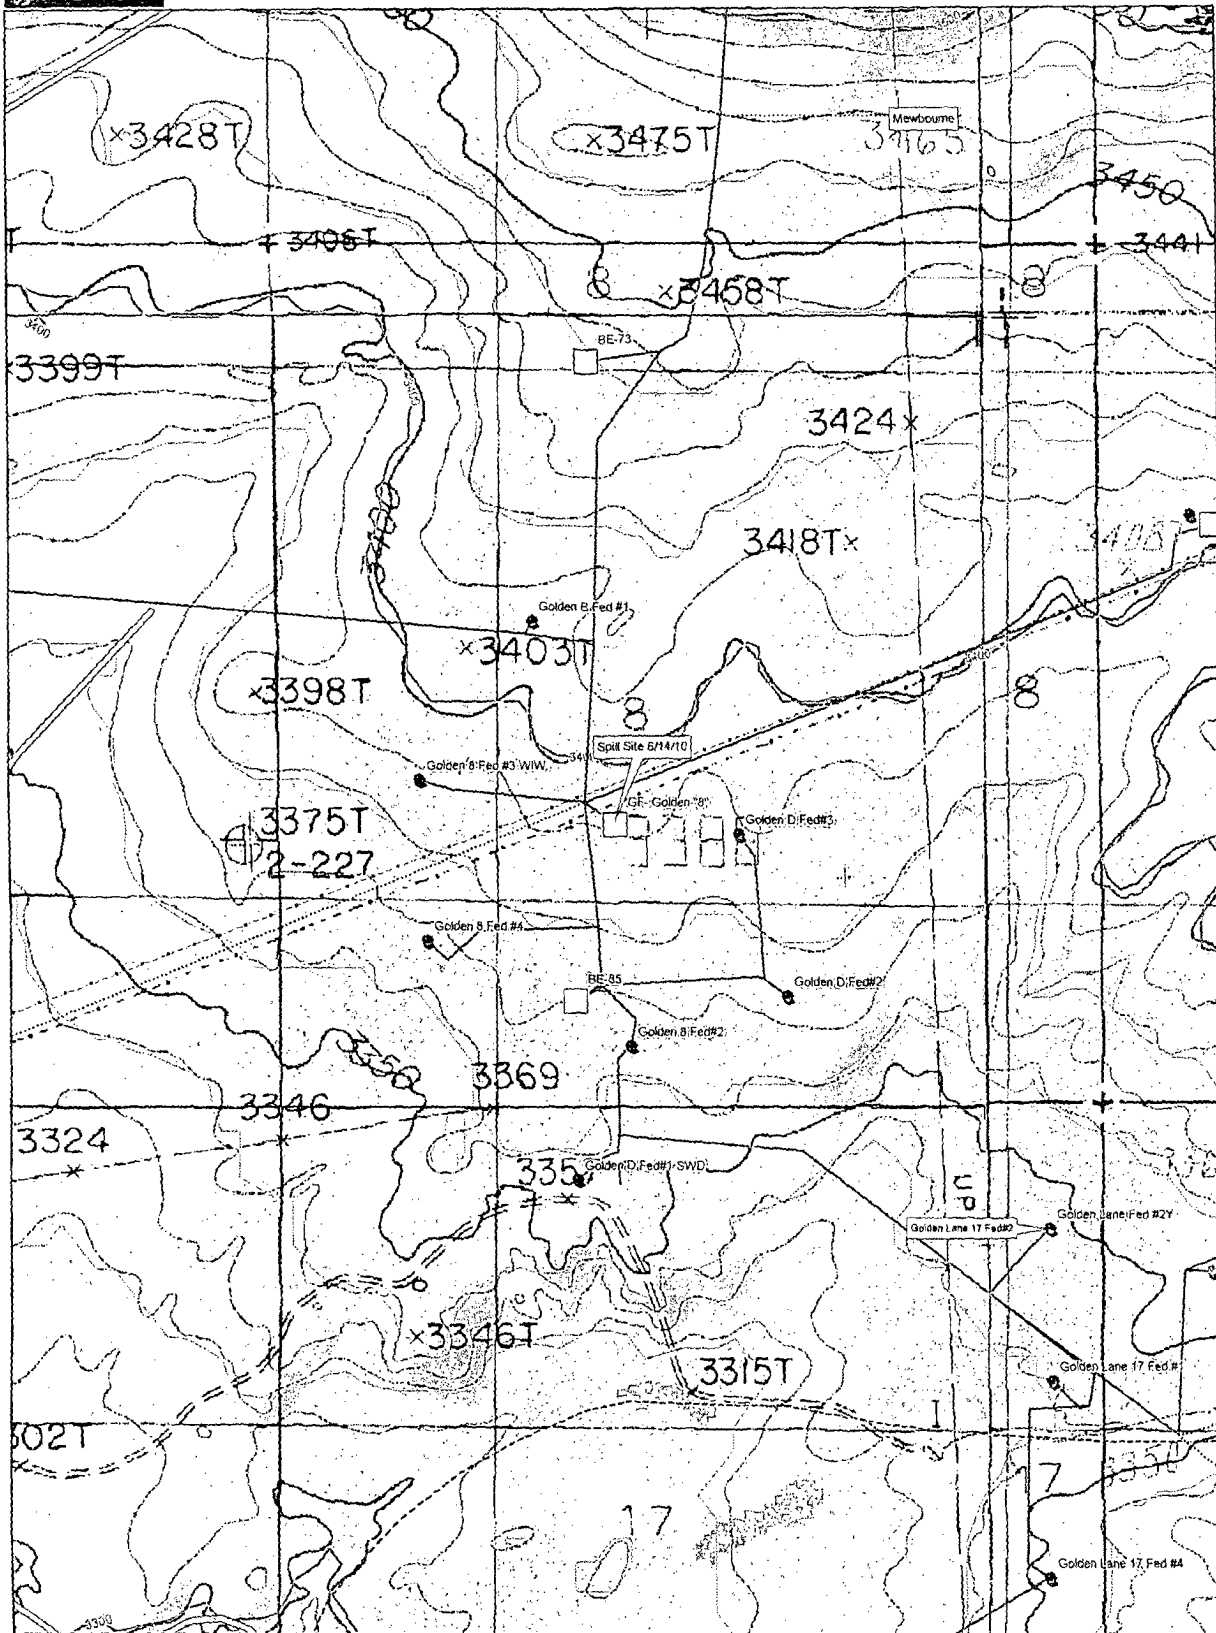

Data use subject to license.

© DeLorme. Topo USA® 8.

www.delorme.com

