

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Las CrucesLease No. 063841-EUnit 30-005-00178

RECEIVED
SEP 9 1955
U. S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	☒	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....		SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....		SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....		SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....			

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

September 8, 1955

Well No. 3-26 is located 1900 ft. from {N} line and 660 ft. from {E} line of sec. 26

6 82 NW (Sec. and Sec. No.) 7 12 S (Twp.) 2 26 E (Range) (Meridian)
Wilcox (Field) Chama (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 3577 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

7000' rotary test. Objective horizons, Queen Sand 450'-550'; San Andres 1550'-1650'; Olorieta 2150'-2250'; Wolfcamp-Pennsylvanian 5200'-6500'; Siluro-Devonian 6500'-7000'. All potential zones, if warranted, be D.S.T.'d. Approximately 1000' of 10-3/4" OD 32.75# N-40 (top of San Andres) and 7000' (as conditions warrant) of 5-1/2" OD 15.5# J-95. Circulate 10-3/4" casing with cement and cement 5-1/2" casing with sufficient cement to protect all potential zones. Mud up under surface and maintain mud to total depth. Electric log hole at total depth. To diamond core any zone or zones deemed necessary.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Inter Oil Company & John H. Trigg
Address 717 Meadows Building
Expressway At Hilton
Dallas, Texas
By N. F. Bartholmey
Title Engineer

10/10/10

10

10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10

10

10

10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10

10/10/10


10/10/10

10/10/10

10/10/10

10/10/10

Client: W.R. Barthelony
c/o Intex Oil Co.
327 Hickory St.
Abilene, Texas

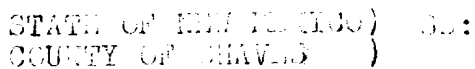

Thomas I. Mann

THOMAS T. LANN
Registered Professional Engineer
and Land Surveyor
License No. 277

