

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Cibola Energy Corporation	8. Farm or Lease Name Elenore
3. Address of Operator P. O. Box 1668, Albuquerque, New Mexico 87103	9. Well No. 1
4. Location of Well UNIT LETTER L 1980 FEET FROM THE South LINE AND 660 FEET FROM West 19 TOWNSHIP 10S RANGE 29E NMPM.	10. Field and Pool, or Wildcat Wildcat - SA
15. Elevation (Show whether DF, RT, GR, etc.) 3881.0 GL	12. County Chaves

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:


PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIATION WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged well as follows:

- 1-2-86 1st plug 25 sx at 8314' tagged 7937
- 2nd plug 10 sx at 7320-7220
- 1-3-86 Cut 4 1/2" casing at 4340 and pulled out of hole.
- 1-4-86 Circulate hole with gel water
- 3rd plug 35 sx at 4390' tagged 4246'
- 4th plug 35 sx at 3669-3569
- 5th plug 35 sx at 3149
- 1-10 thru 1-14-86 Did not tag plug at 3149'. Ran RTBP & pkr and tested San Andres. Well was not economical.
- 1-15-86 6th plug 35 sx at 3160-3060
- 7th plug 40 sx 2964-2775
- 8th plug 35 sx 590-490
- 9th plug 30' plug with marker at surface.

Location will be cleaned and levelled as soon as the pit dries.

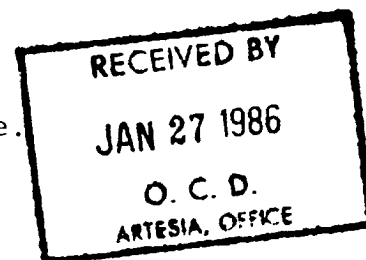

Post ID-2
2-21-86
P4A

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Karen Meyer</u>	TITLE <u>Drilling Secretary</u>	DATE <u>1-22-86</u>
APPROVED BY <u>[Signature]</u>	TITLE <u>3rd Rep</u>	DATE <u>3/15/93</u>
CONDITIONS OF APPROVAL, IF ANY:		