

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

NM OIL CONS. COMMISSION
NM OIL CONSERVATION TRUST
(Other Instructions
on Reverse Side)
Artesia, NM 88210

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 38343

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Michael Eric

9. WELL NO.

#1

10. FIELD AND POOL, OR WILDCAT

Wildcat

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 22, T7S, R26E
660' FNL & 660' FWL

12. COUNTY OR PARISH 13. STATE

Chaves

NM

1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Sanders Petroleum Corporation /

3. ADDRESS OF OPERATOR

11000-D Spain Road NE, Albuquerque, NM 87111

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*

See also space 17 below.)
At surface

660' FNL & 660' FWL, Sec. 22, T7S, R26E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3739 GL

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other) Casing & Cement

REPAIRING WELL


ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Ran 127 jts. 10.5# K-55 Smls. API casing, set at 4756'. Top of float collar 4715'. Cemented with 300 sx. 35/65 Poz, 4% gel with 1/2# Flocele and 5# salt per sack; followed by 150 sx. "Self-Stress" with 1/4# Flocele per sack. Plug down 11:15 a.m. 10-21-81. Top of cement 3000' by temperature survey.

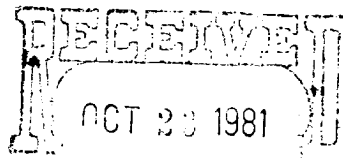

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

18. I hereby certify that the foregoing is true and correct.

SIGNED

ROGER A. CHAPMAN

TITLE President

DATE 10-22-81

(This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

OCT 29 1981
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

*See Instructions on Reverse Side