Form 9-331
Dec. 1973

NM OIL CONS. COMMISSION
Drawer DD
Artesia, NM 88210

Form Approved.
Budget Bureau No. 42-R1424

UNITED ATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

C/SF

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☐   gas well ☒   other

2. NAME OF OPERATOR

Yates Petroleum Corporation

3. ADDRESS OF OPERATOR

207 South 4th St., Artesia, NM 88210

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

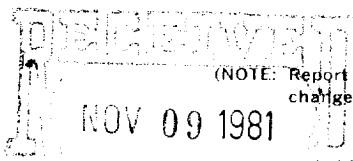AT SURFACE: 660 FSL & 660 FEL, Sec. 4-9S-26E
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:

5. LEASE NM-29211

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

RECEIVED

8. FARM OR LEASE NAME
Engwall RL Federal

NOV 17 1981

9. WELL NO.
1

O. C. D.
ARTESIA, OFFICE

10. FIELD OR WILDCAT NAME
Und. Abo

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Unit P, Sec. 4-T9S-R26E

12. COUNTY OR PARISH
Eddy

13. STATE
NM

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)
3826.2' GR

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:		SUBSEQUENT REPORT OF:
TEST WATER SHUT-OFF	☐	☒
FRACTURE TREAT	☐	☐
SHOOT OR ACIDIZE	☐	☐
REPAIR WELL	☐	☐
PULL OR ALTER CASING	☐	☐
MULTIPLE COMPLETE	☐	☐
CHANGE ZONES	☐	☐
ABANDON*	☐	☐
(other)		

RECEIVED
NOV 09 1981

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Set 60' of 20" conductor pipe.
Spudded 12-1/4" hole at 1:30 PM 10-28-81.
Ran 39 joints of 8-5/8" 24# K-55 ST&C casing set at 1550'. 1-Texas Pattern guide shoe set at 1550'. Insert float at 1510'. Cemented w/700 sacks Halliburton Lite w/2% $CaCl_2$. Tailed in w/300 sacks Class C 2% $CaCl_2$. PD 9:00 PM 11-3-81. Bumped plug to 600 psi, released pressure and float held okay. Circulated 15 sacks to pit. WOC. Drilled out at 10:30 AM 11-4-81. WOC 13-1/2 hours. Nippled up and tested to 1000 psi, okay. Reduced hole to 7-7/8". Drilled plug and resumed drilling.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED _____ ACCEPTED FOR RECORD TITLE Engineering Sect DATE 11-5-81

ROGER A. CHAPMAN (This space for Federal or State office use)

APPROVED BY
CONDITIONS OF APPROVAL NOV 16 1981 TITLE _____ DATE _____

U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

See Instructions on Reverse Side