

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

C/SF  
**SUNDRY NOTICES AND REPORTS ON WELLS**

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ gas ☒ other ☐  
well well

2. NAME OF OPERATOR

Yates Petroleum Corporation

3. ADDRESS OF OPERATOR

207 South 4th St., Artesia, NM 88210

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.) 1980 FSL & 660 FEL, Sec. 15-7S-25E

AT SURFACE:

AT TOP PROD. INTERVAL:

AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

CHANGE ZONES ☐

ABANDON\* ☐

(other) ☐

SUBSEQUENT REPORT OF:

☒

☐

☐


☐

☐

☐

☐

☐

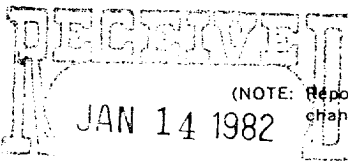

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

OIL & GAS  
U.S. GEOLOGICAL SURVEY  
ROSWEIL, NEW MEXICO

5. LEASE

NM 10893

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Godfrey "MP" Federal

9. WELL NO.

7

10. FIELD OR WILDCAT NAME

Und. Abo

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Unit I, Sec. 15-7S-25E

12. COUNTY OR PARISH

Chaves

13. STATE

NM

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)  
3752.7' GR

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Set 40' of 20" conductor pipe. Spudded a 14-3/4" hole at 12:00 noon 1-9-82. Ran 22 joints of 10-3/4" 40.5# casing set at 850'. 1-Texas Pattern guide shoe set at 850'. Insert float set at 809'. Cemented w/400 sacks Pacemaker Lite w/2% CaCl. Tailed in w/300 sacks Class "C" with 2% CaCl. PD 11:45 AM 1-11-82. Bumped plug to 750 psi, released pressure and float held, okay. Cement circulated 50 sacks to pit. WOC. Drilled out 5:45 AM 1-12-82. WOC 18 hours. Nippled up and tested to 1000 psi, okay. Reduced hole to 7-7/8". Drilled plug and resumed drilling.

Subsurface Safety Valve: Manu. and Type \_\_\_\_\_ Set @ \_\_\_\_\_ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature] TITLE Engineering Secty DATE 1-13-82

ACCEPTED FOR RECORD  
(This space for Federal or State office use)

ROGER A. CHAPMAN

APPROVED BY  
CONDITIONS OF

JAN 15 1981

U.S. GEOLOGICAL SURVEY  
POSWEIL, NEW MEXICO

See Instructions on Reverse Side