

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

C/SF  
**SUNDRY NOTICES AND REPORTS ON WELLS**


(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☐ gas well ☒ other ☐
2. NAME OF OPERATOR  
Yates Petroleum Corporation /
3. ADDRESS OF OPERATOR  
207 South 4th St., Artesia, NM 88210
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)  
660 FNL & 1980 FWL, Sec. 15-6S-25E  
AT SURFACE:  
AT TOP PROD. INTERVAL:  
AT TOTAL DEPTH:
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

- TEST WATER SHUT-OFF ☐  
FRACTURE TREAT ☐  
SHOOT OR ACIDIZE ☐  
REPAIR WELL ☐  
PULL OR ALTER CASING ☐  
MULTIPLE COMPLETE ☐  
CHANGE ZONES ☐  
ABANDON\* ☐  
(other) ☐

SUBSEQUENT REPORT OF:

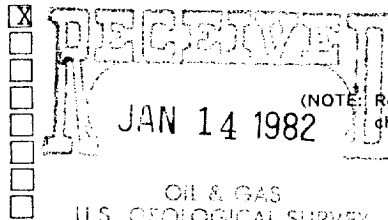

5. LEASE  
NM 11593
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME  
Red Rock "NB" Federal
9. WELL NO.  
3
10. FIELD OR WILDCAT NAME  
Ind. Abo Pecos Slope abo O. C. D.  
ARTESIA, OFFICE
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
Unit C, Sec. 15-T6S-R25E
12. COUNTY OR PARISH  
Chaves
13. STATE  
NM
14. API NO.
15. ELEVATIONS (SHOW DF, KDB, AND WD)  
3952.8' GR

RECEIVED

JAN 19 1982

O. C. D.  
ARTESIA, OFFICE

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Spudded a 12-1/4" hole at 4:30 PM 1-5-82. Ran 22 joints of 8-5/8" 24# J-55 casing set at 888'. 1-Texas Pattern guide shoe at 888'. Insert float at 847'. Cemented w/350 sacks Pacesetter Lite with 2% CaCl<sub>2</sub>. Tailed in w/200 sacks Class "C" with 2% CaCl<sub>2</sub>. PD 9:45 AM 1-7-82. Bumped plug to 750 psi, released pressure and float held okay. Cement circulated 50 sacks to pit. WOC. Drilled out 3:45 AM 1-8-82. WOC 18 hours. Nippled up and tested to 1000 psi, Okay. Reduced hole to 7-7/8". Drilled plug and resumed drilling.

Subsurface Safety Valve: Manu. and Type \_\_\_\_\_ Set @ \_\_\_\_\_ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED ROGER A. CHAPMAN TITLE Engineering Secty DATE 1-13-82

(This space for Federal or State office use)  
APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

JAN 15 1981  
U.S. GEOLOGICAL SURVEY  
ROSWELL, NEW MEXICO