

UNITED STATES

DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-2 for such proposals.)

1. oil well ☐ gas well ☒ other ☐

2. NAME OF OPERATOR

Yates Petroleum Corporation

3. ADDRESS OF OPERATOR

207 South 4th St., Artesia, NM 88210

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE: 660' FSL & 1980' FWL

AT TOP PROD. INTERVAL:

AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL


PULL OR ALTER CASING

MULTIPLE COMPLETE

CHANGE ZONES

ABANDON\*

(other)

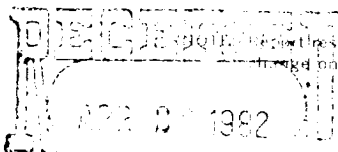

5. LEASE

NM 28297

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Verdette 00 Federal

WELL NO.

7

10. FIELD OR WILDCAT NAME

Pecos Slope Abo

21. SEC. T., R., M., OR BLK. AND SURVEY OR AREA

Unit N, Sec. 26-T5S-R24E

12. COUNTY OR PARISH 13. STATE

Chaves

NM

14. API NO.

15. ELEVATIONS (SHOW DE, KDB, AND WD)  
3953.6' GR

OIL & GAS

U.S. GEOLOGICAL SURVEY

POSWELL, NEW MEXICO

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Spudded a 12-1/4" hole 11:00 AM 4-13-82. Set 40' of 20" conductor pipe. Ran 23 joints of 8-5/8" 24# J-55 casing set 924'. 1-Texas Pattern guide shoe set 924'. Flapper float set 884'. Cemented w/450 sacks Pacesetter Lite, 27 CaCl. Tailed in w/250 sacks Class "C" with 3% CaCl. Compressive strength of cement - 1250 psi. PD 1:00 PM 4-14-82. Bumped plug to 750 psi, released pressure and float held okay. Cement circulated 50 sacks. WOC. Drilled out 7:00 AM 4-15-82. WOC 18 hours. Nipped up and tested to 1000 psi, okay. Reduced hole to 7-7/8". Drilled plug and resumed drilling.

Subsurface Safety Valve: Manu. and Type

Set @

Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED

*[Signature]*

TITLE Engineering Secty

DATE 4-23-82

(This space for Federal or State office use.)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY

TITLE

DATE

ACCEPTED FOR RECORD

MAY 11 1982

U.S. GEOLOGICAL SURVEY  
POSWELL, NEW MEXICO

\*See Instructions on Reverse Side