

DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ well ☐ gas ☒ well ☐ other

2. NAME OF OPERATOR

Yates Petroleum Corporation

3. ADDRESS OF OPERATOR

207 South 4th St., Artesia, NM 88210

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.) 1980 FNI & 660 FEL, Sec. 21-5S-24E

AT SURFACE:

AT TOP PROD. INTERVAL:

AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

PULL OR ALTER CASING ☐


MULTIPLE COMPLETE ☐

CHANGE ZONES ☐

ABANDON* ☐

(other) ☐

SUBSEQUENT REPORT OF:

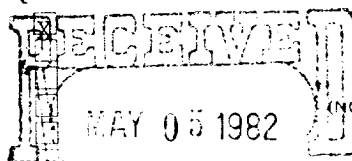

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

5. LEASE

NM 14983

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

RECEIVED

7. UNIT AGREEMENT NAME

MAY - 7 1982

8. FARM OR LEASE NAME

Monaghan QY Federal

9. WELL NO.

3

10. FIELD OR WILDCAT NAME

Pecos Slope Abo

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Unit H, Sec. 21-T5S-R24E

12. COUNTY OR PARISH 13. STATE

Chaves

NM

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)
3983.6 GR

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Spudded 12-1/4" hole 5:15 PM 4-28-82. Set 40' of 20" conductor pipe. Ran 23 joints of 8-5/8" 24# casing set at 925'. 1-Texas Pattern notched guide shoe at 925'. Insert float at 885'. Cemented w/300 sacks Class "C" 2% CaCl₂. Compressive strength of cement - 1250 psi in 12 hours. PD 4:15 AM 4-30-82. Bumped plug to 750 psi, released pressure and float held okay. Cement circulated 50 sacks. WOC. Drilled out at 10:15 PM 4-30-82. WOC 18 hours. Nippled up and tested to 1000 psi, okay. Reduced hole to 7-7/8". Drilled plug and resumed drilling.

Subsurface Safety Valve: Manu. and Type

18. I hereby certify that the foregoing is true and correct

SIGNED Leander J. McCall TITLE Engineering Secty

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____
CONDITIONS OF APPROVAL, IF ANY:

