

SF/yle

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ well gas ☒ well other ☐

JUL 1 1982

2. NAME OF OPERATOR

Yates Petroleum Corporation

O. C. D.

3. ADDRESS OF OPERATOR

207 South 4th St., Artesia, NM 88210

ARTESIA, OFFICE

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE: 1980 FSL & FWL, Sec. 9-7S-25E

AT TOP PROD. INTERVAL:

AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

CHANGE ZONES ☐

ABANDON\* ☐

(other) ☐

SUBSEQUENT REPORT OF:

☒

☐

☐

☐

☐

☐

☐

☐

5. LEASE

NM-11799

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Hahn NH Federal

9. WELL NO.

4

10. FIELD OR WILDCAT NAME

Pecos Slope Abo

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Unit K, Sec. 9-T7S-R25E

12. COUNTY OR PARISH 13. STATE

Chaves

NM


14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)  
3864.3' GR

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Spudded a 14-3/4" hole 6:00 PM 5-28-82. Ran 22 joints of 10-3/4" 40.5# J-55 casing set at 854'. 1-Texas Pattern notched guide shoe at 854'. Insert float at 814'. Cemented w/300 sacks Pacesetter Lite 3% CaCl<sub>2</sub>. Tailed in w/300 sacks Class "C" 2% CaCl<sub>2</sub>. Compressive strength of cement - 1250 psi in 12 hrs. PD 2:00 AM 5-30-82. Bumped plug to 1000 psi, released pressure and float held okay. WOC. Cement circulated 50 sacks to pit. WOC. Drilled out 8:00 PM 5-30-82. WOC 18 hours. Nipped up and tested to 1000 psi, okay. Reduced hole to 9-7/8". Drilled plug and resumed drilling.

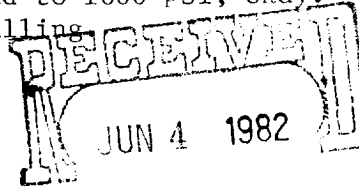

Subsurface Safety Valve: Manu. and Type

OIL & GAS  
U.S. GEOLOGICAL SURVEY  
ROSWELL, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED Janita S. Rodden TITLE Engineering Secty DATE 6-2-82

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

ACCEPTED FOR RECORD

JUN 30 1982  
U.S. GEOLOGICAL SURVEY  
ROSWELL, NEW MEXICO