

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
811 South First, Artesia, NM 87210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

C/SF
OP

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

WELL API NO. 30-005-60332-00-00	
5. Indicate Type of Lease ☒ BLM STATE ☐ FEE ☐	
6. State Oil & Gas Lease No.	
Lease Name or Unit Agreement Name: South Lucky Lake Queen Unit	
8. Well No. Tract 7 #1	
9. Pool name or Wildcat Queen	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR PROPOSALS.)	
1. Type of Well: Oil Well ☐ Gas Well ☒ Other INJECTION	
2. Name of Operator WEBB OIL COMPANY	
3. Address of Operator P.O. Box 1124, Artesia, N.M. 88211-1124	
4. Well Location Unit Letter 0 : _____ feet from the 660 FSL line and 1980 feet from the EAST line Section 16 Township 15S Range 29E NMPM County CHAVES EDDY	
10. Elevation (Show whether DR, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐	REMEDIAL WORK ☐ ALTERING CASING ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐	CASING TEST AND CEMENT JOB ☐
OTHER: ☐	OTHER: Repair INJECTION Well ☒

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions : Attach wellbore diagram of proposed completion or recompletion.

6-15-00 Rig up REAL Well Serv. Release PKR, POOH. w/PKR AND PLASTIC COATED TBG. Pickup New Baker AD-1 Tension PKR. Rlt w/ 4 STANDS (8 JTS) AND TEST Casing - Casing Bled off - continue Testing coming up hole - Thought Casing WAS Leaking @ 130'. POOH. Shut Down. 6-16- Rlt w/ Ball Plug ON Bottom of PLASTIC Coated TBG. Found Leak in TBG. Replace TBG. Rlt Set PKR, pull Tension. Flange Wellhead up. Test casing to 320 PSI for 30 min Casing held good. Rig Down. Repair Complete. Thank you.

(Attached Chart.)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE **Rodney B. Webb** TITLE **owner** DATE **6-19-00**

Type or print name **RODNEY B. WEBB** Telephone No. **(505) 748-2081**

(This space for State use) **365-6657**

APPROVED BY **Michelle Webbfield** TITLE **Field Rep. II** DATE **7/3/2000**

Conditions of approval, if any:

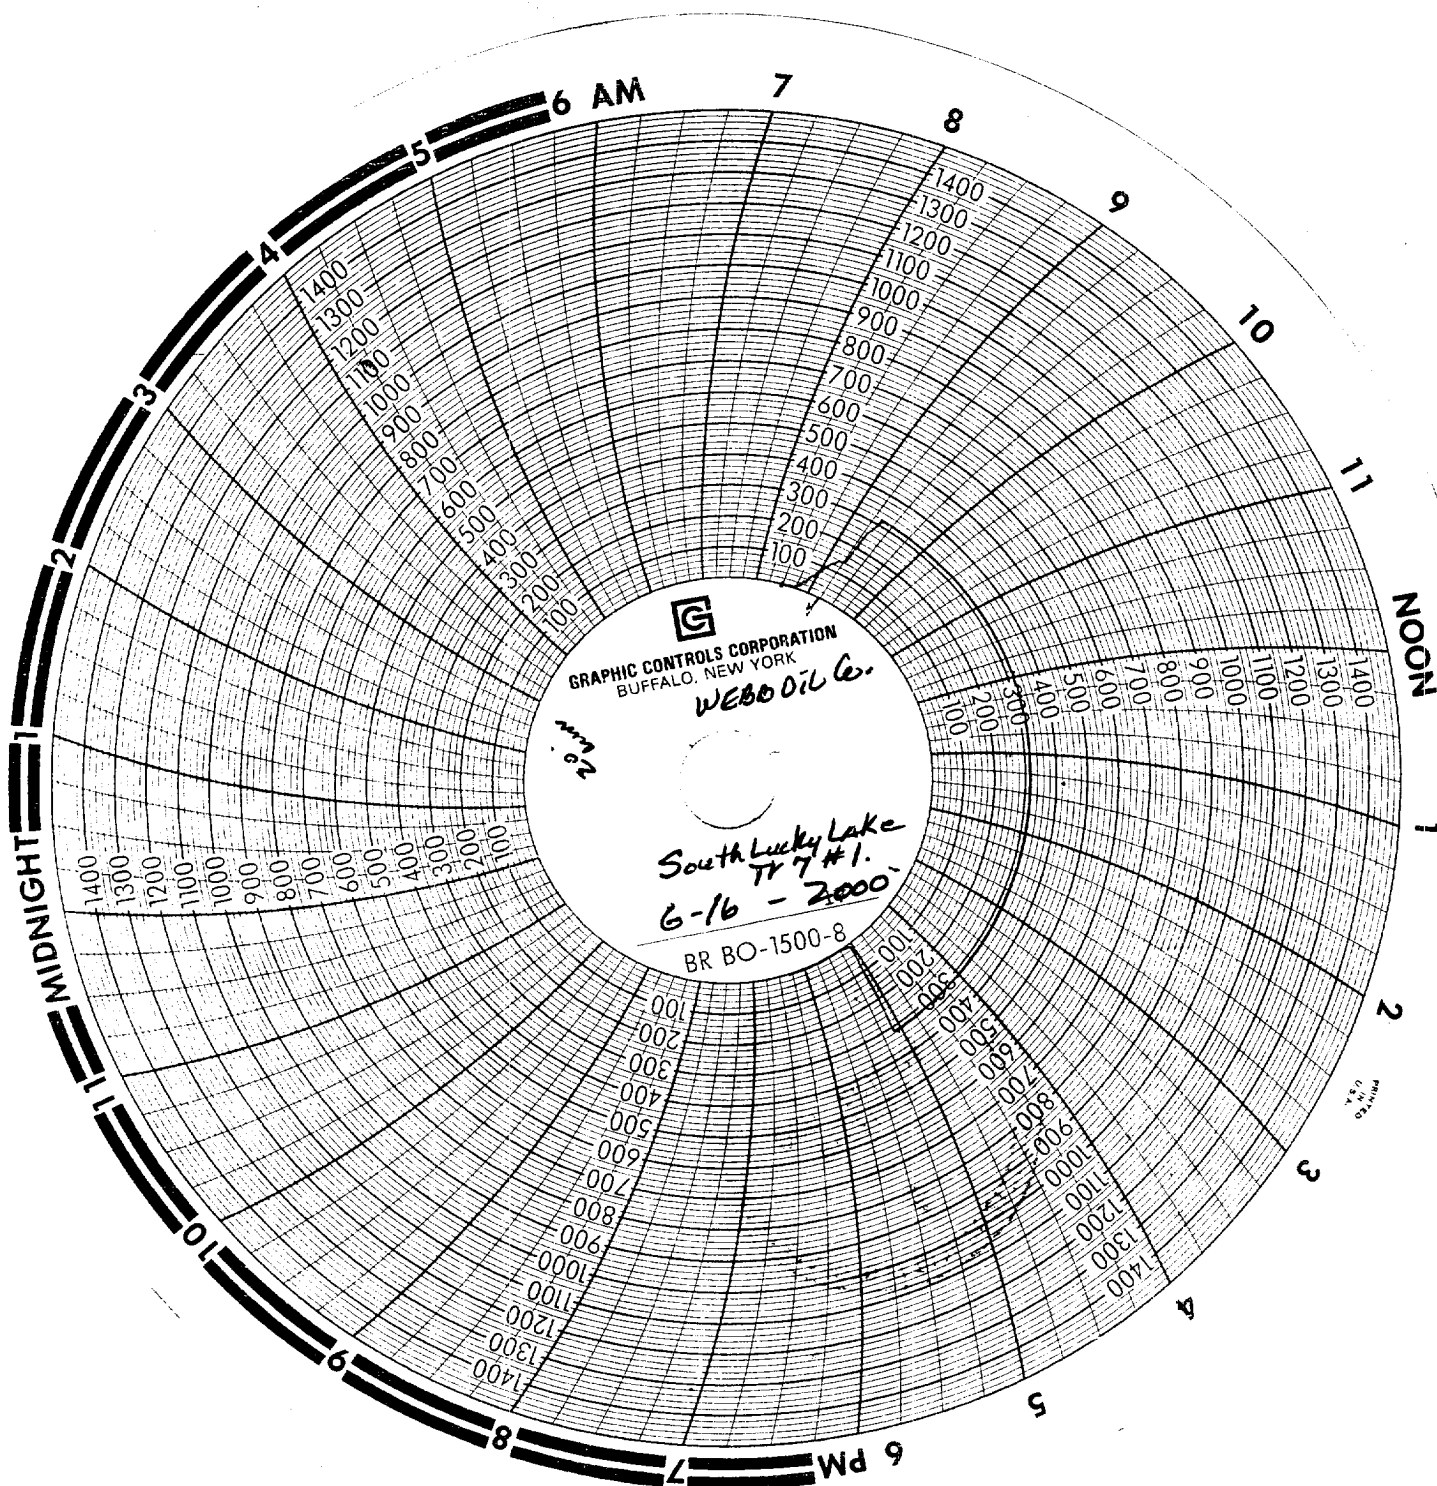

South Lucky Lake
Tract 7 #1 30 MIN.



6-16-00
Kirk Jarvis

6-15-00 Poolt w/ PKR
Test backside coming out.
Leak off 130'.
6-16-00 RTH w/ new Baker RD-1 PKR.
Leak off same place. Poolt w/ PKR.
Put Ball Plug on TB6. RTH Test TB6.
TB6. Leaking - Replace TB6. RTH
w/ new PKR + TB6. Test casing
in this chert. for 30 min.
held good.