

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED  
OMB No. 1004-0135  
Expires July 31, 1999

**SUNDRY NOTICES AND REPORTS ON WELLS**  
*Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.*

**SUBMIT IN TRIPLICATE - Other instructions on reverse side**

1. Type of Well  
☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator  
OXY USA INC.

3a. Address  
P.O. BOX 50250  
MIDLAND, TX 79710-0250

3b. Phone No. (include area code)  
16696  
915-685-5717

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660 FNL 660 FWL NWNW(1) Sec 21 T17S R27E

5. Lease Serial No.  
NM15429

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.  
Oxy Excalibur Federal #1

9. API Well No.  
30-015-30771

10. Field and Pool, or Exploratory Area  
Logan Draw Morrow

11. County or Parish, State  
EDDY NM


12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other Spud, Set
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	CSS & Cmt
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)



See other side

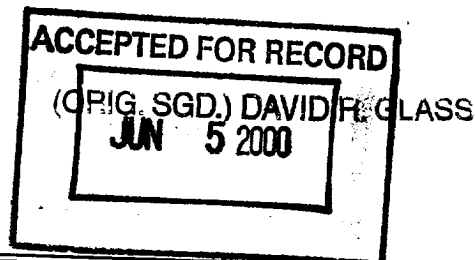

14. I hereby certify that the foregoing is true and correct  
Name (Printed/Typed)

DAVID STEWART

Title

REGULATORY ANALYST

Signature

*David Stewart*

Date

6/2/00

**THIS SPACE FOR FEDERAL OR STATE OFFICE USE**

Approved by	Title	Date
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.	Office	

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on reverse)

ATTACHMENT 3160-5  
OXY USA INC.  
OXY EXCALIBUR FEDERAL #1  
SEC 21 T17S R27E  
EDDY COUNTY, NM

NOTIFIED BLM 5/20/00 OF SPUD. MIRU UTI #307, SPUD WELL @ 1945hrs MDT 5/20/00. DRILL 17-1/2" TO TD @ 436', 5/21/00, PUMP SWEEP. RIH W/ 13-3/8" 48# H40 CSG & SET @ 436'. M&P 200sx 65:35 C/POZ W/ 6% BENTONITE + 2%  $\text{CaCl}_2$  + .5#/sx GILSONITE FOLLOWED BY 200sx CL C W/ 2%  $\text{CaCl}_2$ , DISP W/ FW, PLUG DOWN 1430hrs MDT 5/21/00, CIRC 75sx CMT TO PIT, WOC-6hrs. BLM NOTIFIED OF CMT JOB, DID NOT WITNESS. CUT OFF CASING, WELD ON STARTING HEAD, TEST TO 500#, OK. NU BOP & CHOKE MANIFOLD, TEST BLIND RAMS, PIPE RAMS, & HYDRIL TO 1000#, OK. TOTAL WOC-18hrs, RIH & TAG, DRILL OUT & DRILL AHEAD 5/22/00.

DRILL 11" HOLE TO TD @ 1535' 5/23/00, RAN FLUID CALIPER, PUMP SWEEP. RIH W/ 8-5/8" 32# K55 CSG & SET @ 1535'. M&P 535sx 65:35 C/POZ W/ 6% BENTONITE + 2%  $\text{CaCl}_2$  + .25#/sx CELLOFLAKE + 5#/sx GILSONITE FOLLOWED BY 200sx CL C W/ 2%  $\text{CaCl}_2$  DISP /FW, PLUG DOWN 1815hrs MDT 5/23/00, CIRC 100sx CMT TO PIT, WOC-6hrs. BLM NOTIFIED OF CMT JOB, DID NOT WITNESS. NU BOP & CHOKE MANIFOLD, TEST BLIND RAMS, PIPE RAMS, CHOKE LINES, CHOKE MANIFOLD AND SAFETY VALVES TO 5000#, OK. TEST HYDRIL, MUD LINES, & CASING TO 2500#, BLM NOTIFIED OF BOP TEST, DID NOT WITNESS. TOTAL WOC-18hrs. RIH & TAG, DO CMT, TEST, DRILL AHEAD 5/24/00.

RECEIVED  
2000 JUN -5 A 10:46  
BUREAU OF LAND MANAGEMENT  
ROSWELL OFFICE