

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
ARTESIA, NM 88210

SUBMIT IN TRIP
(Other instructions
reverse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

4157

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

OIL WELL ☒ GAS WELL ☐ OTHER ☐

NAME OF OPERATOR

Yates Drilling Company

ADDRESS OF OPERATOR

105 South 4th Street, Artesia, New Mexico 88210


4 LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below)
At surface

1650' FSL & 1650' FEL

4 PERMIT NO.

15 ELEVATIONS (Show whether FT., RT., GR., etc.)

3260' GR

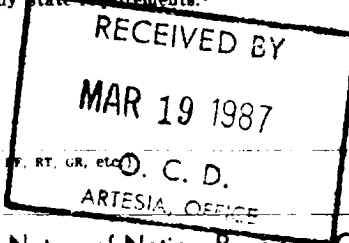

5. LEASE DESIGNATION AND SERIAL NO.

NM-04219

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Anderson Federal

9. WELL NO.

6

10. FIELD AND POOL, OR WILDCAT

McMillan West

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Section 11-20S-26E

12. COUNTY OR PARISH 13. STATE

Eddy

N.M.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST PILE SHUT-OFF

PULL OR ALTER CASING

FRACURE TREATMENT

MULTIPLE COMPLETION

SURFACE OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

16. (For use by owner or completed operator.) (Clearly state all pertinent details and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Associated with the Brantley Dam Project, plugging responsibility and liability was assumed by the Bureau of Reclamation. Plugging was as follows:

- 1-22-87 Pulled sucker rods and pump and laid down
Pulled tubing and mud anchor removed
Ran tubing with additional joints and tagged bottom at 600'
Hole was circulated with water
Spotted cement plug (cement "C") from 600'-360'
Pulled tubing to 90'
- 1-23-87 Tagged cement @ 364'
Salt water gel was circulated in hole
Spotted cement plug from 90'- surface
Pulled tubing

A surface marker will be erected and/or surface work completed as needed by the Bureau of Reclamation.



Post ID-2
3-6-87
P+M

17. I hereby certify that the foregoing is true and correct

SIGNED

TITLE Engineer

DATE 2-25-87

This space for Federal or State office use)

APPROVED BY

TITLE

AREA MANAGER

CARLETON S. [unclear]

DATE

3-16-87

EXPLANATIONS OF APPROVAL, IF ANY.

*See Instructions on Reverse Side