

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

APPROVED

By Kellie Jones at 11:14 am, Jan 25, 2016

Submit 1 Copy to appropriate District Office in accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

OPERATOR

Initial Report Final Report

Name of Company	Oxy Permian Ltd.	Contact	Casey Summers
Address	6 Desta Drive, Midland, TX 79705	Telephone No.	(575) 513-8289
Facility Name	State P Central Battery	Facility Type	Battery

Surface Owner	State	Mineral Owner		API No.	30-025-12180
---------------	-------	---------------	--	---------	--------------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
L	32	22S	38E					Lea County, NM

Latitude N 32.34449° Longitude W 103.08889°

NATURE OF RELEASE

Type of Release	Oil and produced water	Volume of Release	6 bbls oil, 15 bbls produced water	Volume Recovered	5 bbls
Source of Release	Gasket failure on the heater treater	Date and Hour of Occurrence	09/04/2015	Date and Hour of Discovery	
Was Immediate Notice Given?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?	Kellie Jones, Jamie Keyes, & Tomas Oberding-NMOCD		
By Whom?	Kathy Purvis, BBC International	Date and Hour	09/08/2015		
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.			

If a Watercourse was Impacted, Describe Fully.*

REVIEWED

By Kellie Jones at 11:14 am, Jan 25, 2016


Describe Cause of Problem and Remedial Action Taken.*

Gasket failure on the heater treater caused 6 bbls of oil and 15 bbls of produced water to leak onto the ground, inside the berm. A vacuum truck recovered 5 bbls of fluids and the gasket was replaced.

Describe Area Affected and Cleanup Action Taken.*

The affected area is approximately 15' x 30' on location inside the berm. Remediation was completed by removing the contaminated material from inside the lined battery and replacing it with clean material.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature:	OIL CONSERVATION DIVISION		
Printed Name: Casey Summers	Approved by Environmental Specialist: 		
Title: NM Environmental Advisor	Approval Date: 01/25/2016	Expiration Date: //	
E-mail Address: Casey_Summers@oxy.com	Conditions of Approval: //		Attached <input type="checkbox"/>
Date: 1-19-16	Phone: (575) 513-8289	IRP-3871	

* Attach Additional Sheets If Necessary

Closure Report

Site Description

Site Name:	State P Central Battery
Company:	Oxy Permian Ltd.
Legal Description:	U/L L, Section 32, T22S, R38E
County:	Lea County, NM
GPS Coordinates:	N 32.34449° W 103.08889°

Release Data

Date of Release:	09/04/2015
Type of Release:	Oil and produced water
Source of Release:	Gasket failure on heater treater
Volume of Release:	6 bbls oil, 15 bbls produced water
Volume Recovered:	5 bbls

Remediation Specifications

Remediation Parameters:	Remove contaminated soil from inside the lined containment and replace it with clean soil.	
Remediation Activities:	01/08/2016 to 01/15/2016	
Plan Sent to OCD:	n/a- lined btry	n/a- lined battery
OCD Approval of Plan:	n/a- lined btry	n/a- lined battery
Plan Sent to BLM:	n/a	n/a
BLM Approval of Plan:	n/a	n/a

Supporting Documentation

Initial C-141	Signed 09/21/2015
Final C-141	Signed 01/19/2016
Site Diagram	September 2015
Groundwater Plot	150'
TOPO Maps	September 2015
Lab Summary	n/a- lined battery
Lab Analysis	n/a- lined battery
Correspondence	n/a

Request for Closure


Based on the completion of the remediation plan as agreed upon, BBC International requests closure approval from NMOCD.

Cliff Brunson, President of BBC International Inc.

01/19/2016



Oxy
State P Central Battery

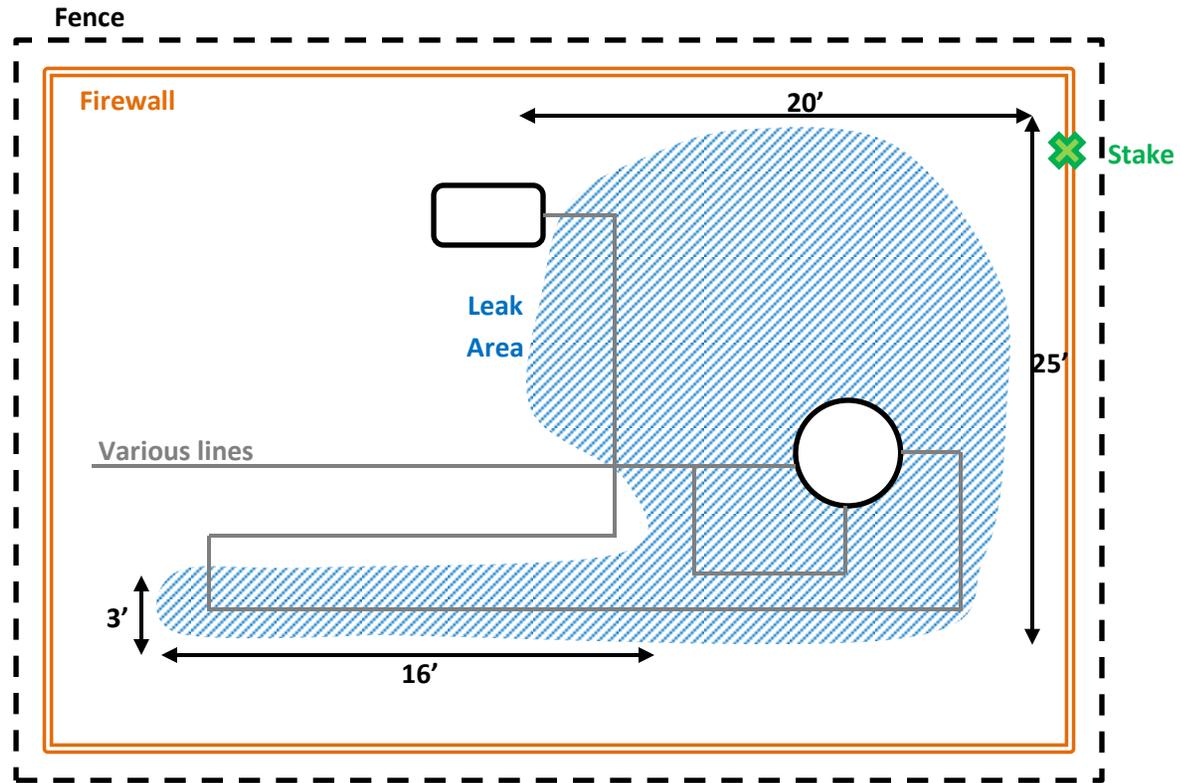

U/L L, Section 32, T22S, R38E

Lea County, NM

N 32.34449° W 103.08889°

API# 30-025-12180

BBC International, Inc.

Oxy
State P Central Battery

Date: 09/14/2015	DRWG by: K. Purvis
NOT TO SCALE	File: Oxy 2015



Groundwater Plot

Oxy State P Central Battery

County
Lea


Unit Letter
L

Section
32

Township
22S

Range
38E

Trend Map 150'

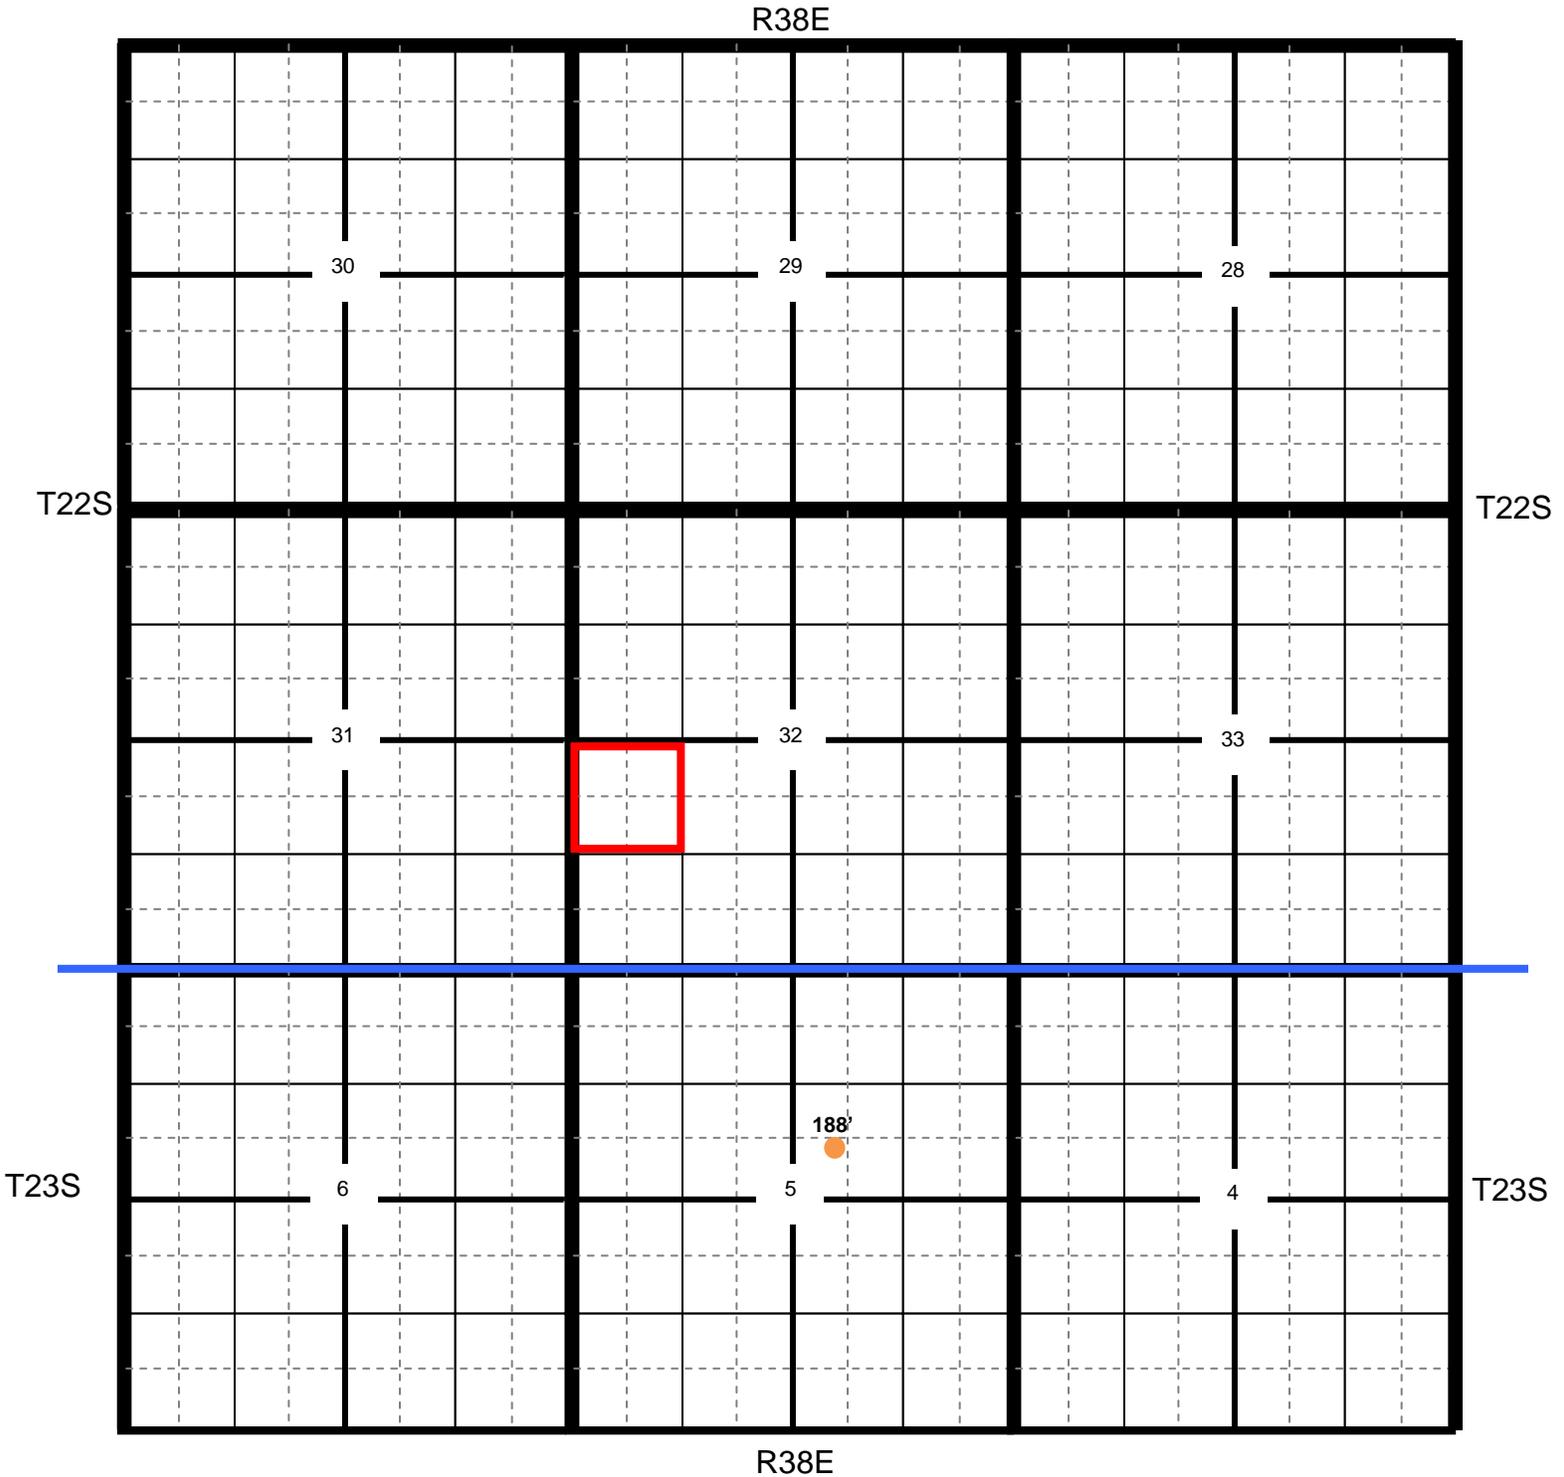

📍 Location

● OCD

● USGS

● SEO

● All Databases

Oxy State P Central Battery

County: Lea Unit Letter: L Section: 32 Township: 22S Range: 38E

Trend Map 150'

1

2


NW/NW None found	NE/NW	NW/NE	NE/NE
Unit Letter D	Unit Letter C	Unit Letter B	Unit Letter A
SW/NW	SE/NW	SW/NE	SE/NE
Unit Letter E	Unit Letter F	Unit Letter G	Unit Letter H
NW/SW	NE/SW	NW/SE	NE/SE
Unit Letter L	Unit Letter K	Unit Letter J	Unit Letter I
SW/SW	SE/SW	SW/SE	SE/SE
Unit Letter M	Unit Letter N	Unit Letter O	Unit Letter P

3

4

Oxy

State P Central Battery

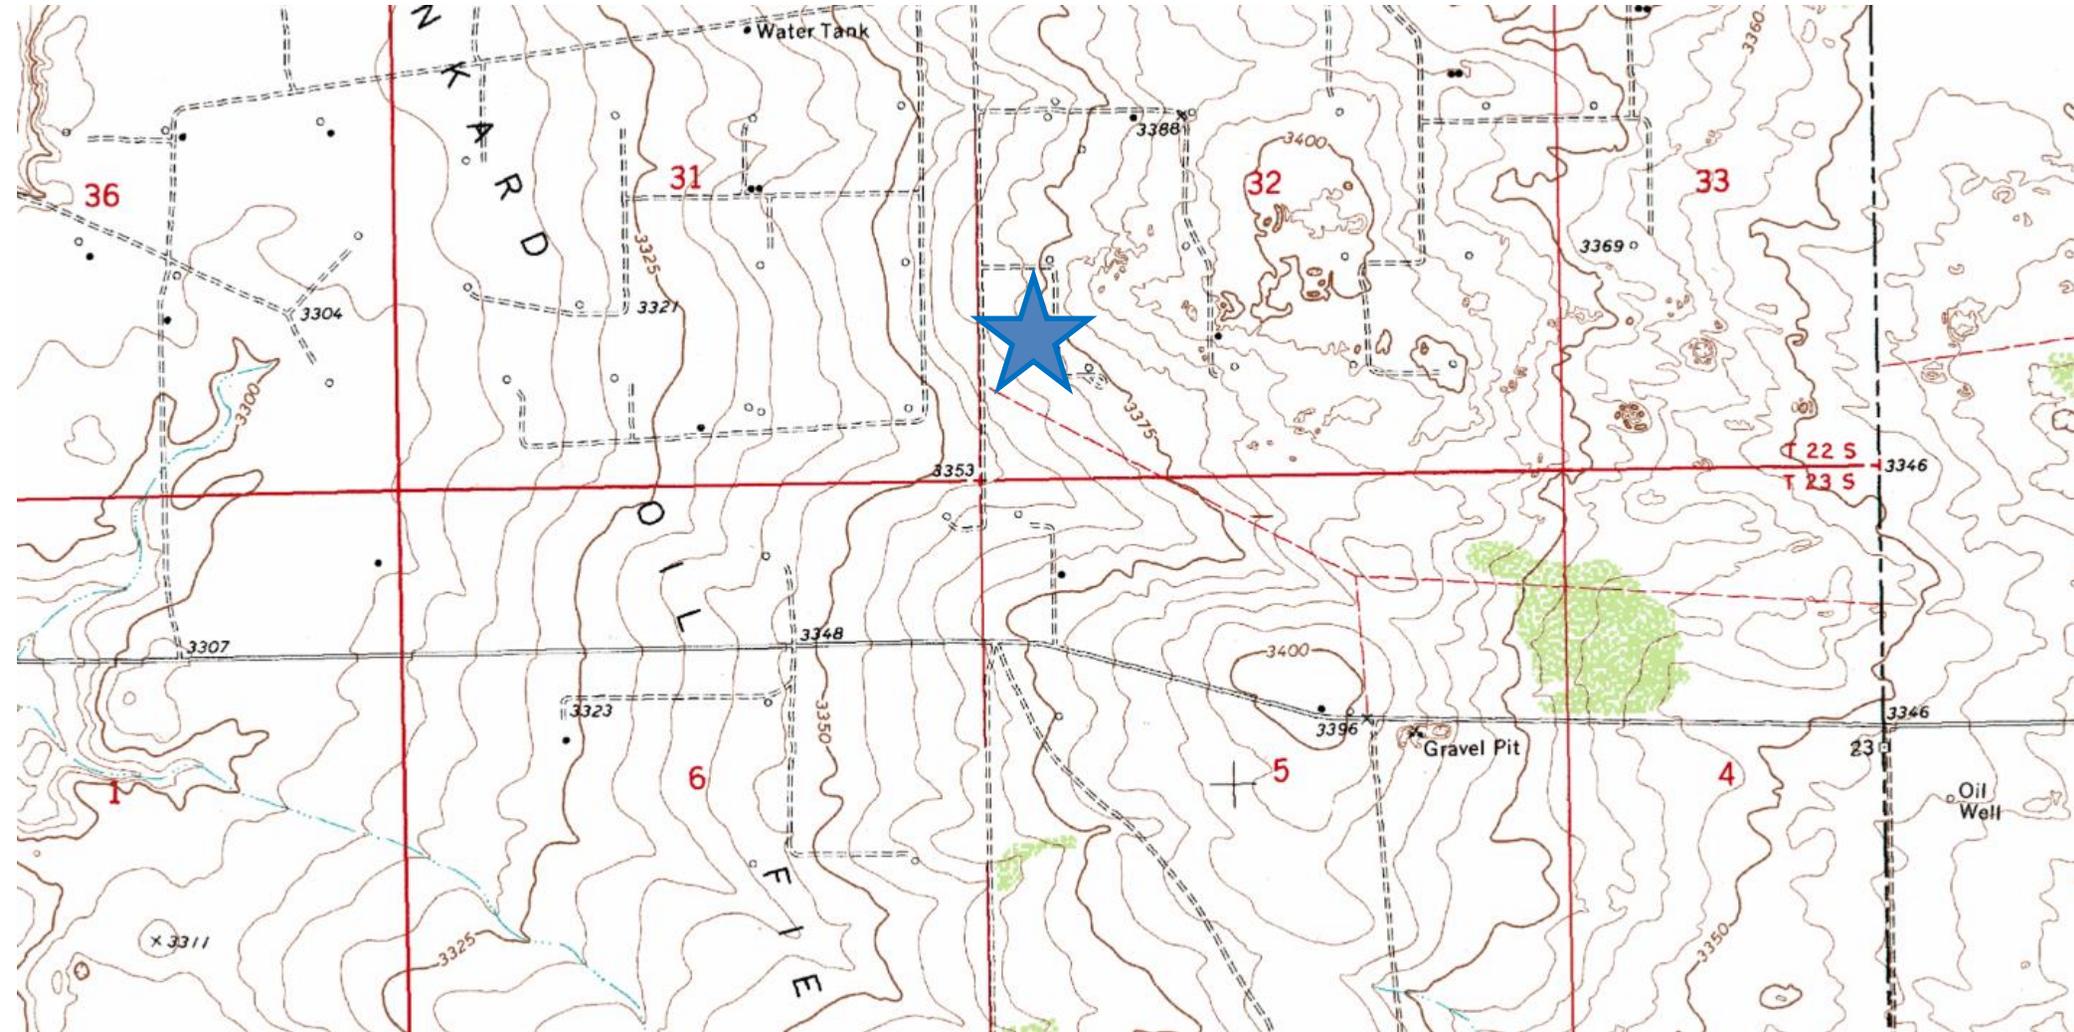























District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised August 8, 2011

Submit 1 Copy to appropriate District Office in accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

OPERATOR

Initial Report Final Report

Name of Company	Oxy Permian Ltd.	Contact	Dusty Wilson
Address	6 Desta Drive, Midland, TX 79705	Telephone No.	(432) 685-5771
Facility Name	State P Central Battery	Facility Type	Battery
Surface Owner	State	Mineral Owner	API No. 30-025-12180

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
L	32	22S	38E					Lea County, NM

Latitude N 32.34449° Longitude W 103.08889°

NATURE OF RELEASE

Type of Release	Oil and produced water	Volume of Release	6 bbls oil, 15 bbls produced water	Volume Recovered	5 bbls
Source of Release	Gasket failure on the heater treater	Date and Hour of Occurrence	09/04/2015	Date and Hour of Discovery	
Was Immediate Notice Given?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Kelle Jones, Jamie Keyes, & Tomas Oberding-NMOCD			
By Whom?	Kathy Purvis, IBC International	Date and Hour	09/08/2015	If YES, Volume Impacting the Watercourse.	
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No				

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.*

Gasket failure on the heater treater caused 6 bbls of oil and 15 bbls of produced water to leak onto the ground, inside the berm. A vacuum truck recovered 5 bbls of fluids and the gasket was replaced.

Describe Area Affected and Cleanup Action Taken.*

The affected area is approximately 15' x 30' on location inside the berm. Remediation will be completed in accordance with a remediation plan approved by NMOCD.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

OIL CONSERVATION DIVISION

Signature:

Printed Name: Dusty Wilson

Title: Environmental Advisor

E-mail Address: Dusty.Wilson@oxy.com

Date: 9/21/15 Phone: (432) 685-5771

Approved by Environmental Specialist:

Approval Date:

Expiration Date:

Conditions of Approval:

Attached

* Attach Additional Sheets if Necessary