


PASTURE

CALICHE ROAD

PAD

PASTURE

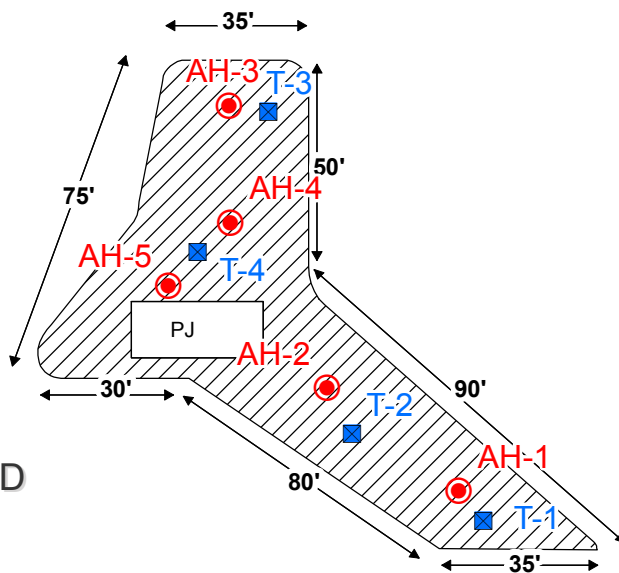

EXPLANATION

- AUGER HOLE SAMPLE LOCATIONS
- TRENCHED SAMPLE LOCATIONS
- ▨ SPILL AREA



SCALE: 1 IN = 50 FEET

Feet 0 25 50



Figure 3

Tahoe #3 Release

Spill Assessment Map

Lea County, New Mexico

Project : 212C-MD-00595

Date : 08/30/2016

File : H:\GIS\212C-MD-00595



Table 1
Foundation
Tahoe #3
Lea County, New Mexico

Sample ID	Sample Date	Sample Depth (ft)	Soil Status		TPH (mg/kg)			Benzene (mg/kg)	Toluene (mg/kg)	Ethlybenzene (mg/kg)	Xylene (mg/kg)	Total BTEX (mg/kg)	Chloride (mg/kg)
			In-Situ	Removed	GRO	DRO	Total						
NMOCD Recommended Remedial Action Levels (RRALS)					-	-	5,000	10	-	-	-	50	-
AH-1	8/1/2016	0-0.5	X		3,650	8,600	12,300	2.45	70.8	63.5	157	293	1,970
T-1	8/22/2016	0-1	X		3,300	9,400	12,700	0.733	33.3	31.8	82.1	148	202
	"	1-2	X		<15.0	109	109	<0.00150	<0.00200	<0.00200	<0.00200	<0.00150	163
	"	2-3	X			-	-	-	-	-	-	-	89.2
AH-2	8/1/2016	0-0.5	X		439	6,920	7,360	<0.0375	0.273	1.46	4.61	6.34	543
T-2	8/22/2016	0-1	X		<15.0	165	165	-	-	-	-	-	83.0
	"	1-2	X			-	-	-	-	-	-	-	57.7
AH-3	8/1/2016	0-0.5	X		<15.0	7,720	7,720	<0.00149	<0.00199	<0.00199	<0.00199	<0.00149	5,640
T-3	8/22/2016	0-1	X		<15.0	677	677	-	-	-	-	-	4,570
	"	1-2	X			-	-	-	-	-	-	-	1,830
AH-4	8/1/2016	0-0.5	X		134	2,960	3,090	<0.00749	<0.00998	0.211	0.870	1.08	712
T-4 (AH-4&5)	8/22/2016	0-1	X		22.7	415	438	-	-	-	-	-	1,690
AH-5	8/1/2016	0-0.5	X		1,790	10,600	12,400	<0.0372	0.907	4.76	23.8	29.4	1,860