

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised August 8, 2011

Submit 1 Copy to appropriate District Office in
accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company: EOG Resources, Inc.	Contact: Zane Kurtz	
Address: 5509 Champions Drive, Midland, TX 79706	Telephone No.: 432-425-2023	
Facility Name: Jolly Roger 16 State 1	Facility Type: Active Well	
Surface Owner: NM	Mineral Owner: NM	API No.: 300254166500

LOCATION OF RELEASE

Unit Letter C	Section 16	Township 24S	Range 33E	Feet from the 150	North/South Line N	Feet from the 2250	East/West Line W	County Lea
------------------	---------------	-----------------	--------------	----------------------	-----------------------	-----------------------	---------------------	---------------

Latitude 32.2244 Longitude -103.4762

NATURE OF RELEASE

Type of Release: Produced Water	Volume of Release: 50 BBLs	Volume Recovered: 0 BBLs
Source of Release: 3" valve left open and discovered by subsequent person arriving on site.	Date and Hour of Occurrence 2/10/2015	Date and Hour of Discovery 2/10/2015
Was Immediate Notice Given? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? NA	
By Whom? NA	Date and Hour	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	
If a Watercourse was Impacted, Describe Fully.* NA		

APPROVED

By Olivia Yu at 3:07 pm, May 11, 2018

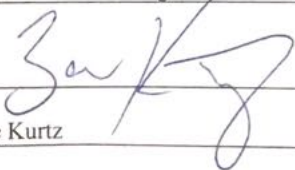

Describe Cause of Problem and Remedial Action Taken.*

Lease operator arrived on location on 10 February 2015 and noticed the open 3-inch valve and release of produced water. CH2M Hill collected soil samples on behalf of EOG Resources, Inc. on 16 February 2015 to delineate vertical and horizontal impacts.

Describe Area Affected and Cleanup Action Taken.*

Subsequent soil sampling was performed by GHD beginning in March through October of 2016. A total of approximately 456 cubic yards of impacted soil were excavated and transported to Lea Land for landfill disposal. Confirmation soil samples were collected and analytical results indicated that chloride concentrations were below the RRAL for chloride.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Zane Kurtz	Approved by Environmental Specialist: 	
Title: Sr. Environmental Representative	Approval Date: 5/11/2018	Expiration Date: xx/xx/xxxx
E-mail Address: zane_kurtz@eogresources.com	Conditions of Approval:	Attached <input type="checkbox"/>
Date: May 31, 2017	Phone: 432-425-2023	

* Attach Additional Sheets If Necessary

1RP-3541