

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-02249
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil / Gas Lease No.	B-1080
7. Lease Name or Unit Agreement Name	VACUUM GRAYBURG SAN ANDRES UNIT
8. Well No.	41
9. Pool Name or Wildcat	VACUUM GRAYBURG SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI (FORM C-101) FOR SUCH PROPOSALS.	
1. Type of Well:	OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator	CHEVRON USA INC
3. Address of Operator	15 SMITH ROAD, MIDLAND, TX 79705
4. Well Location	Unit Letter <u>F</u> : <u>1980</u> Feet From The <u>NORTH</u> Line and <u>1980</u> Feet From The <u>WEST</u> Line Section <u>1</u> Township <u>18S</u> Range <u>34E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	4003' DF

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

**NOTICE OF INTENTION TO:**


PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK ☒ ALTERING CASING ☐  
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: CLEAN OUT, ACIDIZE, RETURN TO SUB PUMP ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

11-09-04: MIRU KEY #167.  
11-10-04: CIRC WATER UP CSG. CSG PRESS UP.  
11-11-04: PUMP 1000 GALS 15% ACID DN TBG. PUMP 2000 GALS 15% ACID.  
11-12-04: WORK SUB PUMP FREE.  
11-15-04: TOH W/37 JTS 2 3/8" TBG. TIH W/132 JTS 2 3/8" PROD TBG.  
11-16-04: PU BHA: WP, BMPR SUB, JARS, DC'S, 2 7/8" WS TO 4003.  
11-17-04: C/O TO 4009. TIH W/WS, DC, JARS, BMPR SUBS. TIH W/OD SHOE. TAG UP @ 4009.  
11-18-04: TIH W/TAPER MIL, BMPR SUBS, JARS & WS. TAG UP @ 4009. MILL THRU TO 4130. TITE SPOT IN CSG @ 4009.  
11-19-04: PU MILL, SUB, JARS & DC'S TO 2095.  
11-22-04: TIH W/12 STANDS TO 3996'.  
11-23-04: REPLACE DRUM ON PU. 11-24-04: MIRU SPARE RIG. 11-29-04: TIH TO 4130. (TOP OF FISH)  
11-30-04: TIH W/2 7/8" TBG TO 4130. JAR DN ON SUB PUMP. TIH OPEN ENDED 2 7/8" WS TO 4115. SPOT 24 BBLS 15% ACID. PUH TO 2854.  
12-01-04: TIH W/SHOE, BMPR SUB, JARS, DC'S & WS. TAG FISH @ 4130. D/O FISH. PUH TO 2854.  
12-02-04: TIH W/FLAT BTM MILL, BS, JARS, DC'S & WS TO TAG @ 4130. PUSH MOTOR TO 4545. PUH TO 2554.  
12-03-04: PU MILL TO 4003. MILL FR 4003-4445. C/O LINER.  
12-06-04: PU NEW 2 3/8" PROD TBG, 40 JTS TO 1263.  
12-07-04: TIH W/2 3/8" TBG & SUB PUMP. BTM OF PUMPT @ 4308. START WELL. GOOD PUMP ACTION.  
12-08-04: RIG DOWN. FINAL REPORT  
\*\*\*\*\*ADDITIONAL INFORMATION\*\*\*\*\*  
12-28-04: MIRU KEY. 12-29-04: TOH W/SUB PUMP. TIH W/KILL STRING. 12-30-04: PUMP 30 BBLS BRINE IN TBG. ASSEMBLE PUMP. RU SPOOLER. TIH W/TBG, 134 JTS, DRAIN, 4' SUB PUMP, GAS SEPR, SEAL, MOTOR. STRIP OFF BOP. CUT CABLE, HU FL. RUN PUMP. START UP IN AM.  
FINAL REPORT

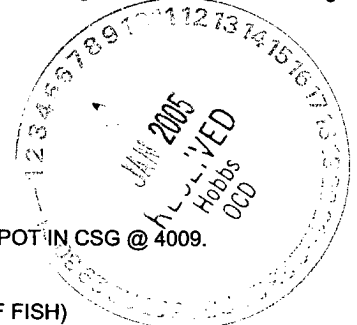

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Denise Leake

TITLE Regulatory Specialist

DATE 1/5/2005

TYPE OR PRINT NAME

Denise Leake

Telephone No. 915-687-7375

(This space for State Use)

APPROVED Harry W. White  
CONDITIONS OF APPROVAL IF ANY:

TITLE FIELD REPRESENTATIVE II/STAFF MANAGER

DATE JAN 13 2005