

Submit 3 Copies To Appropriate District
Office

District I

1625 N. French Dr., Hobbs, NM 87240

District II

811 South First, Artesia, NM 87210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION

1220 S. St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

WELL API NO. 30 025 21231
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B 2657
7. Lease Name or Unit Agreement Name: State A
8. Well No. 2
9. Pool name or Wildcat Stateline Ellenburger

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	
2. Name of Operator Bruce A. Wilbanks Company	
3. Address of Operator c/o Box 953, Midland, TX 79702	
4. Well Location Unit Letter <u>C</u> <u>752'</u> feet from the <u>North</u> line and <u>2092</u> feet from the <u>East</u> line Section <u>5</u> Township <u>24S</u> Range <u>38E</u> NMPM Lea County	
10. Elevation (Show whether DR, RKB, RT GR, etc.) <u>3393 GR</u>	

I 1. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENTJOB ☐
OTHER: TA ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

8-2-04: Rigged up, RU Craft Wireline to check free point - found 100% free @ 5521'. Chemical cut @ 5550', POOH w/ 2 7/8" tubing. SION.

8-3-04: Rotated down to top of fish @ 4423.27'. Washing scale. Worked on sand line. SION.


8-4 to 8-9-04: Working on cleaning out hole, working on fish. TOOH w/ remainder of tubing - reamed hole.

8-10-04: PU tubing & set CIBP @ 11,950'.

8-11-04: RU kill truck and tested casing to 500 psi OK for 30 minutes.

12-23-04: Ran MIT test, testing casing to 580 psi OK for 30 minutes. Notified, but not witnessed.

This Approval of Temporary
Abandonment Expires 12/23/09

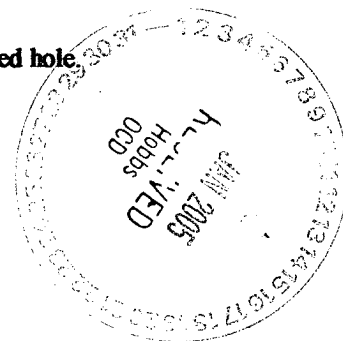

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE [Signature] TITLE Regulatory Agent DATE 1-11-05

Type or print name Ann E. Ritchie

Telephone No. 432 684-6381

(This space for State use)

APPROVED BY [Signature] TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER
Conditions of approval, if any: JAN 11 2005

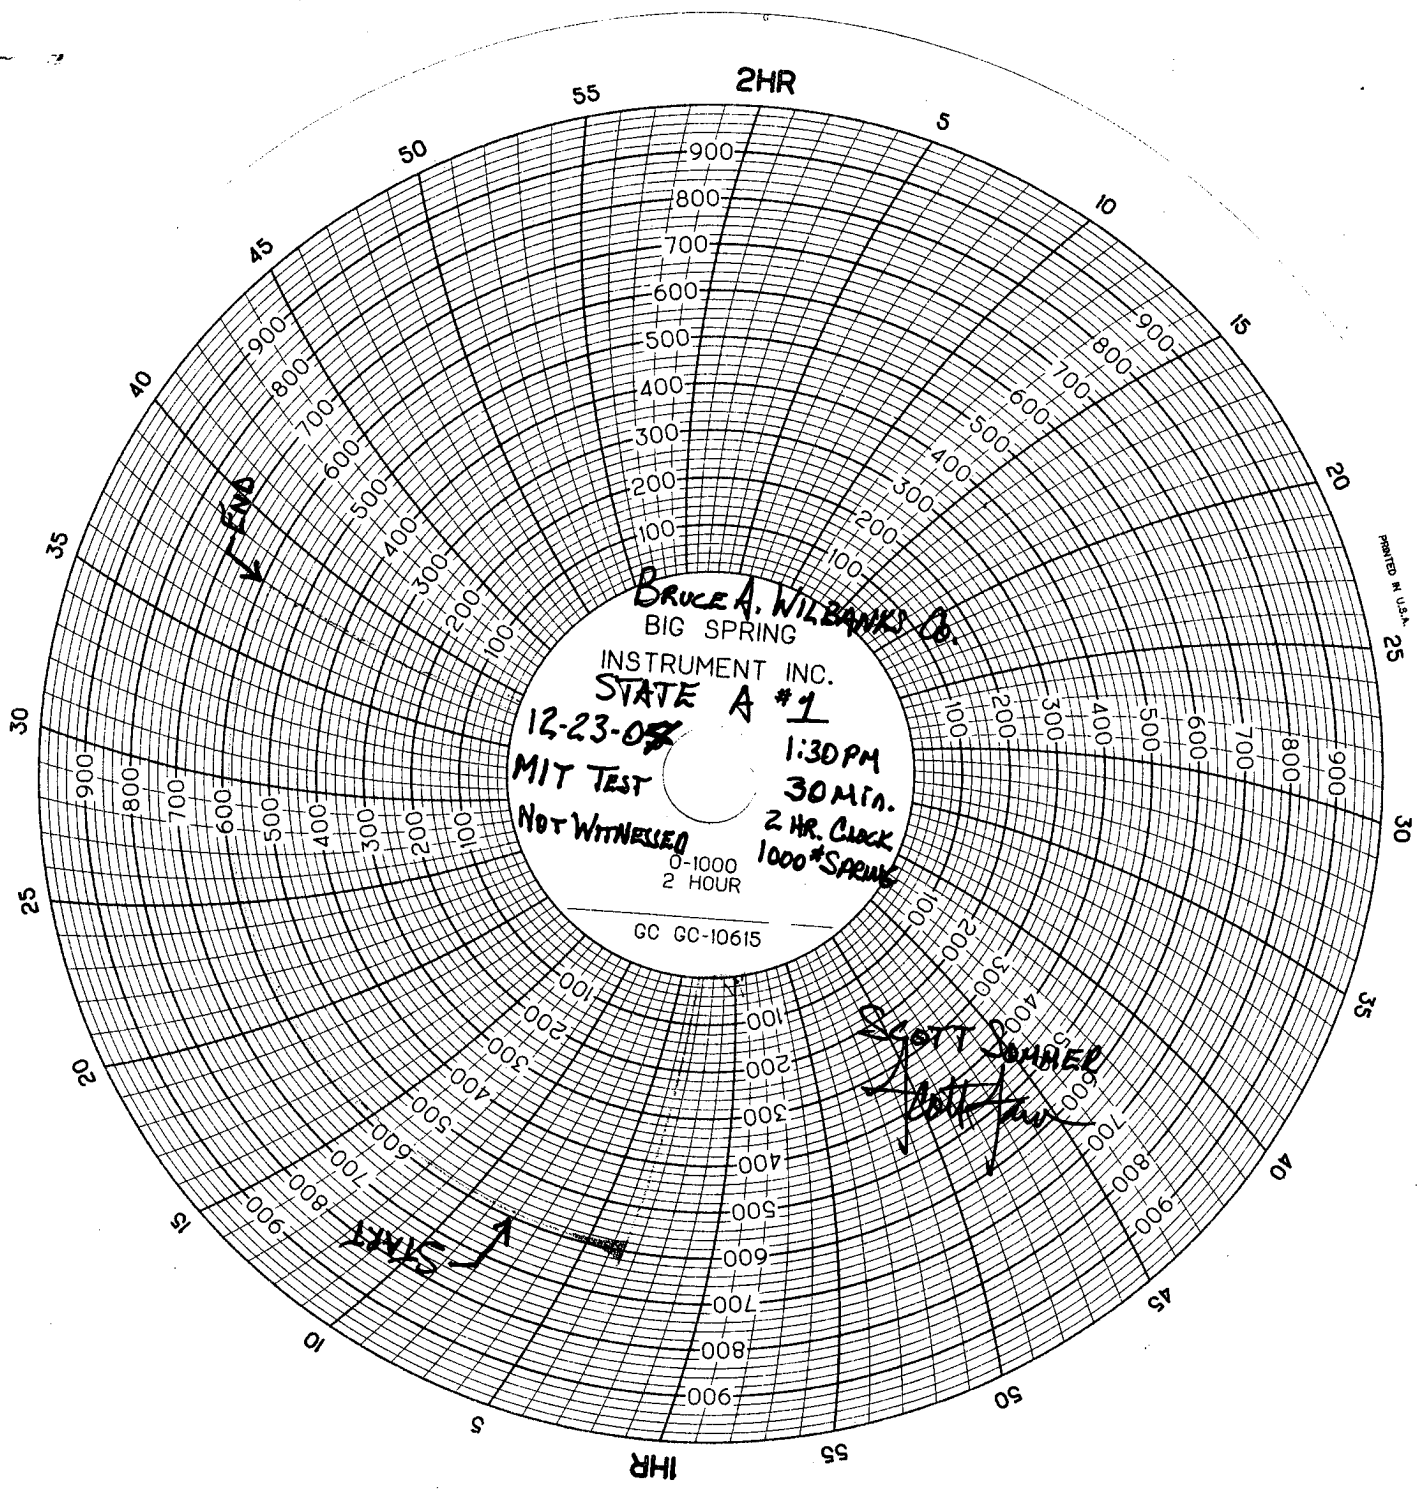

PRINTED IN U.S.A.