

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-25815
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil / Gas Lease No.	B-1056
7. Lease Name or Unit Agreement Name	CENTRAL VACUUM UNIT
8. Well No.	27
9. Pool Name or Wildcat	VACUUM GRAYBURG SAN ANDRES
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3990 GR	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI
(FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER water injection well	2. Name of Operator CHEVRON USA INC
3. Address of Operator 15 SMITH RD, MIDLAND, TX 79705	4. Well Location Unit Letter <u>J</u> : <u>1330</u> Feet From The <u>SOUTH</u> Line and <u>1425</u> Feet From The <u>EAST</u> Line Section <u>25</u> Township <u>17S</u> Range <u>34E</u> NMPM <u>LEA</u> COUNTY
11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	

NOTICE OF INTENTION TO:


PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: MIT REPAIR & CLEAN OUT ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4-03-06: MIRU. REL PKR. TOH W/140 JTS TBG. FOUND HOLE IN TBG 70 JTS OUT. LD PKR. PU RBP & PKR. PU 135 JTS 2 3/8" WS. SET RBP @ 4317. TEST CSG FR 4317-SURFACE. WOULD NOT HOLD. SET PKR @ 4311. PULL PKR TO 2115. PMP DN TBG & TEST FR 4317-2115'-GOOD.
4-04-06: TIH W/PKR, 14 JTS 2 3/8" WS TO ISOLATE HOLE IN 4 1/2" CSG. HOLES FR 428-458'. TIH W/20 JTS 2 3/8" WS TO SPOT 2 SACKS SAND ON RBP @ 4317.
4-05-06: PMP 380 SX CL C NEAT CMT TO SQZ OFF HOLES IN 4 1/2" CSG FR 427-458.
4-06-06: TIH W/BIT TO TAG CMT @ 95'. DRILLING HARD CMT FR 95-286'.
4-07-06: DRILL CMT 286-448.
4-10-06: PUMP 100 SX CL H.
4-11-06: TAT CMT @ 50' FR SURF. DRILL CMT TO 292. TIH TO 281'.
4-12-06: DRILL CMT FR 292-458. FELL OUT OF CMT. TIH TO 504. TIH W/RETR HEAD ON 2 3/8" TBG. TAG SAND @ 4308. CIRC SAND FR TOP OF RBP @ 4317. REL RBP. PULL TBG & RBP TO 2456.
4-13-06: TOH W/RBP & LD. PU BIT & 136 JTS 2 3/8" TBG. TAG FILL @ 4336. WASH & REAM 4336-4750, PBTD. DISPL W/100 BFW. PU RBP & TIH W/80 JTS 2 3/8" TBG. SET RBP @ 4317.
4-14-06: TIH W/RBP & TBG. SET RBP @ 4317. PMP 70 BBLs PKR FLUID. LD TBG. TIH W/PKR TO 630. TEST RBP TO 500 PSIG. SPOT 2 SX SAND ON RBP. RIG DOWN. FINAL REPORT

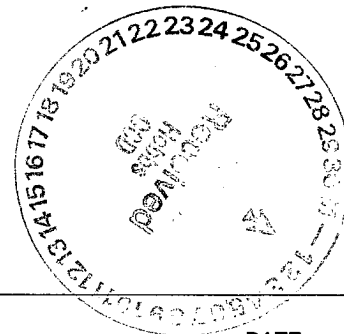

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Denise Pinkerton TITLE Regulatory Specialist DATE 4/26/2006
TYPE OR PRINT NAME Denise Pinkerton Telephone No. 432-687-7375

(This space for State Use)

APPROVED Larry W. Wink OC FIELD REPRESENTATIVE II/STAFF MANAGER
CONDITIONS OF APPROVAL, IF ANY: DATE

MAY 10 2006