

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

May 27, 2004

WELL API NO.

30-025-08651

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

E-396

7. Lease Name or Unit Agreement Name
Cone Jalmat Yates Pool Unit

8. Well Number 602

9. OGRID Number 184860

10. Pool name or Wildcat
Jalma-Tansill- Yates Seven River

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☐ Other Water Injection

2. Name of Operator

Melrose Operating Company, LLC

3. Address of Operator 5813 NW Grand Blvd Suite B
Oklahoma City, OK 73118

4. Well Location

Unit Letter J : 1980 feet from the south line and 1980 feet from the east line
Section 24 Township 22S Range 35E NMPM County Lea

11. Elevation (Show whether DR, RKB, RT, GR, etc)
3592

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type Depth to Groundwater Distance from nearest freshwater well Distance from nearest surface water

Pit Liner Thickness: mil Below-Grade Tank: Volume bbls; Construction Material

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ P AND A ☐

CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

-4-07 MIRUPU, & reverse unit, clean out 5 1/2" casing to PBTD, 3900'.

1-5-07 Rig up wireline & run casing inspection log, found bad casing, RD WL, RDPU.


2-8-07 MIRUPU, RIH w/86 jnts 4" Ultra Flush Jnt 9.50# casing, set at 3856', RDPU

2-23-07 RU & cement 4" liner w/ 300sx class "C", cement, circulate cement to surface, RD cementers

2-26-07 RU Wireline & run CBL, CCL, GR, found cement at surface, Perf Yates zone: 3670-80, 90-3700, 10-15, 20-3-, 44-58, 68-74,

80-86, w/4SPF, 244 holes, RD WL.

2-27-07 MIRUPU, RIH w/4" Baker AD-1 Nickle coated packer & 115 jnts 2 3/8", J-55, 8rd, IPC tubing, RU & circ. Packer fluid around pkr & csg., set packer in tension at 3608', RU & test csg & pkr to 300#s for 15 min., OK, RD & MO

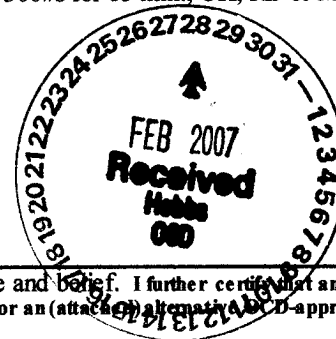

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative approved plan ☐.

SIGNATURE

Anthony Beilman

TITLE Operation Supt

DATE 02/28/2007

Type or print name Anthony Beilman

For State Use Only

E-mail address: trinityengineering@sbcglobal.net Telephone No. (405)848-4012
OC FIELD REPRESENTATIVE II/STAFF MANAGER

APPROVED BY:

Larry W. Wink

TITLE

DATE

Conditions of Approval (if any):

MAR 07 2007

