

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-32068
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Maljamar Grayburg Unit
8. Well Number 93
9. OGRID Number 8D41
10. Pool name or Wildcat Maljamar Grayburg San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other

2. Name of Operator
Forest Oil Corporation

3. Address of Operator
707 17th Street, Suite 3600, Denver, Colorado

4. Well Location

Unit Letter: O feet from the 1290 line and South feet and 1328 from the East line
Section 3 Township 17S Range 32E NMPM County Lea

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
4189 GR

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____

Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐


SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: Rod Repair ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1-31-07 - RUPU tried to pull pmp. POH w/45 rods change equipment for tbg.
2-1-07 - ND WH NU BOP. POH w/18 stands. POH w/rods. Strip job. Pmp stuck w/scale lay pmp down.
2-2-07 RU tbg tester, test 124 jts less 8 top jts had paraffin. RD tbg tester. Run paraffin knife. 4 runs to 2500' ND BOP. Set TAC Pull 12 points. NU WH change to rod equipment.
2-5-07 PU rebuilt pmp. RIH replace pmp. RU pmp truck load tbg 7 bbls. Press 500#. RD pmp truck. RD PU MO. Put on production

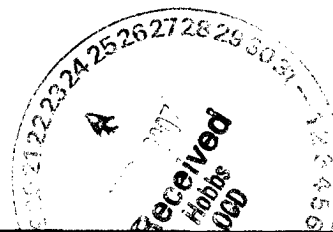

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☒, a general permit ☐ or an (attached) alternative OGD-approved plan ☐.

SIGNATURE Cindy Bush TITLE Sr. Regulatory Tech DATE 3-19-07
Type or print name Cindy Bush E-mail address: cabush@forestoil.com Telephone No. 303-812-1554

For State Use Only

APPROVED BY: Gayle W. Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE MAR 27 2007
Conditions of Approval (if any) _____