

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-24322
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	B-1080
7. Lease Name or Unit Agreement Name	VACUUM GRAYBURG SAN ANDRES UNIT
8. Well No.	48
9. Pool Name or Wildcat	VACUUM GRAYBURG SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI (FORM C-101) FOR SUCH PROPOSALS.	
1. Type of Well.	OIL WELL ☐ GAS WELL ☐ OTHER INJECTION
2. Name of Operator	CHEVRON USA INC
3. Address of Operator	15 SMITH RD, MIDLAND, TX 79705
4. Well Location Unit Letter <u>F</u> : <u>1330</u> Feet From The <u>NORTH</u> Line and <u>1330</u> Feet From The <u>WEST</u> Line Section <u>1</u> Township <u>18S</u> Range <u>34E</u> NMPM <u>LEA</u> COUNTY	
10. Elevation (Show whether DF, RKB, RT, GR, etc) <u>4005' DF</u>	

11

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☒ DEEPEN, RTRN TO INJECTION

12 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.


8-30-07: MIRU. 8-31-07: SET RBP @ 3850 SET PKR @ 3819.
9-04-07: REL PKR. PULL PKR TO 2497. SET PKR. ISOLATE HOLES IN 5 1/2" CSG 356-419.
9-05-07: TIH W/RBP TO 668. SPOT 2 SX SAND ON RBP. SQZ FR 356-419. CIRC 38 BBLS FW. FOLLOW W/125 SX PREM PLUS. 9-07-07: TAG CMT @ 262. 9-10-07: DRILL ON CMT FR 262-415. FELL OUT CMT. DRILL 153' CMT. TIH TO 468. TIH W/PKR & SET @ 419.
9-11-07: TIH W/2 7/8" WS. EOT @ 450. SQZ HOLE FR 419-356. (30 SX PREM PLUS CMT)
9-13-07: TIH W/BIT & TAG @ 175' FR SURF. DRILL 175-220, 232-452, FELL THRU. TIH TO 499 & DISPL W/10# BRINE
9-14-07: TIH W/RBP TO 668. LATCH ONTO RBP & REL. TIH TO 3843. RETEST 5 1/2" CSG TO 520#. GOOD. LATCH ON & REL RBP @ 3850. TIH W/WS & TAG UP @ 4214. 9-17-07: C/O FILL FR 4214-4800 DRILL OUT SHOE @ 4800 & NEW HOLE TO 4817.
9-18-07: TIH W/WS TO TAG @ 4793. DRILL 4793-4822. 9-20-07: DRILL & MILL 4815-4825. TIH W/BHA W/19 JTS 2 7/8" WS TO 894
9-21-07: TAG @ 4823. DRILL 4823-4947. 9-24-07: DRILL 4947-5009. (PBTD @ 5009).
9-25-07: SET RBP @ 2209. SET 2ND RBP @ 671. SPOT SAND ON RBP WASH SAND OFF RBP @ 671. REL RBP. TIH TO 2209. REL RBP. TIH W/WS TO 2200. 9-26-07: PMP 230 SX CMT TO CMT 4" CSG PMP 100 BFW. GODD. CIRC TO PIT. PMP 230 SX. BUMP PLUG @ 1400#.
9-27-07: MOVE 172 JTS 2 3/8" WS. PU BIT & TAG @ 4955. RUN GR/CNL. LOG FR 4955-2950. TIH W/CBL/CCL/GR. LOG FR 4955-1400.
9-28-07: MOVE IN 156 JTS 2 3/8" TBG. 10-01-07: TIH & RUN GR/CNL FROM 4955-4800. PERF 4810-4820, 4846-4852, 4792-4796, 4799-4804, 4824-4836. TIH W/WS TO 2514. 10-02-07: PERF 4770-78, 4782-88, 4746-53, 4756-66. TIH W/PKR & SET @ 4651'. EOT @ 2544.
10-03-07: TIH TO 4650. DISPL W/50 BBLS 10# BW. SET PKR @ 4650. SWAB. 10-05-07: ACIDIZE 4746-4852 W/6000 GALS 15% ACID HCL.
10-08-07: GIH W/TBG. LATCH ONTO PKR @ 4650. 10-09-07: RU TO CHART & TEST 4" CSG TO 580#. LEAK OFF 40# IN 33 MINS TEST GOOD. (ORIGINAL CHART & COPY OF CHART ATTACHED).
RIG DOWN FINAL REPORT
10-25-07: INJ'G 514 BWPD.

PMX III

I hereby certify that the information above is true and complete to the best of my knowledge and belief

SIGNATURE Denise Pinkerton TITLE Regulatory Specialist

TYPE OR PRINT NAME Denise Pinkerton

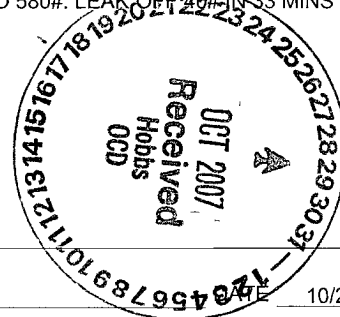


10/26/2007
Telephone No 432-687-7375

(This space for State Use)

APPROVED Hayward Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER
CONDITIONS OF APPROVAL, IF ANY: DATE

OCT 30 2007

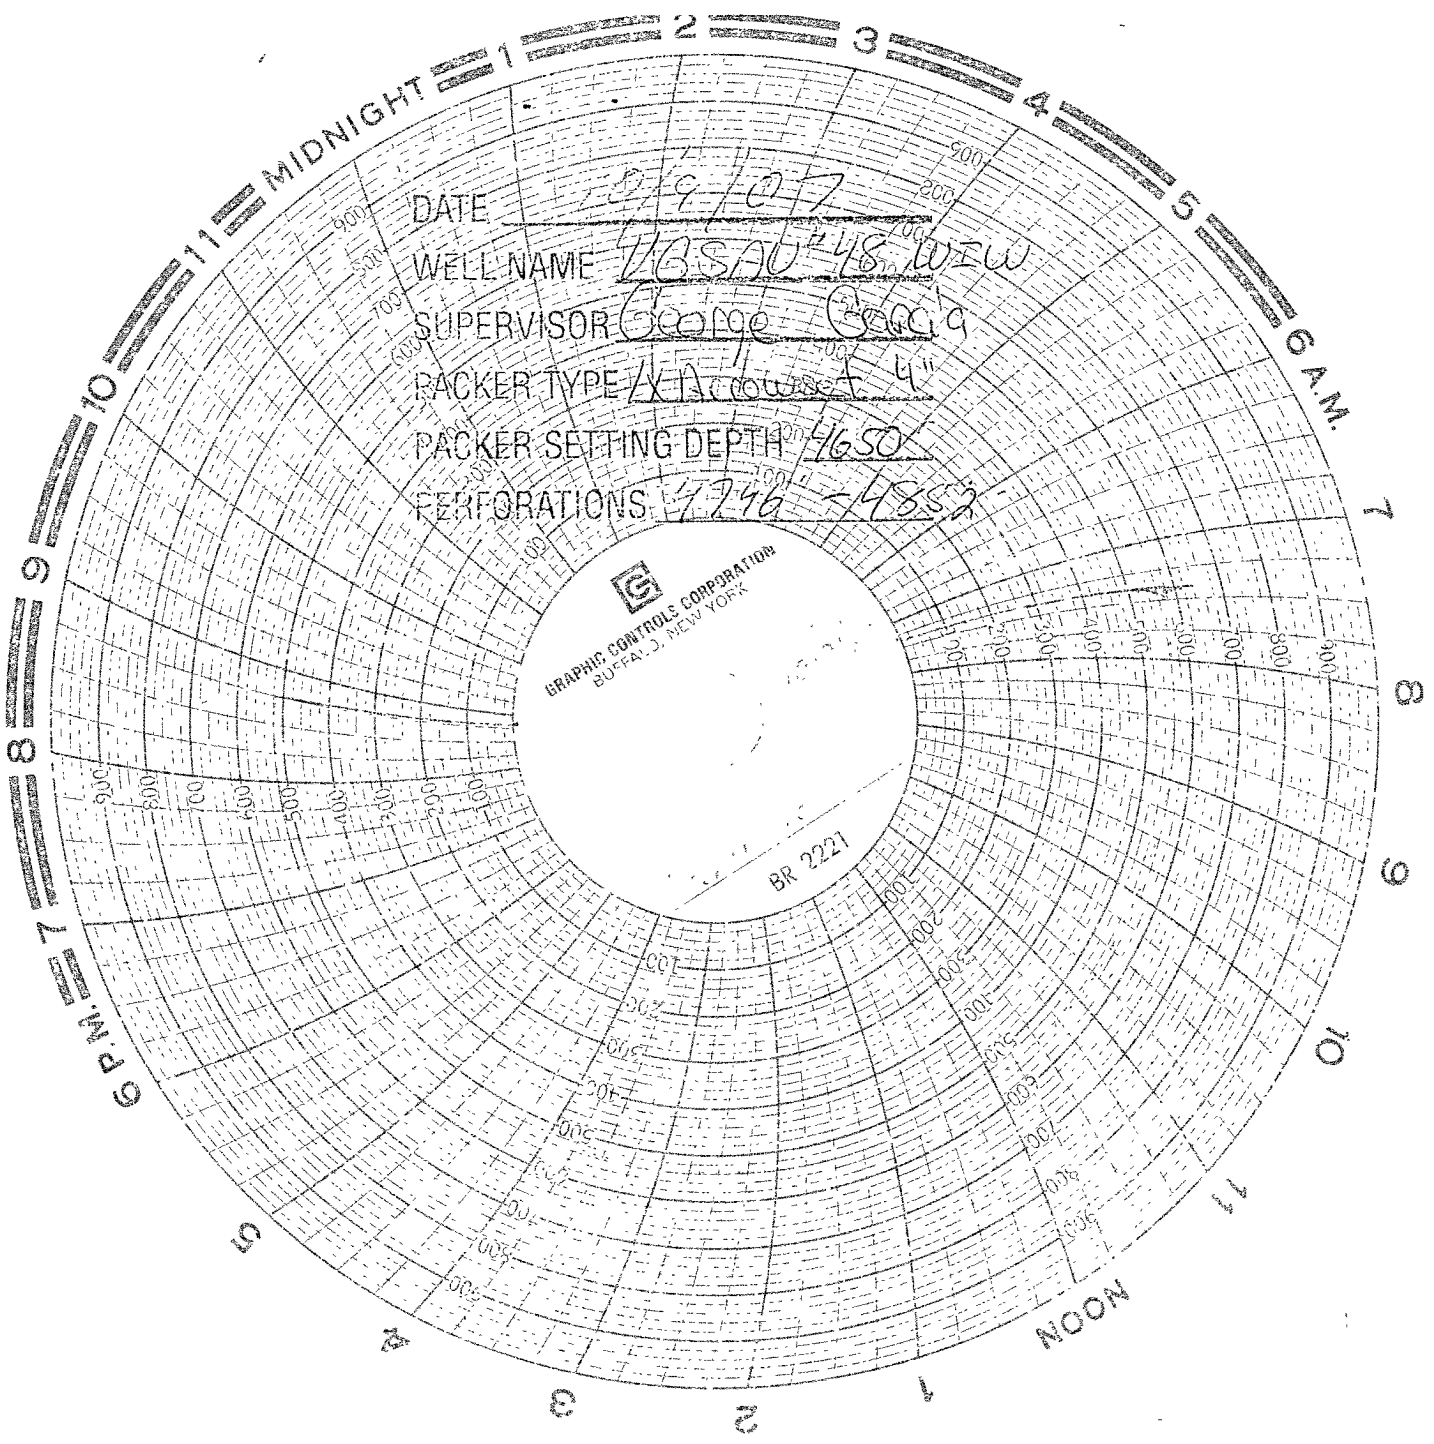

DATE 2/9/07
WELL NAME WBSAU#48 WEW
SUPERVISOR George B. G. G.
PACKER TYPE Accu-set 4"
PACKER SETTING DEPTH 4650
PERFORATIONS 4246 - 4852

GRAPHIC CONTROLS CORPORATION
BUFFALO, N. Y.

BR 2221

7628' FWL - 1980 FNL
UNIT Letter F
Sec: 1

Twp: 18S

Rge 34E

APL 30-05-05
308413