
Submit 3 Copies To Appropriate District Office	Blate of New Mexico		Form C-103 June 19, 2008
District I	rgy, Minerals and Natu	1	WELL API NO. /
District II	CONSERVATION	DIVISION	30-025-08109 5. Indicate Type of Lease
District III 1000 Rio Brazos Rd., Aztec, NM 874 MAY 1 8 200	9 1220 South St. Frar	ncis Dr.	STATE FEE FEE
District IV 1220 S. St. Francis Dr., Santa Fe, NOBBSOC 87505	Santa Fe, NM 87	/505	6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH			7. Lease Name or Unit Agreement Name GILMORE FEDERAL
PROPOSALS.) 1. Type of Well: Oil Well ☐ Gas Well ☒ Other S ₩ ☐			8. Well Number 001
2. Name of Operator STRATA PRODUCTION COMPANY			9. OGRID Number 21712
3. Address of Operator		10. Pool name or Wildcat	
PO BOX 1030, ROSWELL, NM 88201			SWD; Delaware
4. Well Location Unit Letter : 1980' feet from the SOUTH line and 660' feet from the EAST line			
Section 21 Township 22S Range 32E NMPM County LEA			
11. Elevation (Show whether DR, RKB, RT, GR, etc.)			
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data			
TEMPORARILY ABANDON	ON TO: ND ABANDON ☐ E PLANS ☐ LE COMPL ☐	SUBS REMEDIAL WORK COMMENCE DRIL CASING/CEMENT	LING OPNS. P AND A
OTHER:	. 🗆	OTHER: Run 5 ½"	on SWD. Repair Casing and Cement.
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.			
04/08/09- MIRU. Release pkr. TOH. Prep to find hole in casing and repair. 04/10/09- Squeeze hole between 300' - 330'. Pump 100 sx CL "C". Circ up 11" casing. SI & WOC.			
04/13/09- Drlg cement and metal. 8 5/8" casing parted @ 316'. 04/23/09- Drlg and clean out top of 8 5/8" casing. Work 2 7/8" tbg through casing stub.			
04/24/09- Tag up on fill @ 2058". Wash down to 2115'.			
04/28/09- PU and GIH w/ over-shot mill. Clean out around mandril. TOH. TIH w/ ret. tool. Latch onto RBP & TOH w/ tools. GIH w/			
7 7/8" bit and stabilizers. Clean out to 4800'. 05/05/09- TIH w/ 8 5/8" CIBP. Set pipe @ 4689'. TOH w/tbg. PU and GIH w/ float shoe. Float collar and 114 jts 5 1/2 17# LT&C. Set			
pipe @ 4688'. Cement w/ 760 sx 75#/Blend. Circ 71 sx to surface. WOC. Witnessed by OCD. 05/08/09- Drlg out cement float collar. Float shoe and CIBP. TOH and lay down tools.			
05/09/09- TIH w/ 5 1/2" Nickel coated pkr. Circ. and notified BLM and OCD. RD. Rel	pkr fluid. Set pkr @ 4085'.	Flange up. Test casin	g to 500# for 30 min. OK. Run chart
Spud Date:	Rig Release Da	ite:	
I hereby certify that the information above is true and complete to the best of my knowledge and belief.			
SIGNATURE Than & YM	TITLE VICE-P	RESIDENT	DATE <u>05/18/2009</u>
Type or print name FRANK MORGAN E-mail address: fmorgan@stratanm.com PHONE: 575-622-1127 For State Use Only			
APPROVED BY: DISTRICT 1 SUPERVISOR DATE MAY 2 2 2009 Conditions of Approval (if any)			

15. ##

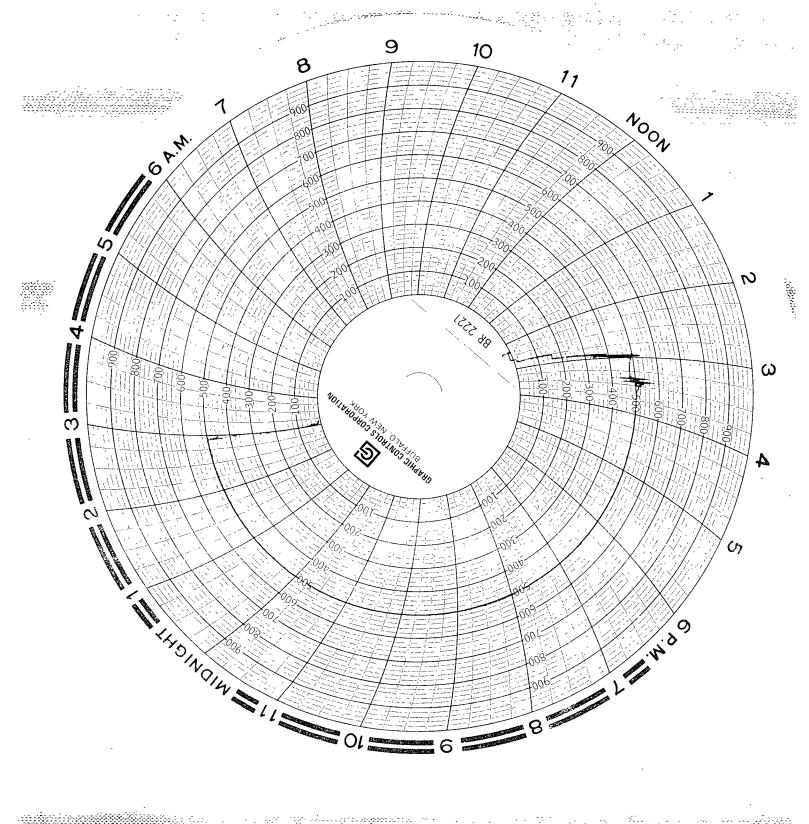


JAW KILLTRUCK # 1495 Journal Deuth 413 Steva I Farish

GILMONE FED # 1
SWD

API-30-025-18109
SEC. 21 T325 R32E
1980' FSL + 660' FEL
1980' FSL + 660' FEL
LEWIE NM-77058

30 min. 500th Casing Tantourts test

POST OFFICE DRAWER 1030 ROSWELL, NM 88202-1030



TELEPHONE (575) 622-1127 FACSIMILE (575) 623-3533

1301 NORTH SYCAMORE AVENUE ROSWELL, NEW MEXICO 88201 www.stratanm.com

RECEIVED

May 20, 2009

MAY 2 1 2009 HOBBSOCD

Oil Conservation Division Hobbs District Office Attn: Buddy Hill 1625 N. French Dr. Hobbs, NM 88240

Re:

Form 3160-5 Sundry Notices & Reports on Wells

Gilmore Federal #1

Lea County, New Mexico

To Whom it May Concern,

Attached is the Casing integrity test you requested. Should you require additional information regarding the Gilmore Federal #1 SWD, please contact this office.

Sincerely,

Vennifer Zapata C Production Analyst

Enclosures