



New Mexico Energy, Minerals and Natural Resources Department

Bill Richardson

Governor

Jim Noel

Cabinet Secretary

Karen W. Garcia

Deputy Cabinet Secretary

Mark Fesmire

Division Director

Oil Conservation Division



Response Required – Deadline Enclosed

Underground Injection Control Program

"Protecting Our Underground Sources of Drinking Water"

21-Jul-10

OXY USA INC
PO BOX 4294
HOUSTON TX 77210-

OXY USA INC.
1017 W. STANOLIND RD.
HOBBS, NM 88240

LETTER OF VIOLATION and SHUT-IN DIRECTIVE
Failed Mechanical Integrity Test

Dear Operator:

The following test(s) were performed on the listed dates on the following well(s) shown below in the test detail section.

The test(s) indicates that the well or wells failed to meet mechanical integrity standards of the New Mexico Oil Conservation Division. To comply with guidelines established by the U.S. Environmental Protection Agency, the well(s) must be shut-in immediately until it is successfully repaired. The test detail section which follows indicates preliminary findings and/or probable causes of the failure. This determination is based on a test of your well or facility by an inspector employed by the Oil Conservation Division. Additional testing during the repair operation may be necessary to properly identify the nature of the well failure.

Please notify the proper district office of the Division at least 48 hours prior to the date and time that the well(s) will be retested so the test may be witnessed by a field representative.

MECHANICAL INTEGRITY TEST DETAIL SECTION

AZTEC STATE No.006

Active Injection - (All Types)

30-025-01315-00-00
E-8-17S-33E

Test Date:	7/19/2010	Permitted Injection PSI:		Actual PSI:	
Test Reason:	Annual IMIT	Test Result:	F	Repair Due:	10/22/2010
Test Type:	Std. Annulus Pres. Test	FAIL TYPE:	Other Internal Failure	FAIL CAUSE:	
Comments on MIT:	ATTEMPTED PT; STOPPED TEST; HOLE AT SURFACE UP CLOSE TO WELLHEAD (OUTSIDE OF CASING); FAILED PRESSURE TEST; *****OPERATOR IN VIOLATION OF NMOCD RULE19.15.26.11*****				

AZTEC STATE No.007

Active Injection - (All Types)

30-025-22397-00-00
G-8-17S-33E

Test Date:	7/19/2010	Permitted Injection PSI:		Actual PSI:	
Test Reason:	Annual IMIT	Test Result:	F	Repair Due:	10/22/2010
Test Type:	Std. Annulus Pres. Test	FAIL TYPE:	Other External Failure	FAIL CAUSE:	
Comments on MIT:	FAILED MIT; AT WELLHEAD WITHIN FLANGE AREA COMMENCED TO LEAK WHILE PRESSURING UP ON WELL FOR PT; *****OPERATOR IN VIOLATION OF NMOCD RULE 19.15.26.10*****				

Oil Conservation Division
1625 French Drive • Hobbs, New Mexico 88240
Phone (575) 393-6161 • Fax (575) 393-0720 • www.emnrd.state.nm.us/OCD



AZTEC STATE No.015

30-025-27297-00-00
G-7-17S-33E

Active Injection - (All Types)
Test Date: 7/19/2010 Permitted Injection PSI: Actual PSI:
Test Reason: Annual IMIT Test Result: F Repair Due: 10/22/2010
Test Type: Std. Annulus Pres. Test FAIL TYPE: Other Internal Failure FAIL CAUSE:
Comments on MIT: WELL TOOK 13 BBLS TO LOAD; COMMENCED PT WELL WOULD NOT HOLD PRESSURE;*****
OPERATOR IN VIOLATION OF NMOCD RULE 19.15.26.11*****


CENTRAL CORBIN QUEEN UNIT No.104

30-025-29740-00-00
A-9-18S-33E

Active Injection - (All Types)
Test Date: 7/19/2010 Permitted Injection PSI: Actual PSI:
Test Reason: Annual IMIT Test Result: F Repair Due: 10/22/2010
Test Type: Std. Annulus Pres. Test FAIL TYPE: Other Internal Failure FAIL CAUSE:
Comments on MIT: DID NOT ATTEMPT PRESSURE TEST; WELL HAS 1000# ON CASING / 810# ON TUBING; POSSIBLE
TUBING/PKR FAILURE; ***** OPERATOR IN VIOLATION OF NMOCD RULE
19.15.26.11*****

In the event that a satisfactory response is not received to this letter of direction by the "Repair Due:" date shown above, or if the well(s) are not immediately shut-in, further enforcement will occur. Such enforcement may include this office applying to the Division for an order summoning you to a hearing before a Division Examiner in Santa Fe to show cause why you should not be ordered to permanently plug and abandon this well. Such a hearing may result in imposition of CIVIL PENALTIES for your violation of OCD rules.

Sincerely,




Hobbs OCD District Office

COMPLIANCE OFFICER

Note: Pressure Tests are performed prior to initial injection, after repairs and otherwise, every 5 years; Bradenhead Tests are performed annually. Information in Detail Section comes directly from field inspector data entries - not all blanks will contain data. "Failure Type" and "Failure Cause" and any Comments are not to be interpreted as a diagnosis of the condition of the wellbore. Additional testing should be conducted by the operator to accurately determine the nature of the actual failure. * Significant Non-Compliance events are reported directly to the EPA, Region VI, Dallas, Texas

EMNRD
OIL CONSERVATION DIVISION
1625 N FRENCH DRIVE
HOBBS NM 88240

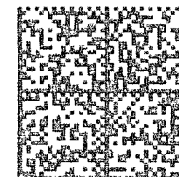

HASLER	017H15554612	US POSTAGE
	\$0.440	
	07/21/2010	
	Mailed From 88240	

OXY USA INC.
P.O. BOX 4294
HOUSTON, TX 77210