

Submit 1 Copy To Appropriate District Office

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
October 13, 2009

RECEIVED
District I
1625 N. 1st St., Santa Fe, NM 87505
District II
1301 W. Grand Ave., Artesia, NM 88210
District III **FEB 28 2011**
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. 6th St., Santa Fe, NM 87505
HOBBSUCD

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-02255 ✓
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. B-3011-1
7. Lease Name or Unit Agreement Name VACUUM GRAYBURG SAN ANDRES UNIT ✓
8. Well Number 26 ✓
9. OGRID Number 241333 ✓
10. Pool name or Wildcat VACUUM GRAYBURG SAN ANDRES ✓

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐	
2. Name of Operator CHEVRON MIDCONTINENT, L.P. ✓	
3. Address of Operator 15 SMITHG ROAD, MIDLAND, TEXAS 79705	
4. Well Location Unit Letter K: 1980 feet from the SOUTH line and 1980 feet from the WEST line Section 1 Township 18.0S Range 34E NMPM County LEA	
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☒	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	P AND A ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPL ☐	CASING/CEMENT JOB ☐	
DOWNHOLE COMMINGLE ☐			
OTHER: ☐		OTHER: ☐	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

WRITE AND REVIEW JSA'S. UPDATE AS JOB SCOPES CHANGE.

MIRU PU. BLEED DOWN WELL. UNHANG WELL. POOH TO ROD PART. PU FISHING TOOL. RIH W/ RODS AND LATCH ONTO FISH. POOH W/RODS AND LD PUMP, K-BARS AND ANY BAD RODS AS NEEDED. KILL WELL W/BBW DOWN TBG. AND ANN. NDWH. NUBOP. RU TUBOSCOPE. POOH WHILE SCANNING 2 7/8" TBG. PU NEW 24' X 3 1/2" BULL PLUGGED AND SLOTTED MUD ANCHOR, 2 7/8" LIFT SUB. SS MECH SN WITH 14' X 1 1/4" DIP TUBE ATTACHED, 1- 2 7/8" J-55 6.5# TK-99 JT., RIH W/ REST OF TBG. WHILE HYDROTESTING TBG. TO 6500# TO FHD OF 4560'. NDBOP. SET TAC. NUWH. PU PUMP AND K-BARS RIH W/RODS. SPACE OUT AND HANG ON. LOAD AND TEST. RD CLEAN LOCATION. MO. ALL WORK WILL BE DONE ON EXPENSE

Spud Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE: Tejay Simpson TITLE: OPERATIONS SUPERVISOR DATE: FEBRUARY 25, 2011

Type or print name: TEJAY SIMPSON E-mail address: tsimpson@chevron.com PHONE: 575-396-4414 ext 201

For State Use Only


APPROVED BY: [Signature] TITLE: STAFF MGR DATE: 3-1-2011

Conditions of Approval (if any):

Chevron U.S.A. Inc. Wellbore Diagram : VGSAU 026



[Lease] OVC VACUUM [Well No.] VGSAU 26 VGSA 26 [Field] FLD-VACUUM
 [Location] 1980FSL1980FWL [Sec.] N/A [Blk] _____ [Survey] N/A
 [County] Lea [St.] New Mexico [Refno] FA3416 [API] 3002502255 [Cost Center] BCT492200
 [Section] 1 [Township] 018 S [Range] 034 E
 [Current Status] ACTIVE [Dead Man Anchors Test Date] 05/03/2006
 [Directions] _____

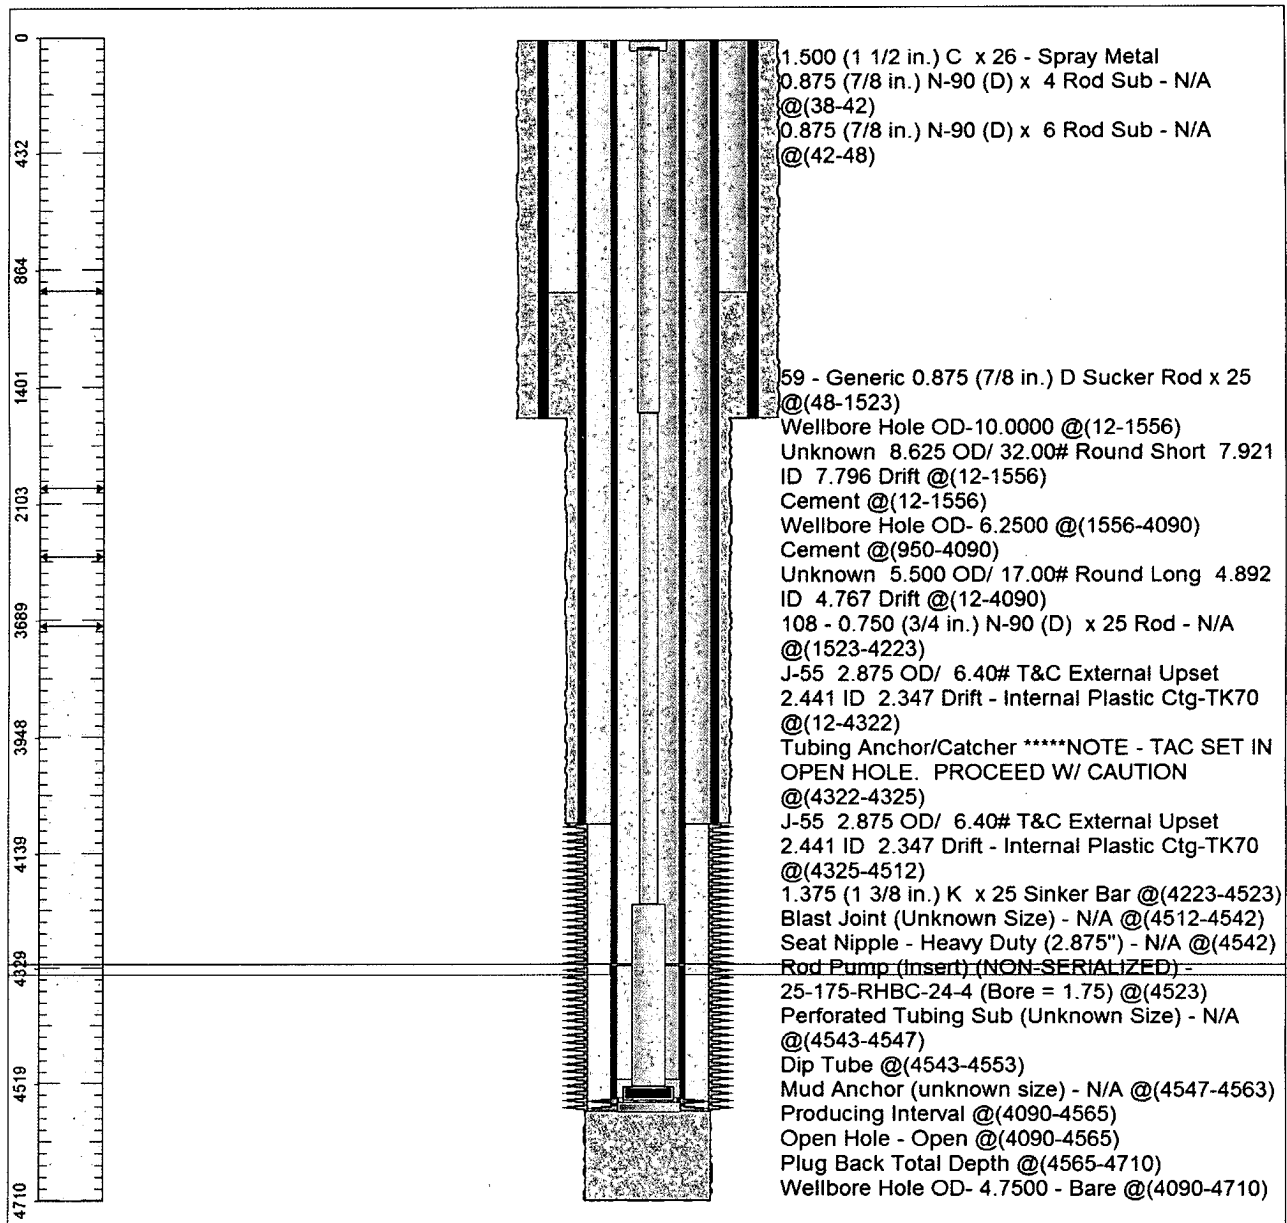

[Ground Elevation (MSL):] 4003.00 [Spud Date] 06/07/1970 [Compl. Date] 07/08/1970
 [Well Depth Datum:] CSI0000N [Elevation (MSL):] 4015.00 [Correction Factor] 12.00
 [Last Updated by] acostde [Date] 02/09/2011
 [null] null [null] null