


THE MAURICE L. BROWN COMPANY

Lane "B" 674 LTD #3

- 3-12-76 Ran West Eng. pressure bomb to 3890'. Could not get below that depth. Pulled out of hole.
Move in Baber Well Service.
- 3-13-76 Rig up unit - pick up mud anchor and seating nipple crossover to seal lock and 257 jts. 2-7/8" seal lock tubing. Set down @ 7991.30 GL, or 8012 KB measure. Layed down 1 joint and land on flange to swab down. Ran swab to S/N - no fluid in hole. Pump 100 bbls. fresh water and 10 gallons soap down casing. Shut down @ 4:30 pm.
- 3-14-76 SD for Sunday
- 3-15-76 Attempt to work past bridge @ 8012'. Made no progress. Start tubing out of hole - found tubing walls dry. Went back to bottom and pump 100 bbls. fresh water down casing. Work 1 hour, no progress. SD @ noon to allow water to soak on expected salt bridge. Ordered 2nd load of water for Monday p.m. Pump down casing.
- 3-16-75 Attempt to work through bridge - no progress in one hour. Pulled out of hole. Bottom of anchor was polished but not scarred. Went in hole w/6" Rock Bit. Turned and spudded 1½ hrs. Stuck bit and plugged tubing. Loaded tubing w/25 bbls. fresh water. Pressured to 3000#, no leak off. Indicate fluid level 4,000', approximate. Swab tubing to 5,000', and pump 150 bbls. fresh water down casing. Shut down for night @ 6:30 p.m.
- 3-17-76 Swab tubing to seating nipple. No fluid entered into tubing. Latch on to tubing to work and tubing was free. Lower tubing to bottom and tag bottom @ 9684 KB. Pulling tubing out of hole to run production equipment.

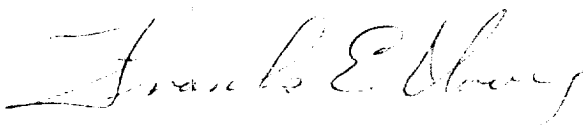

Frank E. Novy
Manager, Production & Exploration
FN:mj