


Santa Fe

(SUBMIT IN TRIPLICATE)

Land Office

LC-067771

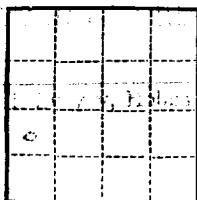

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

HOODS OFFICE 000
1660 FEB 2 1960
Whitehall Oil Company,
Inc. #1 Federal

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 19 60

Well No. **1** is located **1830** ft. from **N** line and **660** ft. from **E** line of sec. **14**
Sw/4 14 **9-S** **36-E** **NMPM**
 (1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Undesignated **Lea** **New Mexico**
 (Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is **4044** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work.)
 Drilled to 369' - set 15-3/8" 48# H-40 casing and Baker Guide Shoe & Float Collar to 369'. Cemented w/300 sx. cement w/2% CC. Circulated back to surface-plug down @ 9:45 A.M., 11/1/59. Waited 24 hrs. - tested casing w/1000# 30 mins. - no drop in pressure. Drilled to 4300', set 4300' of 8-5/8" casing consisting of 540' of 32# J-55, 2494' of 24# J-55, 1266' of 32# H-40 and Baker Guide Shoe & Float Collar. Cemented w/1500 sx. of Pozmix w/6% Gel and 100 sx. Neat cement w/2% C.C. Circulated to surface. Plug down @ 10:20 P.M. 11/10/59. Waited 24 hrs. - tested casing w/1000#. No drop in pressure.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **Whitehall Oil Company, Inc.**

Address **1814 Mercantile Bank Building,**

Dallas 1, Texas

By **James B. Neale**
Title **Office Manager**