


Form 9-331a  
(Feb. 1951)

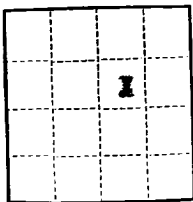

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office .....

Lease No. **12-060307**

Unit .....

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL .....	SUBSEQUENT REPORT OF WATER SHUT-OFF .....
NOTICE OF INTENTION TO CHANGE PLANS .....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING .....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF .....	SUBSEQUENT REPORT OF ALTERING CASING .....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL .....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR .....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE .....	SUBSEQUENT REPORT OF ABANDONMENT .....
NOTICE OF INTENTION TO PULL OR ALTER CASING .....	SUPPLEMENTARY WELL HISTORY .....
NOTICE OF INTENTION TO ABANDON WELL .....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Love Federal "A" No. 1

March 13, 1961

Well No. **1** is located **1920** ft. from **N** line and **1980** ft. from **E** line of sec. **17**

**NE 1/4 Sec. 17**

(1/4 Sec. and Sec. No.)

**S 3**

(Twp.)

**36 E**

(Range)

**N 71° 15' W**

(Meridian)

**Undesignated**

(Field)

**Roosevelt**

(County or Subdivision)

**New Mexico**

(State or Territory)

The elevation of the derrick floor above sea level is **4126** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spotted 30 sack cement plug from FBD 9760' to 8850'. Pulled up to 8810' and loaded hole with salt water mud. Ran freepoint and found 4 1/2" casing free at 8870' and stuck at 8880'. Top of cement plug in 4 1/2" casing at 8890'. McCullough made cut with chemical cutter at 8870'. Pulled 272 joints of 4 1/2" casing, 8857.70'. Pumped 110 sacks of common cement down 11 3/4" x 8 5/8" casing annulus. Placed 50 sack cement plug from 5060 to 4900'. Job completed at 12 midnight 3-11-61. Removed 11 3/4" casing-band. Placed 10 sack cement plug from 30' to surface in top of 8 5/8" casing. Installed dry hole marker in place. Released rig and well plugged and abandoned at 8 PM 3-12-61.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **The Atlantic Refining Company**

Address **P. O. Box 1610**

**Midland, Texas**

By **M. J. Miller & L. J. Mills**

Title **Regional Drilling Supt.**