


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

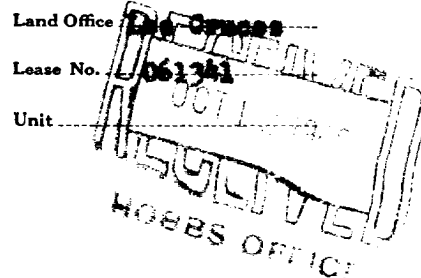

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF REDRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 7, 1948

Well No. 1-Sanders is located 1980 ft. from N line and 660 ft. from E line of sec. 5

NE 1/4 Sec. 5 (1/4 Sec. and Sec. No.) R-9 (Twp.) 37-1 (Range) N 100 W (Meridian)

Blount (Field) Roosevelt (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 4072 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drilled 11-inch hole to 3958 feet. Ran 8 5/8-inch casing to 3936 feet and cemented with 2850 sacks cement. Circulated with 2175 sacks and left 175 sacks in casing. After W.O.C. 48 hours, tested casing with 1000 p.s.i. for 30 minutes. Held OK. Drilled plug and tested cement job with 1000 p.s.i. for 30 minutes. Held OK.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Shell Oil Company, Incorporated

Address Box 1457 Hobbs, New Mexico

By Frank E. Lovering

Title District Superintendent