


Form 9-331a
(Feb. 1951)

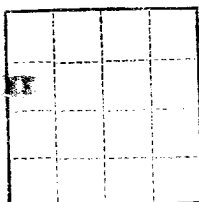

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office _____

Lease No. 10 - 004900

Unit _____

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

June 1, 1955

Well No. 8-17 is located 330 ft. from N line and 330 ft. from E line of sec. 17

W/4 Section 17 7-17-8 8-12-8 R.M.I.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)

Captrock Survey Clayton New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 4137 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drilled 7-7/8" hole to 3132' and cemented 5-1/2" O.D., 14#, J-55, main casing at 3131.75' with 800 cu. ft. of cement, plus 200 cu. ft. of Strat-Crete added.
Waited on cement 24 hours, nippled up and tested casing with 1000# pressure for 30 minutes - O.K.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Valon Oil Company of California

Address 219 West Texas Avenue

Midland, Texas

By R.W. Gailor

Title Drilling Rep.