

NEW MEXICO OIL CONSERVATION COMMISSION

FORM C-103
(Rev 3-55)

MISCELLANEOUS REPORTS ON WELLS

(Submit to appropriate District Office as per Commission Rule 1106)

Name of Company Geror Oil Corporation		Address 1846 East Broadway, Tucson, Arizona				
Lease State	Well No. 10	Unit Letter E	Section 26	Township 13S	Range 31E	
Date Work Performed 4-3-59	Pool Caprock-Queen			County Chaves		

THIS IS A REPORT OF: (Check appropriate block)

- ☐ Beginning Drilling Operations ☐ Casing Test and Cement Job ☒ Other (Explain): **Sand-frac**
☐ Plugging ☒ Remedial Work

Detailed account of work done, nature and quantity of materials used, and results obtained.

Well stopped pumping - pulled rods and changed pump - no results. Pulled rods and tubing - two joints tubing and perforated sub came unscrewed below seating nipple. Fished out tubing and perforated sub. Sand pumped well and cleaned out fill up. Treated with 55,000 # 10-20 sand and 713 barrels lease oil. Used 400# adomite. Treated by Dowell, Inc.

Witnessed by Frank Loop	Position Engineer	Company Dowell, Inc.
-----------------------------------	-----------------------------	--------------------------------

FILL IN BELOW FOR REMEDIAL WORK REPORTS ONLY

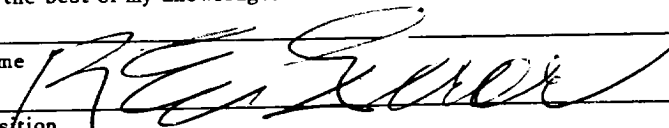
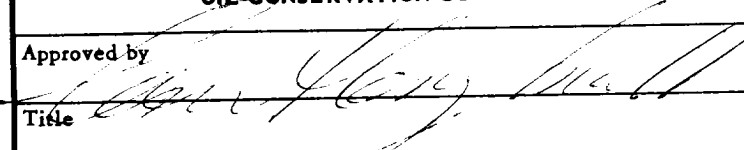
ORIGINAL WELL DATA

D F Elev. 4421	T D 3055.5	P BTD O. H.	Producing Interval 3038-3055	Completion Date 2-25-55
Tubing Diameter 2 3/8	Tubing Depth 3037	Oil String Diameter 5 1/2 O. D.	Oil String Depth 3036	
Perforated Interval(s) O. H.				
Open Hole Interval 3036 to 3055			Producing Formation(s) Queen	

RESULTS OF WORKOVER

Test	Date of Test	Oil Production BPD	Gas Production MCFPD	Water Production BPD	GOR Cubic feet/Bbl	Gas Well Potential MCFPD
Before Workover	Not tested - tubing unscrewed					
After Workover	4-13-59	53	not tested	none		

I hereby certify that the information given above is true and complete to the best of my knowledge.

OIL CONSERVATION COMMISSION		Name 	
Approved by 		Position President	
Date		Company Geror Oil Corporation	