


Form 9-331a
(Feb. 1961)

(SUBMIT IN TRIPLICATE)

Land Office Las Cruces

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Lease No. 12 068,74
Unit Government "B"
City Service Oil Co.

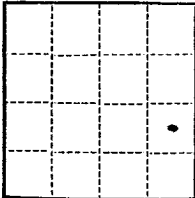

SUNDRY NOTICES AND REPORTS ON WELLS

| | | |
|---|---|-------------------------------------|
| NOTICE OF INTENTION TO DRILL..... | SUBSEQUENT REPORT OF WATER SHUT-OFF..... | <input checked="" type="checkbox"/> |
| NOTICE OF INTENTION TO CHANGE PLANS..... | SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING..... | |
| NOTICE OF INTENTION TO TEST WATER SHUT-OFF..... | SUBSEQUENT REPORT OF ALTERING CASING..... | |
| NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL..... | SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR..... | |
| NOTICE OF INTENTION TO SHOOT OR ACIDIZE..... | SUBSEQUENT REPORT OF ABANDONMENT..... | |
| NOTICE OF INTENTION TO PULL OR ALTER CASING..... | SUPPLEMENTARY WELL HISTORY..... | |
| NOTICE OF INTENTION TO ABANDON WELL..... | | |

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

September 14, 19 54

Well No. 9 is located 1980 ft. from AS line and 660 ft. from E line of sec. 3
NE SE 3 14S 31E 107N
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Criskey-Coon (Ext.) Chaves New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 4421 ft. 02

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

This well was drilled to a total depth of 3033' in anhydrite. Ran 96 4/10 joints of 5 1/2" OD 14.5 lb J-55 SS casing, 3031' set at 3033' and cemented with 200 sacks of neat cement. Plug was down at 4:30 A.M. 9-9-54. Cement was allowed to set until 10:00 P.M. 9-12-54 while attempting to reclaim 8 5/8" OD 24.5 lb J-55 SS casing which was stuck in hole. Application to drill stated that 8 5/8" casing would be reclaimed. However, 518' was all that could be pulled. Water shut-off on 5 1/2" casing was tested and was found to be satisfactory. Drilling resumed.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Cities Service Oil Company
Address Box 97
Hobbs, New Mexico
By [Signature]
Title Asst. Division Supt.