

## N. M. OIL CONS. COMMISSION

P. O. BOX 19

HOBBS, NEW MEXICO 88240

Form 9-331  
(May 1963)UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE\*  
(Other instructions on re-  
verse side)Form approved.  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 0478452

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Federal - 5

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Vest Ranch-Qn.Assoc.

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

5-15S-30E

12. COUNTY OR PARISH 13. STATE

Chaves

NM

## SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐

2. NAME OF OPERATOR  
Dalport Oil Corp.

3. ADDRESS OF OPERATOR  
3471 First National Bank Bldg., Dallas, Tx 75202

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)  
At surface  
660' FN & EL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

## 16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

## NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON\* ☐CHANGE PLANS ☐

## SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT\* ☒

Final cleanup

(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

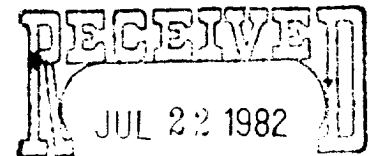
Original info:

TD 2211, PBDT 2177; 8-5/8 - 20# at 314'/175 Sx; 2-7/8" - 6.5#  
at 2206/275 Sx; perfs 2108-1/2-20.

5-13-82 Spotted 15 Sx cem. 2075-2125.

5-14-82 Shot off 2-7/8" at 410'. Pulled 410' of 2-7/8". Spotted 50 Sx  
260-450'. Mud between plugs.5-15-82 Tagged top of plug at 260'. Spotted 10 Sx at surface.  
Installed marker showing location. Cleaned location.

Ready for inspection.

OIL & GAS  
U.S. GEOLOGICAL SURVEY  
ROSWELL, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED

*Jean M. [Signature]*

TITLE

Geologist

DATE

7-16-82

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

APPROVED  
PETER W. CHESTER

JUL 30 1985

BUREAU OF LAND MANAGEMENT  
ROSWELL RESOURCE AREA

\*See Instructions on Reverse Side

RECEIVED

AUG -1 1963

100-100000-100000