

N. M. OIL CONS. COMMISSION

P. O. BOX 1980

HOBBS, NEW MEXICO 88240

UNITED STATES OF AMERICA, NM

DEPARTMENT OF THE INTERIOR

GEOLOGICAL SURVEY

Form Approved.  
Budget Bureau No. 42-R1424

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☒ gas ☐ other ☐  
well well

2. NAME OF OPERATOR

Yates Petroleum Corporation

3. ADDRESS OF OPERATOR

207 South 4th St., Artesia, NM 88210

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE: 1980 FNL 1980 FWL, Sec. 12-8S-31E

AT TOP PROD. INTERVAL:

AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

CHANGE ZONES ☐

ABANDON\* ☐

(other) ☐

5. LEASE

NM 15894 - A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Champlin UL Federal

9. WELL NO.

1

10. FIELD OR WILDCAT NAME

Und. Tomahawk SA

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Unit F, Sec. 12-T8S-R31E

12. COUNTY OR PARISH

Chaves

13. STATE

NM

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

4410' GR

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

TD 1682'. Ran 42 joints of 8-5/8" 24# J-55 casing set at 1682'. 1-Texas Pattern guide shoe set 1682'. Insert float set 1641'. Cemented w/400 sacks Halliburton Lite with 1/4# sacks Flocele and 3% CaCl<sub>2</sub>. Tailed in w/300 sacks Class "C" with 3% CaCl<sub>2</sub>. Compressive strength of cement - 1250 psi in 12 hours. PD 7:30 PM 7-2-82. Bumped plug to 1000 psi, released pressure and float held okay. Cement circulated 25 sacks. WOC. Drilled out 9:00 AM 7-4-82. WOC 37-1/2 hours. Nipped up and tested to 1000 psi, okay. Reduced hole to 7-7/8". Drilled plug and resumed drilling.

Subsurface Safety Valve: Manu. and Type

Set @ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Peter W. Chester TITLE Engineering Secty DATE 7-8-82

ACCEPTED FOR RECORD

PETER W. CHESTER


(This space for Federal or State office use)

APPROVED BY  
CONDITIONS OF APPROVAL

SEP 3 1982

U.S. GEOLOGICAL SURVEY  
ROSWELL, NEW MEXICO

\*See Instructions on Reverse Side

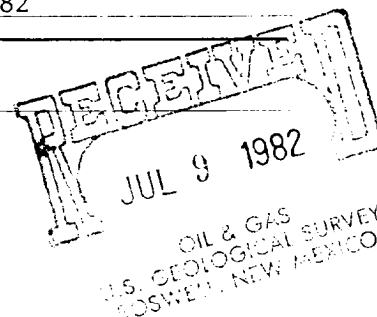

RECEIVED  
SEP 7 1982  
G.C.C.  
HOBBS OFFICE