

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☒ gas ☐ other ☐
well well
2. NAME OF OPERATOR
Yates Petroleum Corporation
3. ADDRESS OF OPERATOR
207 South 4th St., Artesia, NM 88210
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 990 FSL & 990 FWL, Sec. 19-7S-30E
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA


REQUEST FOR APPROVAL TO:	SUBSEQUENT REPORT OF:
TEST WATER SHUT-OFF <input type="checkbox"/>	<input checked="" type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	<input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	<input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	<input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	<input type="checkbox"/>
MULTIPLE COMPLETE <input type="checkbox"/>	<input type="checkbox"/>
CHANGE ZONES <input type="checkbox"/>	<input type="checkbox"/>
ABANDON* <input type="checkbox"/>	<input type="checkbox"/>
(other) <input type="checkbox"/>	<input type="checkbox"/>

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give approximate dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Spudded 12-1/4" hole 3:00 PM 3-18-84. Ran 9 jts of 8-5/8" 24# J-55 casing set 357'. 1-Texas Pattern notched guide shoe set 357'. Insert float set 317'. Cemented w/250 sacks Class "C" 2% CaCl₂. Compressive strength of cement - 1250 psi in 12 hrs. PD 9:00 PM 3-18-84. Bumped plug to 1000 psi, released pressure and float held okay. Cement circulated 25 sacks. WOC.
Drilled out 9:00 AM 3-19-84. WOC 12 hrs. Nippled up and tested to 1000# for 30 minutes, OK. Reduced hole to 7-7/8". Drilled plug and resumed drilling.

5. LEASE
NM 20364
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME
Pendleton ZB Federal
9. WELL NO.
1
10. FIELD OR WILDCAT NAME
Wildcat San Andres
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Unit M, Sec. 19-T7S-R30E
12. COUNTY OR PARISH
Chaves
13. STATE
NM
14. API NO.
15. ELEVATIONS (SHOW DF, KDB, AND WD)
4097' GR

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

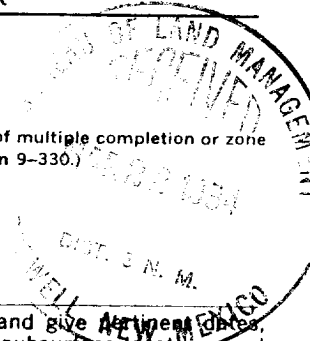

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Peter W. Chester TITLE Production Supervisor DATE 3-20-84

APPROVED BY PETER W. CHESTER TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: APR 9 1984



RECEIVED

APR 17 1984

O.C.D.
HOBBS OFFICE