



STATE OF NEW MEXICO
ENERGY, MINERALS AND NATURAL RESOURCES DEPARTMENT
OIL CONSERVATION DIVISION
HOBBS DISTRICT OFFICE

GOVERNOR

April 24, 1996

POST OFFICE BOX 1980
HOBBS, NEW MEXICO 88241-1980
(505) 393-6161

Ensearch Expl Inc

6 Desta Dr, Suite 5250

Midland, TX 79705

Gentlemen:

Form C-103, Report of Plugging, for your Annie Harvey #1-J 6-5s-33e cannot be approved until a Division representative has made an inspection of the location and found it to be cleared to comply with Division Rules and Regulations. Please check each item in the space provided to indicate that the work has been done.

- () 1. All pits have been filled and levelled
- () 2. Rat hole and cellar have been filled and levelled.
- () 3. A steel marker 4" in diameter and approximately 4' above ground level has been set in concrete. It must show the OPERATOR, LEASE NAME, WELL NUMBER, QUARTER/QUARTER SECTION OR UNIT LETTER DESIGNATION, SECTION, TOWNSHIP, and RANGE which have been permanently stenciled or welded on the marker.
- () 4. The location has been levelled as nearly as possible to original top ground contour and has been cleared of all junk and equipment.
- () 5. The dead men and tie downs have been cut and removed.
- () 6. If a one-well lease or last remaining well on lease, the battery and burn pit locations have been levelled and cleared of all junk and equipment.

The above are minimum requirements and no plugging bond will be released until all locations for plugged and abandoned wells have been inspected and Form C-103 approved. When all of the work outlined above has been done, please notify this office by filling in the blank form below and returning this letter to us so that our representative will not have to make more than one trip to the location.

Very truly yours,

OIL CONSERVATION DIVISION

Jerry Sexton

Jerry Sexton, Supervisor, Dist. I


FILL IN BELOW AND RETURN TO: Oil Conservation Division, P.O. Box 1980, Hobbs, NM 88241

I certify that the above work has been done and the well referenced above is ready for your inspection and approval.

OPERATOR

DATE

NAME AND TITLE

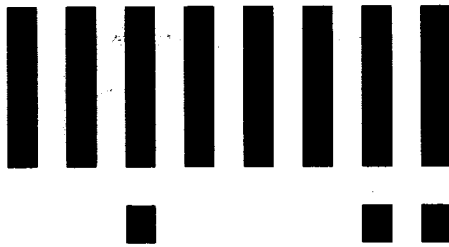

LTR



Job separation sheet

**WEST TEXAS DISTRICT
WEEKLY DRILLING REPORT**

LEASE: ANNIE HARVEY #1 FIELD: DORA (PENN) &
PETERSON (MISS)
COUNTY: ROOSEVELT STATE: NEW MEXICO

API #30-041-20558

EEI W.I.: 100%

(COMMINGLED-DORA/PENN & PETERSON/MISS IN JUNE 1982)

3-15-96: **INITIAL REPORT TO PLUG AND ABANDON WELL**
MIRU. UNSEATED PUMP. SDFN.

3-16-96: FINISHED LAYING DOWN RODS AND PUMP. STOOD BACK 20
STANDS OF TBG. SDFN.

3-17 & 3-18-96: SHUT DOWN FOR WEEKEND.

3-19-96: STOOD BACK REST OF TBG. PU BRIDGE PLUG. RIH TO
8096' & SET BRIDGE PLUG. MUD PUMP BROKE DOWN. SDFN.

3-20-96: LOADED HOLE W/180 BBLs. MUD LADEN FLUID (90 SXS.
SALT GEL). SPOTTED 25 SX. CEMENT ON TOP OF BP @ 8096'.
LAID DOWN 50 JTS. TBG. (@ 6550'). PUMPED 25 SX. CEMENT (@
6300'). STOOD BACK 60 STANDS, LAID REST OF TBG. DOWN. ND
WH. WELDED ON PULL NIPPLE. TOOK STRETCH ON 5-1/2" CSG.
CUT CSG. @ 3378'. LAID DOWN 30 JTS. SDFN.

3-21-96: FINISHED LAYING DOWN CASING, TOTAL 87 JTS. RIH TO
3350'. PUMPED 45 SX. CEMENT. WAITED 3 HRS. TAGGED @
3358', ADDED 45 SX. PULLED UP TO SHOE PLUG @ 1900'. PUMPED
80 SX., TAGGED LOW. ADDED 45 SX. TOTAL OF 125 SX. ON 9-
5/8" SHOE. PUMPED 35 SX. CEMENT @ 400'-300'. PUMPED 10 SX.
CEMENT @ SURFACE. PREPARING TO CLOSE PIT & PUT UP DRY HOLE
MARKER (PROBABLY 3-27-96).

3-28-96: COVERED PIT & INSTALLED DRY HOLE MARKER.
WELL PLUGGED AND ABANDONED. (COST: SALVAGE)

FINAL REPORT